

Model 2110 5½ Digit Multimeter

Reference Manual

2110-901-01 Rev. B / July 2012

Model 2110
5½ Digit Multimeter
Reference Manual

© 2008-2012, Keithley Instruments, Inc.

Cleveland, Ohio, U.S.A.

All rights reserved.

Any unauthorized reproduction, photocopy, or use the information herein, in whole or in part, without the prior written approval of Keithley Instruments, Inc. is strictly prohibited.

All Keithley Instruments product names are trademarks or registered trademarks of Keithley Instruments, Inc. Other brand names are trademarks or registered trademarks of their respective holders.

Document number: 2110-901-01 Rev. A / July 2012

The following safety precautions should be observed before using this product and any associated instrumentation. Although some instruments and accessories would normally be used with nonhazardous voltages, there are situations where hazardous conditions may be present.

This product is intended for use by qualified personnel who recognize shock hazards and are familiar with the safety precautions required to avoid possible injury. Read and follow all installation, operation, and maintenance information carefully before using the product. Refer to the user documentation for complete product specifications.

If the product is used in a manner not specified, the protection provided by the product warranty may be impaired.

The types of product users are:

Responsible body is the individual or group responsible for the use and maintenance of equipment, for ensuring that the equipment is operated within its specifications and operating limits, and for ensuring that operators are adequately trained.

Operators use the product for its intended function. They must be trained in electrical safety procedures and proper use of the instrument. They must be protected from electric shock and contact with hazardous live circuits.

Maintenance personnel perform routine procedures on the product to keep it operating properly, for example, setting the line voltage or replacing consumable materials. Maintenance procedures are described in the user documentation. The procedures explicitly state if the operator may perform them. Otherwise, they should be performed only by service personnel.

Service personnel are trained to work on live circuits, perform safe installations, and repair products. Only properly trained service personnel may perform installation and service procedures.

Keithley Instruments products are designed for use with electrical signals that are rated Measurement Category I and Measurement Category II, as described in the International Electrotechnical Commission (IEC) Standard IEC 60664. Most measurement, control, and data I/O signals are Measurement Category I and must not be directly connected to mains voltage or to voltage sources with high transient overvoltages. Measurement Category II connections require protection for high transient overvoltages often associated with local AC mains connections. Assume all measurement, control, and data I/O connections are for connection to Category I sources unless otherwise marked or described in the user documentation.

Exercise extreme caution when a shock hazard is present. Lethal voltage may be present on cable connector jacks or test fixtures. The American National Standards Institute (ANSI) states that a shock hazard exists when voltage levels greater than 30 V RMS, 42.4 V peak, or 60 VDC are present. A good safety practice is to expect that hazardous voltage is present in any unknown circuit before measuring.

Operators of this product must be protected from electric shock at all times. The responsible body must ensure that operators are prevented access and/or insulated from every connection point. In some cases, connections must be exposed to potential human contact. Product operators in these circumstances must be trained to protect themselves from the risk of electric shock. If the circuit is capable of operating at or above 1000 V, no conductive part of the circuit may be exposed.

Do not connect switching cards directly to unlimited power circuits. They are intended to be used with impedance-limited sources. NEVER connect switching cards directly to AC mains. When connecting sources to switching cards, install protective devices to limit fault current and voltage to the card.

Before operating an instrument, ensure that the line cord is connected to a properly-grounded power receptacle. Inspect the connecting cables, test leads, and jumpers for possible wear, cracks, or breaks before each use.

When installing equipment where access to the main power cord is restricted, such as rack mounting, a separate main input power disconnect device must be provided in close proximity to the equipment and within easy reach of the operator.

For maximum safety, do not touch the product, test cables, or any other instruments while power is applied to the circuit under test. ALWAYS remove power from the entire test system and discharge any capacitors before: connecting or disconnecting cables or jumpers, installing or removing switching cards, or making internal changes, such as installing or removing jumpers.

Do not touch any object that could provide a current path to the common side of the circuit under test or power line (earth) ground. Always make measurements with dry hands while standing on a dry, insulated surface capable of withstanding the voltage being measured.


The instrument and accessories must be used in accordance with its specifications and operating instructions, or the safety of the equipment may be impaired.


Do not exceed the maximum signal levels of the instruments and accessories, as defined in the specifications and operating information, and as shown on the instrument or test fixture panels, or switching card.


When fuses are used in a product, replace with the same type and rating for continued protection against fire hazard.


Chassis connections must only be used as shield connections for measuring circuits, NOT as safety earth ground connections.

If you are using a test fixture, keep the lid closed while power is applied to the device under test. Safe operation requires the use of a lid interlock.


If a  screw is present, connect it to safety earth ground using the wire recommended in the user documentation.

The  symbol on an instrument means caution, risk of danger. The user should refer to the operating instructions located in the user documentation in all cases where the symbol is marked on the instrument.

The  symbol on an instrument means caution, risk of electric shock. Use standard safety precautions to avoid personal contact with these voltages.

The  symbol on an instrument shows that the surface may be hot. Avoid personal contact to prevent burns.

The  symbol indicates a connection terminal to the equipment frame.

If this  symbol is on a product, it indicates that mercury is present in the display lamp. Please note that the lamp must be properly disposed of according to federal, state, and local laws.

The **WARNING** heading in the user documentation explains dangers that might result in personal injury or death. Always read the associated information very carefully before performing the indicated procedure.

The **CAUTION** heading in the user documentation explains hazards that could damage the instrument. Such damage may invalidate the warranty.

Instrumentation and accessories shall not be connected to humans.

Before performing any maintenance, disconnect the line cord and all test cables.

To maintain protection from electric shock and fire, replacement components in mains circuits — including the power transformer, test leads, and input jacks — must be purchased from Keithley Instruments. Standard fuses with applicable national safety approvals may be used if the rating and type are the same. Other components that are not safety-related may be purchased from other suppliers as long as they are equivalent to the original component (note that selected parts should be purchased only through Keithley Instruments to maintain accuracy and functionality of the product). If you are unsure about the applicability of a replacement component, call a Keithley Instruments office for information.

To clean an instrument, use a damp cloth or mild, water-based cleaner. Clean the exterior of the instrument only. Do not apply cleaner directly to the instrument or allow liquids to enter or spill on the instrument. Products that consist of a circuit board with no case or chassis (e.g., a data acquisition board for installation into a computer) should never require cleaning if handled according to instructions. If the board becomes contaminated and operation is affected, the board should be returned to the factory for proper cleaning/servicing.

Table of Contents

Introduction.....	1-1
Welcome	1-1
Contact information	1-1
CD-ROM contents.....	1-2
Organization of manual sections.....	1-2
Capabilities and features.....	1-3
Measurement ranges and functions	1-3
Mathematical operations	1-4
Startup software and PC utilities	1-4
Standard accessories.....	1-4
Optional accessories.....	1-4
General information.....	1-5
Displaying the instrument's serial number.....	1-5
Dimensions	1-5
Power-on settings	1-6
General specifications.....	1-7
General overview	2-1
Turning your instrument on and off.....	2-1
Procedure.....	2-1
Front panel overview.....	2-6
(1) Display	2-6
(2) The Power key	2-8
(3) The function and operation keys.....	2-9
(4) RANGE and scroll keys	2-11
(5) TC input	2-11
(6) Terminals and fuses	2-11
(7) Menu overview.....	2-11
Main menu	2-12
Rear panel overview	2-17
(1) Voltmeter complete output terminal (VM COMP).....	2-18
(2) External triggering input terminal (EXT TRIG)	2-18
(3) USB connection	2-18
(4) Protective earth (safety ground).....	2-18
(5) AC line receptacle, power line fuse, and line voltage setting	2-18
(6) Interface port.....	2-19
Rear panel connection details.....	2-19
System operations	2-20
Turning off measurement display	2-20
Turning the beeper off or on.....	2-21
Selecting the initial operating mode	2-22
Selecting the language.....	2-23
Viewing errors in the error queue.....	2-23
Viewing system version.....	2-24
Viewing calibration information.....	2-24
Basic DMM operation	3-1
Basic measurement functions.....	3-1

Voltage measurements	3-1
Ratio measurements	3-4
Current measurements	3-6
Resistance measurements.....	3-9
Frequency and period measurements.....	3-12
Continuity measurements.....	3-15
Diode measurements	3-15
Temperature measurement.....	3-17
Capacitance measurements.....	3-24
Secondary measurement function.....	3-26
Triggering and data buffer.....	3-28
Front panel triggering	3-28
Remote triggering.....	3-30
Trigger settings	3-33
Data buffer	3-37
Enhancing measurement performance.....	3-38
Autozero.....	3-38
Range selection	3-39
Resolution and integration time.....	3-41
Digital filter	3-45
Math operations	3-47
Theory of operation	4-1
AC voltage measurements and crest factor.....	4-1
DMM resistance measurement methods	4-3
Reference junctions	4-4
Real (internal) reference junction	4-4
Simulated reference junction.....	4-4
Accuracy calculations.....	4-5
Calculating DC and AC characteristics accuracy	4-5
Remote commands.....	5-1
Programming syntax	5-1
Command format used in this manual.....	5-1
Common commands.....	5-4
Common command summary	5-5
Common command reference.....	5-6
*CLS — clear status.....	5-6
*ESE <NRf> — event enable command	5-6
*ESE? — event enable query.....	5-6
*ESR? — event status register query.....	5-6
*IDN? — identification query	5-7
*OPC — operation complete command	5-7
*OPC? — operation complete query	5-7
*PSC — power-on status clear	5-8
*PSC? — power-on status clear query.....	5-8
*RST — reset command	5-8
*SRE <NRf> — service request enable command.....	5-9
*SRE? — service request enable command query	5-9
*STB? — status byte query	5-9
*TRG — trigger command.....	5-9
Introduction to SCPI language	5-10
Topic overview	5-10

- SCPI parameter types 5-10
- Query commands 5-11
- Program messages 5-11
- Output Data 5-13
- SCPI signal oriented measurement commands 5-14
 - :CONFigure:<function> [<range>|MIN|MAX|DEF,<resolution>|MIN|MAX|DEF] 5-15
 - :FETCh[1|2]? 5-16
 - :INITiate 5-17
 - :READ[1|2]? 5-17
 - :MEASure[:<function>]? <range>|MIN|MAX|DEF,<resolution>|MIN|MAX|DEF 5-18
- SCPI command subsystem reference 5-19
 - CALCulate subsystem summary 5-20
 - DISPlay subsystem summary 5-21
 - INPUt subsystem summary 5-21
 - SENSe subsystem summary 5-22
 - STATus subsystem summary 5-26
 - SYSTem subsystem summary 5-26
 - TRIGger subsystem summary 5-27
- CALCulate subsystem 5-28
 - CALCulate:AVERage:AVERage? 5-28
 - CALCulate:AVERage:COUNt? 5-28
 - CALCulate:AVERage:MINimum? 5-28
 - CALCulate:AVERage:MAXimum? 5-28
 - CALCulate:DB:REFerence <n>|MIN|MAX 5-29
 - CALCulate:DBM:REFerence <n>|MIN|MAX 5-29
 - CALCulate:FUNCTion <name> 5-30
 - CALCulate:LIMit:LOWer <n>|MIN|MAX 5-30
 - CALCulate:LIMit:UPPer <n>|MIN|MAX 5-31
 - CALCulate:MXB:MBFactor <n>|MIN|MAX 5-31
 - CALCulate:MXB:MMFactor <n>|MIN|MAX 5-32
 - CALCulate:NULL:OFFSet <n>|MIN|MAX 5-32
 - CALCulate:PERCent:TARGeT <n>|MIN|MAX 5-32
 - CALCulate:STATe 5-33
 - DATA:FEED RDG_STORE,'CALCulate'|" 5-33
- DISPlay subsystem 5-34
 - DISPlay 5-34
 - DISPlay:TEXT <a> 5-35
 - DISPlay:TEXT:CLEar 5-35
- INPUt subsystem 5-35
 - INPUt:IMPedance:AUTO 5-36
- SENSe subsystem 5-37
 - [SENSe:]AVERage:COUNt <n>|MIN|MAX 5-37
 - [SENSe:]AVERage:STATe 5-37
 - [SENSe:]AVERage:TCONtrol <name> 5-38
 - [SENSe:]CAPacitance:RANGe <n>|MIN|MAX 5-38
 - [SENSe:]CAPacitance:RANGe:AUTO 5-39
 - [SENSe:]CURRent:AC:RANGe <range>|MIN|MAX 5-39
 - [SENSe:]CURRent:AC:RESolution <n>|MIN|MAX 5-40
 - [SENSe:]CURRent[:DC]:NPLCycles <n>|MIN|MAX 5-41
 - [SENSe:]CURRent[:DC]:RANGe <n>|MIN|MAX 5-41
 - [SENSe:]CURRent[:DC]:RESolution <n>|MIN|MAX 5-42
 - [SENSe:]CURRent:AC:RANGe:AUTO 5-42
 - [SENSe:]CURRent[:DC]:RANGe:AUTO 5-43
 - [SENSe:]DETector:BANDwidth <n>|MIN|MAX 5-43
 - [SENSe:]FRESistance:NPLCycles <n>|MIN|MAX 5-44
 - [SENSe:]FRESistance:RANGe <n>|MIN|MAX 5-44
 - [SENSe:]FRESistance:RANGe:AUTO 5-45

[SENSe:]FREStance:RESolution <n> MIN MAX	5-45
[SENSe:]FREQuency:APERture <n> MIN MAX	5-46
[SENSe:]FREQuency:CURRent:RANGe <n> MIN MAX	5-46
[SENSe:]FREQuency[:VOLTage]:RANGe <n> MIN MAX	5-47
[SENSe:]FREQuency[:VOLTage]:RANGe:AUTO 	5-47
[SENSe:]FUNctIon [1 2] "<function>"	5-48
[SENSe:]PERiod:APERture <n> MIN MAX	5-49
[SENSe:]PERiod:VOLTage:RANGe <n> MIN MAX	5-49
[SENSe:]PERiod:VOLTage:RANGe:AUTO 	5-50
[SENSe:]RESistance:RANGe <n> MIN MAX	5-50
[SENSe:]RESistance:RANGe:AUTO 	5-50
[SENSe:]RESistance:RESolution <n> MIN MAX	5-51
[SENSe:]RESistance:NPLCycles <n> MIN MAX	5-52
[SENSe:]TCouple:RJUNctIon:REAL <n> MIN MAX	5-52
[SENSe:]TCouple:RJUNctIon:RSElect <name>	5-53
[SENSe:]TCouple:RJUNctIon:SIMulated <n> MIN MAX	5-53
[SENSe:]TCouple:TYPE <name>	5-54
[SENSe:]TEMPerature:RTD:ALPHa <n> MIN MAX	5-55
[SENSe:]TEMPerature:RTD:BETA <n> MIN MAX	5-55
[SENSe:]TEMPerature:RTD:DELTA <n> MIN MAX	5-56
[SENSe:]TEMPerature:RTD:TYPE <name>	5-56
[SENSe:]TEMPerature:RTD:RZERo <n> MIN MAX	5-57
[SENSe:]TEMPerature:SPRTD:RZERo <n> MIN MAX	5-57
[SENSe:]TEMPerature:SPRTD:A4 <n> MIN MAX	5-58
[SENSe:]TEMPerature:SPRTD:B4 <n> MIN MAX	5-58
[SENSe:]TEMPerature:SPRTD:AX <n> MIN MAX	5-59
[SENSe:]TEMPerature:SPRTD:BX <n> MIN MAX	5-59
[SENSe:]TEMPerature:SPRTD:CX <n> MIN MAX	5-60
[SENSe:]TEMPerature:SPRTD:DX <n> MIN MAX	5-60
[SENSe:]TEMPerature:TRANsducer <name>	5-61
[SENSe:]UNIT <name>	5-61
[SENSe:]VOLTage:AC:RANGe <n> MIN MAX	5-62
[SENSe:]VOLTage:AC:RANGe:AUTO 	5-62
[SENSe:]VOLTage:AC:RESolution <n> MIN MAX	5-63
[SENSe:]VOLTage[:DC]:RANGe <n> MIN MAX	5-63
[SENSe:]VOLTage[:DC]:RANGe:AUTO 	5-64
[SENSe:]VOLTage[:DC]:NPLCycles <n> MIN MAX	5-64
[SENSe:]VOLTage[:DC]:RESolution <n> MIN MAX	5-65
[SENSe:]ZERO:AUTO <name>	5-65
SYSTem subsystem	5-66
:BEEPer 	5-66
:DATA:POINts?	5-66
SYSTem:ERRor?	5-66
SYSTem:VERsion?	5-67
SYSTem:LOCal	5-67
SYSTem:REMote	5-67
TRIGger subsystem	5-67
SAMPlE:COUNt <n> MIN MAX	5-68
TRIGger:COUNt <n> MIN MAX INFinite	5-68
TRIGger:DELay <n> MIN MAX	5-69
TRIGger:DELay:AUTO 	5-69
TRIGger:SOURce <name>	5-70
Troubleshooting guide	6-1
Troubleshooting	6-1
Running a self-test	6-2
Error codes	6-3

Next steps 7-1
 Additional Model 2110 information..... 7-1

Maintenance A-1
 Line fuse replacement..... A-1
 Current input fuse replacement..... A-4
 Upgrading the firmware..... A-5

Status model B-1
 Overview B-1
 Status byte and SRQ B-1
 Status register sets B-1
 Error Queue and Output Buffer B-2
 Clearing registers and queues B-3
 Programming enable registers..... B-3
 Reading registers B-4
 Status byte and service request (SRQ) B-4
 Status Byte Register B-4
 Service request B-5
 Status structure B-6
 Using serial polling and SRQ B-6
 Status byte and service request commands..... B-7
 Status register sets B-8
 Standard Event Register B-9
 Questionable Data Register B-10
 Status reporting command summary..... B-11

Communication interface C-1
 Communication interfaces..... C-1
 Selecting an interface..... C-1
 USB communications..... C-1
 GPIB setup..... C-8
 Supplied software..... C-12
 Keithley I/O layer..... C-15
 Addressing instruments with VISA C-18

Introduction

In this section:

Welcome	1-1
Contact information	1-1
CD-ROM contents	1-2
Organization of manual sections	1-2
Capabilities and features	1-3
General information	1-5

Welcome

Thank you for using a Keithley Instruments product. The Model 2110 Digit Multimeter (DMM) features 12 measurement functions and 7 math functions, and has dual-line display capability, which allows it to display two different measurements concurrently.

The Model 2110 provides superior measurement accuracy and speed necessary for a broad range of applications, ranging from production testing to bench-top applications. The Model 2110 meets application requirements for production engineers, research and development engineers, test engineers, scientists, students and anyone else making measurements in either system applications or on the bench.

Contact information

If you have any questions after reviewing this information, please use the following sources:

1. [Keithley Instruments website](http://www.keithley.com) (<http://www.keithley.com>).
2. [Keithley web forum](http://forum.keithley.com) (<http://forum.keithley.com>).
3. Call Keithley Instruments corporate headquarters (toll-free inside the U.S. and Canada only) at 1-888-KEITHLEY (1-888-534-8453), or from outside the U.S. at +1-440-248-0400. For worldwide contact numbers, visit the [Keithley Instruments website](http://www.keithley.com) (<http://www.keithley.com>).

CD-ROM contents

A CD-ROM is shipped with each Model 2110 order.

The Model 2110 Product Information CD-ROM contains:

- **Reference Manual:** Includes a description of connections, operation information, programming information, and maintenance information. Users looking for basic operating information, programmers looking for a command reference, and users looking for an in-depth description of the way the instrument works (including troubleshooting and optimization) should refer to the Reference Manual.
- **Calibration Manual:** Includes procedures to verify that the Model 2110 accuracy is within the limits stated in the instrument's one-year accuracy specifications.
- **Drivers and release notes:** IVI Instrument Driver, driver for National Instruments LabVIEW™, and related release notes.
- **Keithley I/O layer and release notes.**
- **Start-up Software and PC Utilities:** Includes KI-Tool and KI-Link application and Microsoft® Excel Add-In utility.
- **Additional product information:** The product specifications are also included on the CD-ROM.

For the latest drivers and additional support information, see the [Keithley Instruments website](http://www.keithley.com) (<http://www.keithley.com>).

Organization of manual sections

The information in this manual is organized into the following major categories:

- **General overview:** Describes the components of the instrument and basic operation.
- **Basic DMM operation:** Introduces some basic measurement functions of the instrument. You will learn how to use your instrument to measure voltage, current, resistance, frequency, period, continuity, diodes, capacitance, and temperature. You will learn about triggering and data buffering. You will also learn about enhancing measurement performance.
- **Theory of operation:** Describes basic DMM measurement techniques and concepts.
- **Remote commands:** Describes the IEEE Std 488.2 common commands. Provides an alphabetical listing of all commands available for the Model 2110. Provides information about using remote commands to control the instrument.
- **Troubleshooting guide:** Describes self-test procedure and error codes.
- **Maintenance:** Information on instrument maintenance, including line fuse replacement and firmware upgrades.
- **Status model:** Description of the Model 2110 status model.

Bookmarks for each section of this manual are provided in the PDF version of the documentation. The manual sections are also listed in the Table of Contents located at the beginning of this manual.

For more information about bookmarks, see Adobe® Acrobat® or Reader® help.

Capabilities and features

The Keithley Instruments Model 2110 is a rugged and versatile 5½-digit resolution digital multimeter with a dual-line vacuum fluorescent display (VFD), built-in USB interface, and optional GPIB interface.

The Model 2110 has 0.0012% one-year basic DC voltage accuracy and 0.020% one-year basic resistance accuracy up to the 1 MΩ range. At 5½ digits, the Model 2110 delivers over 200 readings via the USB remote interface. At the fast 4½ digit setting, it reads up to 50,000 readings. This is ideal for production applications and monitoring applications, where speed is critical.

Figure 1: Keithley Model 2110 5 ½ Digit Multimeter



Measurement ranges and functions

The Model 2110 provides a wide number of measurement ranges and functions including:

- DC voltage: 0.1 V, 1 V, 10 V, 100 V, and 1000 V
- AC voltage: 0.1 V, 1 V, 10 V, 100 V, and 750 V
- DC current: 10 mA, 100 mA, 1 A, and 10 A
- AC current: 1 A, 3 A, and 10 A
- Two and 4-wire resistance: 100 Ω, 1 kΩ, 10 kΩ, 100 kΩ, 1 MΩ, 10 MΩ, and 100 MΩ
- Frequency: 3 Hz to 300 kHz
- Capacitance measurement: 1 nF, 10 nF, 100 nF, 1 μF, 10 μF, 100 μF, 1 mF, 10 mF
- Temperature measurement using RTDs, thermistors, and thermocouples (direct measurement using built-in cold junction compensation to improve accuracy); supports J-, R-, S-, T-, E-, N-, B-, C-, and K-type thermocouples
- Period measurement
- Diode measurement
- Continuity measurement
- Programmable A-D converter and filter settings for signal-to-noise optimization

Mathematical operations

The Model 2110 allows you to perform the following seven mathematical operations on measurement readings: Percentage, Average (Min/Max, Count), NULL, Limits, $mX+b$, dB, and dBm testing.

Startup software and PC utilities

The following start-up software and PC utilities are included:

- KI-Tool and KI-Link software allow you to quickly control the instrument over GPIB (if equipped) or USB, record measurements, and display time-series plots of the data. KI-Link is an add in for Microsoft® Word and Microsoft Excel.
- LabVIEW™ and IVI drivers allow more advanced customers even more control over the instrument.

Standard accessories

The following standard accessories are supplied with the Model 2110.

- Safety test leads
- USB cable
- Power cable

Optional accessories

The following optional accessories are available for the Model 2110.

Keithley part number	Optional accessory
4299-3	Single Rack Mount Kit
4299-4	Dual Rack Mount Kit
8605	High Performance Modular Test Leads
8606	High Performance Modular Probe Kit
5805	Kelvin Probes, 0.9 m (3 ft)
5805-12	Kelvin Probes, 3.6 m (12 ft)
5808	Low Cost, Single Pin, Kelvin Probes
5809	Low Cost, Kelvin Clip Lead Set
8680	RTD Probe Adapter
8681	Low Cost RTD
7007-1	Shielded GPIB Cable, 1 m (3.3 ft)
7007-2	Shielded GPIB Cable, 2 m (6.6 ft)
6517-TP	Thermocouple Bead Probe (K-Type)

General information

Displaying the instrument's serial number

To display the serial number on the front panel:


1. If the Model 2110 is in remote operation, press the **SHIFT** (LOCAL) key once to place the instrument in local operation.
2. Press the **SHIFT** key.
3. Press the **CONFIGURE** key. The display shows MENU.
4. Use the right and left **RANGE** keys to display SYSTEM.
5. Press the **ENTER** key.
6. Use the right and left **RANGE** keys to display SERIAL.
7. Press the **ENTER** key. The display shows the serial number on the second row.

Dimensions

The following figure shows dimensions for the Model 2110. The figure includes designators to indicate:

1. Dimensions without the handle and the front and rear bumpers.
2. Dimensions with the handle and the front and rear bumpers.
3. Dimensions with the front and rear bumpers, but without the handle.

Figure 2: Dimensions

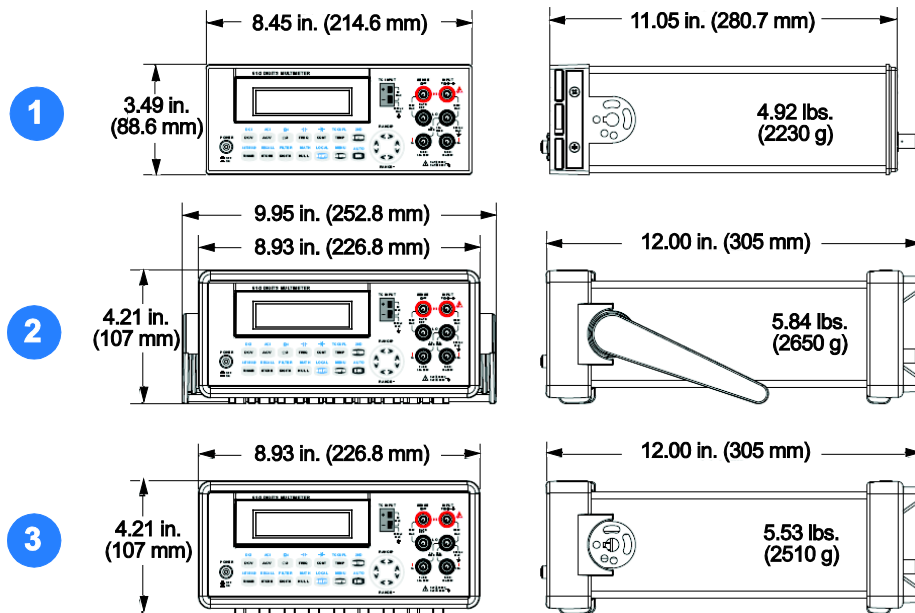

Power-on settings

See the following table for information about the Model 2110 factory default settings. These settings are also restored when the instrument is turned on and when the instrument receives a *RST command from a remote interface.

Function		Default
Function displayed after the instrument is turned on		DC voltage
Auto zero		ON
Frequency and period source		AC voltage
Output format		ASCII
Ratio		OFF
AC voltage	Frequency	20 Hz
	AC digits	5.5
	Range	10 V
DC voltage	DC digits	5.5 (1 PLC)
	Range	1 V
AC current	Frequency	20 Hz
	AC digits	5.5
	Range	1 A
DC current	DC digits	5.5 (1 PLC)
	Range	1 A
Frequency and period	Digits	5.5
	Range	10 V
	Gate time	0.1 s
Capacitance	Digits	4.5
	Range	10 nF
Diode test	Digits	5.5
	Range	1 mA
	Rate	0.2 PLC
Resistance	Digits	5.5 (1 PLC)
	Range	1 k Ω
Temperature	Digits	4.5 (1 PLC)
	Thermocouple	K type
Triggers	Source	Immediate
	Delay	Auto
Input resistance		10 M Ω

General specifications

Item	Limitation and description
Input bias current	<30pA at 25 °C
Input protection	1000V all ranges (2W input)
AC CMRR	70 dB (for 1 kΩ unbalanced LO lead)
Power supply	100 V/120 V/220 V/240 V ±10%
Power line frequency	50/60 Hz auto detected ±10%
Power consumption	25 VA max
Digital I/O interface	USB-compatible type B connection, GPIB (optional)
Environment	For indoor use only
Operating temperature	0 °C to 40 °C
Operating humidity	Maximum relative humidity 80% for temperature up to 31 °C
Storage temperature	-40 °C to 70 °C
Operating altitude	Up to 2000 m above sea level
Bench dimensions (with handles and bumpers)	107 mm high × 252.8 mm wide × 305 mm deep (3.49 in. × 9.95 in. × 12.00 in.)
Weight	2.23 kg (4.92 lb)
Safety	Conforms to European Union Low Voltage Directive UL 61010-1
EMC	Conforms to European Union EMC Directive
Warranty	One year

General overview

In this section:

Turning your instrument on and off	2-1
Front panel overview	2-6
Rear panel overview	2-17
System operations	2-20

Turning your instrument on and off

The following topics describe how to power your instrument on and off, place an instrument in standby, and configure the line frequency.

Proper ventilation is required to keep the 5½ Digit Multimeter from overheating. Even with proper ventilation, the Model 2110 can overheat if the ambient temperature is too high or the 5½ Digit Multimeter is operated in sink mode for long periods of time. The 5½ Digit Multimeter has an over-temperature protection circuit that will turn the output off if the instrument overheats. When the over-temperature protection circuit turns the output off, a message indicating this condition is displayed. You cannot turn the output on until the instrument cools down.

To prevent damaging heat build-up and ensure specified performance, make sure there is adequate ventilation and air flow around the instrument to ensure proper cooling.

Procedure

Follow the procedure below to connect the Model 2110 to line power and to turn on the instrument. The Model 2110 operates from a line voltage of 100 V to 240 V at a frequency of 50 Hz or 60 Hz. Line voltage is set on the rear panel. Make sure the operating voltage in your area is compatible.



CAUTION

Operating the instrument on an incorrect line voltage may cause damage to the instrument, possibly voiding the warranty.



CAUTION

Remove voltage from the front panel input terminals before switching the equipment off. Failure to do so could result in the equipment being damaged.

To turn a Model 2110 on and off:

1. Before plugging in the power cord, make sure that the front-panel **POWER** switch is in the **OFF** position.
2. Connect the Model 2110 protective earth (safety ground) located on the rear panel (see [Rear panel overview](#) (on page 2-17)).
3. Connect the female end of the supplied power cord to the AC receptacle on the rear panel.
4. Connect the male end of the power cord to a grounded AC outlet.

**WARNING**

The power cord supplied with the Model 2110 contains a separate protective earth (safety ground) wire for use with grounded outlets. When proper connections are made, the instrument chassis is connected to power-line ground through the ground wire in the power cord. In addition, a redundant protective earth connection is provided through a screw on the rear panel. In the event of a failure, not using a properly grounded protective earth or grounded outlet may result in personal injury or death due to electric shock.


5. To turn your instrument on, press the front-panel **POWER** switch to place it in the ON position.
6. To turn your instrument off, press the front-panel **POWER** switch to place it in the OFF position.

Voltage selection**WARNING**


Before changing the voltage setting, ensure that the instrument is disconnected from the AC power.

To set the line voltage:

1. Verify that the instrument is disconnected from AC power, as shown in the following figure.

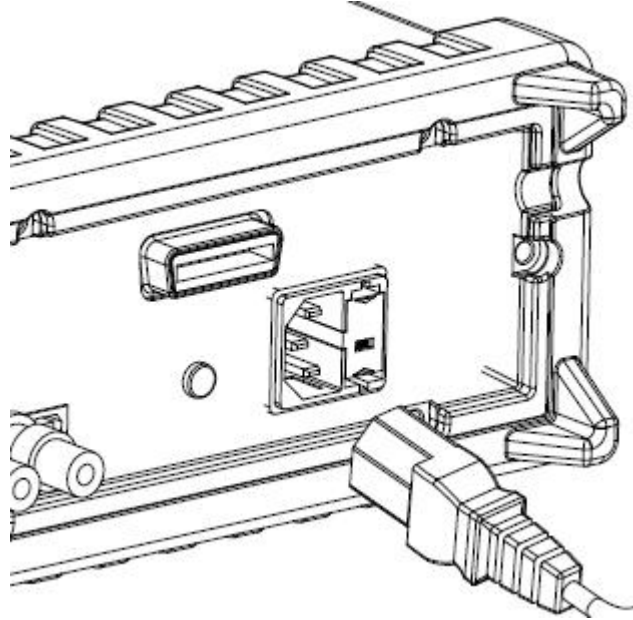
Figure 3: Disconnect AC power

2. Press the latch to unlatch the voltage setting selector container, as shown in the following figure (a flat blade screwdriver may be required).

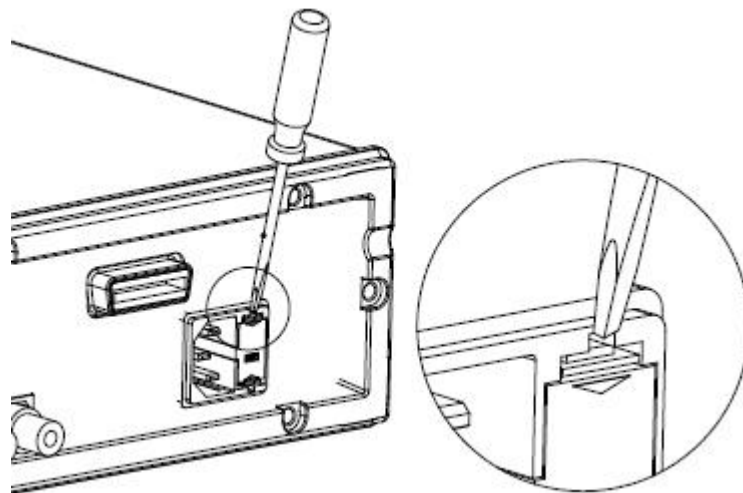Figure 4: Unlatching voltage selector


3. Remove the voltage setting selector container, as shown in the following figure (a flat blade screwdriver may be required).

Figure 5: Remove voltage selector

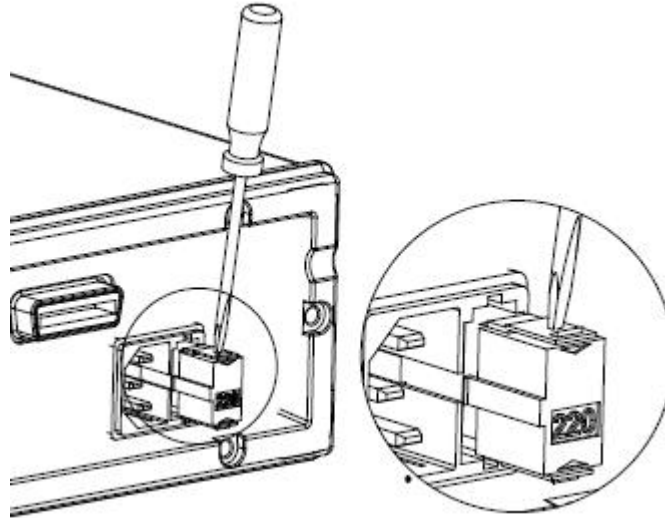

4. Open the clips on the sides and remove the voltage setting selector from the container, as shown in the following figure.

Figure 6: Open clips

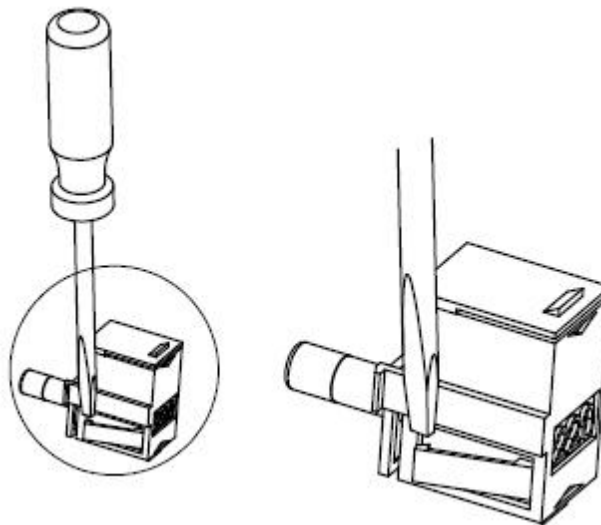


- Turn the voltage setting to the correct setting.

NOTE

The instrument has four possible voltage settings: 100 V, 120 V, 220 V, and 240 V. It can be set to any of these working voltages.

Figure 7: Turn voltage selector

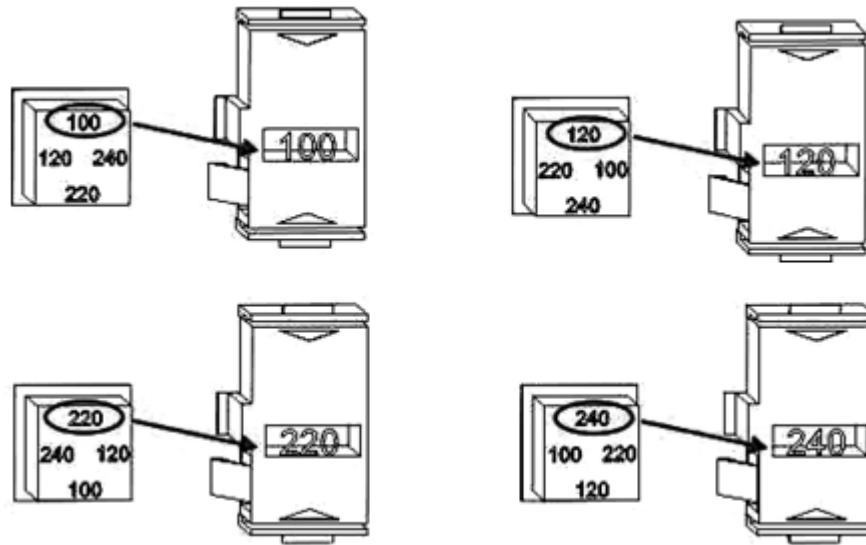

- Insert the voltage setting selector back into the socket and close the cap.

Fuse replacement

A rear-panel fuse drawer is located below the AC receptacle (refer to [Rear panel overview](#) (on page 2-17)). This fuse protects the power line input of the instrument. If the line fuse needs to be replaced, refer to [Line fuse replacement](#) (on page A-1).

Power-up sequence

Self-test procedures are built into the Model 2110 for checking that the logic and measurement hardware are functioning properly. Every time the instrument power is turned on, a set of test procedures is performed to make sure the basic function of the instrument works properly. If any error occurs during self-test procedures, it indicates that parts of the instrument are not operating properly and need to be serviced.

Refer to [Error codes](#) (on page 6-3) for information about self-test error codes.




CAUTION

Erroneous self-test failures may occur if the setting of power line voltage is incorrect. Errors may also occur because of signals present on the input terminal during self-test procedures. Long test leads can act as an antenna, causing pick-up of AC signals.

Front panel overview

This topic describes the keys, connections, and fuse device on the front panel. The following figure shows the front panel. A brief description of the front-panel features follows the figure.


Figure 8: Front panel

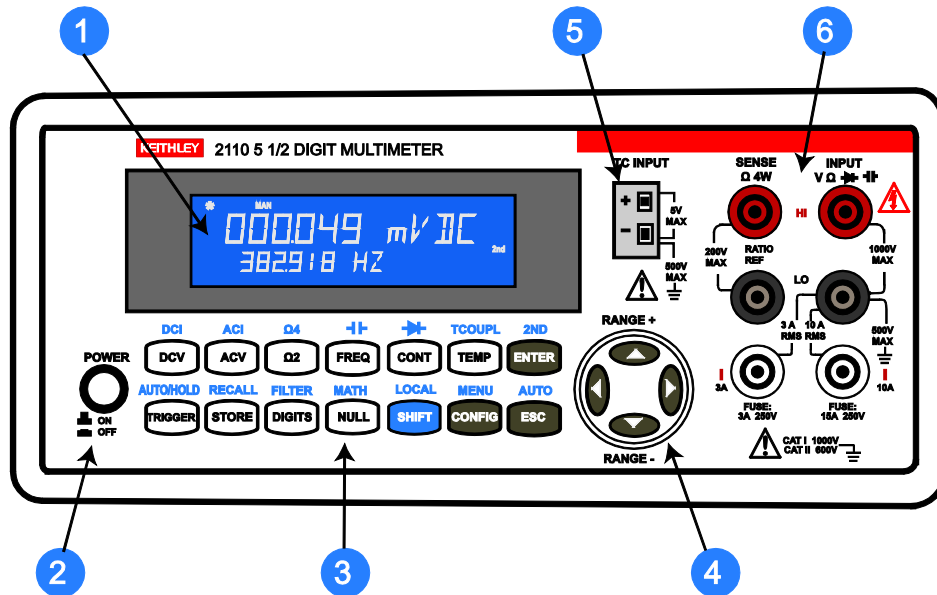

(1) Display

The instrument display has a primary and a secondary display area. There are additional indicators at the upper side (top) and right side of the display to show the state or the condition of an ongoing measurement. They are explained individually in the following sections. The following figure shows the display with all indicators lit and all character segments lit.

Figure 9: Display

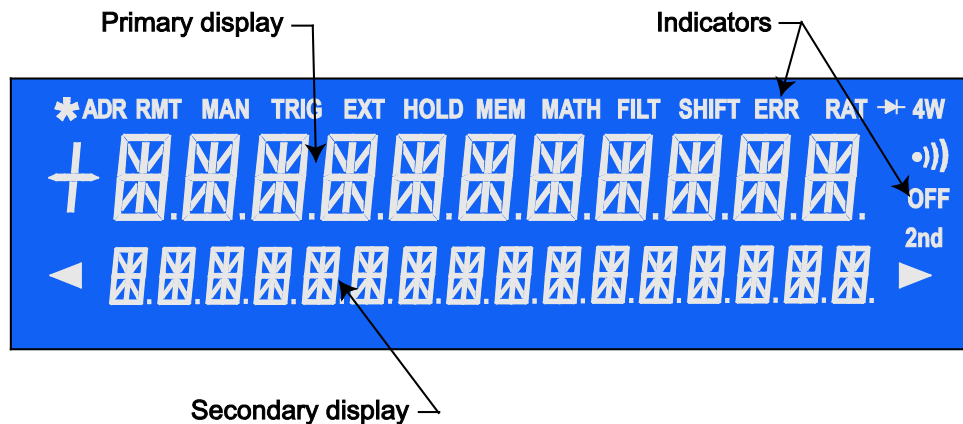

Primary display

The primary display shows readings and units. The primary display can show a maximum of 11 characters.

Secondary display

The secondary display shows the range of the measurements, condition, secondary readings and units, or information about an ongoing configuration. The secondary display can show a maximum of 16 characters.

Indicators

When you are using the instrument, the lit indicators show active functions. For example, in the following figure, the **MAN** indicator shows that the manual range is selected and the **2nd** indicator shows that the second function is in use.

Figure 10: Display typical




The following table describes the meaning of each lit indicator.

Indicator	Indicates
ADR	Instrument is controlled via the GPIB Interface.
RMT	Remote interface operation via the USB Interface.
MAN	Manual range mode is selected.
TRIG	Single triggering is enabled.
HOLD	Reading hold function is enabled.
MEM	Internal memory is in use.
MATH	MATH operation is enabled.
FILT	The digital filter is enabled.
SHIFT	The SHIFT key was just pressed.
ERR	An error occurred.
RAT	RATIO operation is taken.
→	Diode testing operation was initiated.
4W	4-wire mode is selected for resistance measurement.
)))	Continuity testing is enabled.
OFF	Front-panel display is turned off.
2nd	Second function is in use.

(2) The Power key

Power switch. The in position turns the instrument ON; the out position turns it OFF.

Figure 11: Power switch

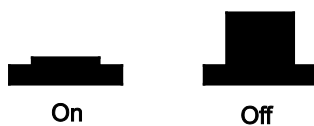

(3) The function and operation keys

The front panel has keys that allow you to select various functions and operations.

Function

The function keys are white. Pressing a function key causes the instrument to perform a specific function. For example, pressing the **DCV** function key selects the DC voltage function.

Operation

The operation keys are gray. Pressing an operation key causes the instrument to perform a specific operation. For example, after selecting DC voltage function, press **Config** to enter the configuration menu for the DC voltage function.

Shift key


The **SHIFT** key is blue. All keys have a shifted function or operation printed in blue above the key. The SHIFT key allows you to perform the shifted function or operation.

Shifted keys



To perform a shifted function or operation, press **SHIFT** and then press the key with the label for the function you want to perform printed above it. The procedures in this manual that require you to use a shifted key sequence list the key name followed by the shifted key name in parentheses. For example, to measure AC current, press **SHIFT** and then press the **ACV (ACI)** key.

See the following figure for the location of the keys.

Figure 12: Function and operation keys

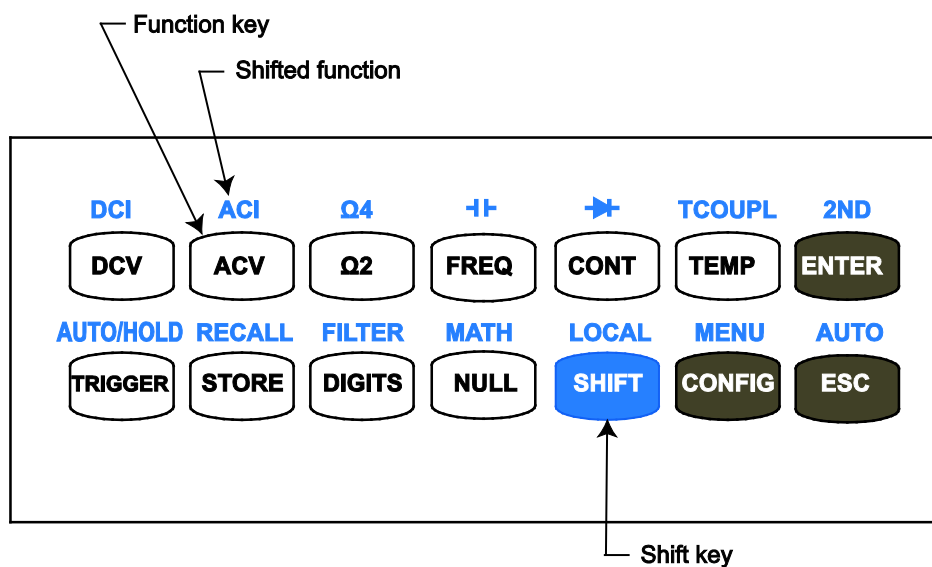

 The following table describes the functions and shifted functions associated with each key. The shifted functions are shown with a shaded background.

Key	Function
DCV	Selects DC voltage measurement.
ACV	Selects AC voltage measurement.
Ω	Selects 2-wire resistance measurement.
FREQ	Selects frequency measurement.
CONT	Selects the continuity test.
TEMP	Selects RTD temperature measurement.
ENTER	Accepts selection, moving to next choice or back to measurement display.
DCI	Selects DC current measurement.
ACI	Selects AC current measurement.
Ω 4	Selects 4-wire resistance measurement.
	Selects capacitance measurement.
	Selects diode test.
TCOUP	Selects thermocouple temperature measurement.
2ND	Sets secondary measurement.
TRIGGER	Manually triggers the instrument to make measurements or sets the instrument to take external triggers.
STORE	Stores a specified number of subsequent readings.
DIGITS	Changes display resolution.
NULL	Activates the null function in order to offset the measurement error due to the test leads.
SHIFT	Used to access shifted-functions printed in blue over each key.
CONFIG	Configures the settings of selected measurement function. Refer to the topics in Basic measurement functions (on page 3-1) for configuration details.
ESC	Cancels selection, moving back to measurement display.
AUTO/HOLD	Enables or disables the reading hold function.
RECALL	Displays stored readings.
FILTER	Enables or disables averaging digital filter.
MATH	Enables or disables mathematical operations/tests, including PERCENT, AVERAGE, NULL, LIMITS, MX+B, dB, and dBm.
LOCAL	Switches the instrument to the local mode from the USB or GPIB remote mode.
MENU	Offers system-wide settings, trigger settings, interface configurations and calibration information. Refer to (7) Menu overview (on page 2-11) for information about menus.
AUTO	Enables or disables autorange.

(4) RANGE and scroll keys

Keys	Description
◀ and ▶	Use ▶ and ◀ keys to scroll through options.
▲ and ▼	Use ▲ and ▼ keys to change the range while measuring. Use ▲ and ▼ keys to change a digit when setting parameters and entering values.

NOTE

If there are editable characters left or right of the one selected, arrow shaped indicators will display on the second line to indicate the presence and location of the additional characters.

(5) TC input

The TC INPUT terminals provide thermocouple temperature measurement. The terminals come with built-in cold junction compensation, so no extra thermocouple adapter is needed.



WARNING

To prevent electrical shock that could cause injury or death, never apply voltages to the LO INPUT terminal while a thermocouple is connected.

(6) Terminals and fuses

The instrument has the following connections on the front panel:

HI and LO INPUT terminals

Use for all measurements except current and TC. The maximum input voltage is 1000 V for voltage measurements; 200 V for 4-wire measurement.



CAUTION

Voltages applied to the LO INPUT terminal will cause erroneous thermocouple measurements.

HI and LO SENSE terminals

Use to make 4-wire resistance measurement and DC voltage ratio measurement.

3A and 10A current Input terminals

Use for all DC and AC current measurements.

(7) Menu overview

The menus and submenus provide a way for you to configure system-wide settings, trigger settings, remote interface configurations, and calibration information.

Menu navigation

Selecting menus

To select menus and submenus, use the keys as follows:

- To navigate to the Main menu, press **SHIFT**, and then press **CONFIG (MENU)**.
- Press the ► ◀ keys to display submenus.
- Press **ENTER** to choose a submenu.
- If there are additional submenus, press the ► ◀ keys to display the submenu you want, and then press **ENTER** to select it.
- If you need to change digits in a value, press the ▲ ▼ keys to change each digit. Refer to the next topic ([Setting a value](#) (on page 2-12)) for more information about values.
- At any time, press **ESC** to cancel changes.
- When you are finished, press **ESC** to back out of the menu structure.

Setting a value

Values are numbers. Some configuration options require values, or if the configuration options have default values, the values may need to be changed. To change the values, you adjust the value one digit at a time.

To adjust the digits use the ▲ ▼ keys, as follows:

1. Use the ► ◀ keys to display the value that you want to edit.
2. Press the **ENTER** key to enter edit mode.
3. Use the ► ◀ keys to select the digit to edit.
4. Use the ▲ ▼ keys to set the appropriate value.
5. Press the **ENTER** key to select the value or press the **ESC** key to cancel the change.

Main menu

You can configure instrument operation through the front panel by pressing keys to display menus. Refer to the following table for information about:

- Keys that you press to display menus. These keys are in a **BOLD** font. If the configuration option relates to the key's shifted function, the key's shifted function is listed in parenthesis after the key name.
- Menus are indented and listed under the key that you press to display them.
- Some menus have submenus. Submenus are indented under the menus.

Keys, menus, and selection	Description
DCV CONFIG NPLC RANGE RATIO	Press the DCV key. Press the CONFIG key to display configuration options. Use ► and ◀ keys to select resolution adjustment. Refer to Resolution and integration time (on page 3-41) for information about the number of power line cycles (NPLC). Use ► and ◀ keys to display additional selections. Refer to Range selection (on page 3-39) for details. Select RATIO . Refer to Ratio measurements (on page 3-4) for details.
ACV CONFIG BAND WIDTH RANGE	Press the ACV key. Press the CONFIG key to display configuration options. Use ► and ◀ keys to select bandwidth. Refer to Bandwidth and resolution for AC measurements (on page 3-43) for details. Use ► and ◀ keys to display additional selections. Refer to Range selection (on page 3-39) for details.
Ω2 CONFIG NPLC RANGE	Press the Ω2 key. Press the CONFIG key to display configuration options. Use ► and ◀ keys to select resolution adjustment. Refer to Resolution and integration time (on page 3-41) for information about the number of power line cycles (NPLC). Use ► and ◀ keys to display additional selections. Refer to Range selection (on page 3-39) for details.
FREQ CONFIG PERIOD APERTURE RANGE INPUT JACK	Press the FREQ key. Press the CONFIG key to display configuration options. Refer to Aperture and resolution for frequency and period measurements (on page 3-44) for details. Refer to Frequency and period measurements (on page 3-12) for information about RANGE and INPUT JACK selections.
CONT CONFIG CONT RES	Press the CONT key. Press the CONFIG key to display configuration options. Select CONT RES. Use the ◀ and ►, ▲, and ▼ keys to set the threshold resistance (1 Ω to 1000 Ω).
TEMP CONFIG SENSOR USER R-ZERO, ALPHA BETA, DELTA SPRTD R-ZERO, A4, B4, AK, BK, CK, DK NTCT A, B, C UNITS	Press the TEMP key. Press the CONFIG key to display configuration options. Use ► and ◀ keys to select a default sensor coefficient. Refer to RTD coefficients and temperature calculation (on page 3-19) for details. Select to enter coefficient values for RTD user-defined sensor types. Refer to the documentation supplied by the manufacturer of the RTD for information about the coefficient values. Select coefficient and enter values. Then use ► and ◀ keys to select the digit. Then use ▲ and ▼ to increase or decrease the number. Select to configure the standard platinum RTD (SPRTD) sensor. Refer to Temperature measurement (on page 3-17) and RTD coefficients and temperature calculation (on page 3-19) for details. Use ► and ◀ keys to select the digit. Then use ▲ and ▼ to increase or decrease the number. NTCT is the supported thermistor type. Refer to Temperature measurement (on page 3-17) for details. Use ► and ◀ keys to select the digit. Then use ▲ and ▼ to increase or decrease the number. Select UNITS to configure the temperature unit type.

Keys, menus, and selection	Description
C, F, K TRANSDUCER	Specify units for temperature measurement (Cel means Celsius, Far means Fahrenheit, and K means Kelvin). Select to: Configure transducer. Where: FRTD = 4-wire as the RTD measurement and RTD = 2-wire as the RTD measurement.
SHIFT DCV (DCI) CONFIG NPLC RANGE	Press the SHIFT key to access the shifted function for the next key you press. Press the DCV (DCI) key. Press the CONFIG key to configure DC current measurements. Use ► and ◀ keys to select resolution adjustment. Refer to Resolution and integration time (on page 3-41) for information about the number of power line cycles (NPLC). Use ► and ◀ keys to display additional selections. Refer to Range selection (on page 3-39) for details.
ACV (ACI) CONFIG BAND WIDTH RANGE	Press the ACV (ACI) key. Press the CONFIG key to configure the instrument for AC current measurements. Use ► and ◀ keys to select bandwidth. Refer to Bandwidth and resolution for AC measurements (on page 3-43) for details. Use ► and ◀ keys to display additional selections. Refer to Range selection (on page 3-39) for details.
Ω2 (Ω4) CONFIG NPLC RANGE	Press the Ω2 (Ω4) key. Press the CONFIG key to configure the instrument for resistance measurements. Use ► and ◀ keys to select resolution adjustment. Refer to Resolution and integration time (on page 3-41) for information about the number of power line cycles (NPLC). Use ► and ◀ keys to display additional selections. Refer to Range selection (on page 3-39) for details.
FREQ (HF) CONFIG RANGE RANGE AUTO	Press FREQ (HF) key. Press the CONFIG key to configure the instrument for capacitance measurements. Use ► and ◀ keys to display additional selections. Refer to Range selection (on page 3-39) for details. Use ► and ◀ keys to select RANGE AUTO (autorange) or use ► and ◀ keys to display additional selections.
CONT (HF) CONFIG VF-LOW VF-high	Press CONT (HF) key. Press the CONFIG key to configure the instrument for diode measurements. Refer to Diode measurements (on page 3-15) for details.
TEMP (TCOUP) CONFIG TYPE UNITS	Press TEMP (TCOUP) key. Press the CONFIG key to configure the instrument for thermocouple measurements. Refer to Thermocouple measurements (on page 3-22) for details. Specify units for temperature measurement (Cel means Celsius, Far means Fahrenheit, and K means Kelvin).
ENTER (2ND) CONFIG OFF DCI	Press ENTER (2ND) key. Press the CONFIG key to configure the instrument for the dual-measurement function. Refer to Secondary function measurements (see " Secondary measurement function " on page 3-26) for details. Select OFF to turn off the dual measurement function off. Select DCI to configure DC current as the second function.

Keys, menus, and selection	Description
NPLC	Use ► and ◀ keys to select resolution adjustment. Refer to Resolution and integration time (on page 3-41) for information about the number of power line cycles (NPLC).
RANGE	Use ► and ◀ keys to display additional selections. Refer to Range selection (on page 3-39) for details.
ACV	Select ACV to configure AC voltage as the second function.
BAND WIDTH	Use ► and ◀ keys to select bandwidth. Refer to Bandwidth and resolution for AC measurements (on page 3-43) for details.
RANGE	Use ► and ◀ keys to display additional selections. Refer to Range selection (on page 3-39) for details.
FREQ	Select FREQ to configure frequency as the second function.
APERTURE	Refer to Aperture and resolution for frequency and period measurements (on page 3-44) for details.
RANGE	Use ► and ◀ keys to display additional selections. Refer to Range selection (on page 3-39) for details.
PERIOD	Select PERIOD to configure period as the second function.
APERTURE	Refer to Aperture and resolution for frequency and period measurements (on page 3-44) for details.
RANGE	Use ► and ◀ keys to display additional selections. Refer to Range selection (on page 3-39) for details.
TCOUPPL	Select TCOUPPL to configure thermocouple as the second function.
TYPE	Select TYPE to configure the thermocouple type.
UNITS	Specify units for temperature measurement (Cel means Celsius, Far means Fahrenheit, and K means Kelvin).
RJUNCTION	Specify reference junction type, real or simulated (REAL or SIMulated).
REAL	Select REAL.
SIMULATED	Select SIMULATED.
VIEW REAL	Select VIEW REAL to the offset voltage of the real reference junction.
TRIGGER (AUTO/HOLD)	Press TRIGGER (AUTO/HOLD) to toggle the reading hold function on and off. After turning it on, you can also adjust the reading hold sensitivity band using ▲ and ▼ keys. Refer to Reading hold (on page 3-36) for details.
STORE (RECALL)	Press STORE (RECALL) to view the number of stored readings. Refer to Data buffer (on page 3-37) for details.
DIGITS (FILTER)	Press DIGITS (FILTER) to select the type of filter for the measurement on the selected function, or to turn the filter off. Use ► and ◀ keys to display additional selections. Refer to Digital filter (on page 3-45) for details about moving average and repeat average.
OFF	Turn the filter off.
MOVING AVERAGE	Select to configure MOVING AVERAGE. Use ► and ◀ keys to display additional selections.
RUN	Select RUN to start the function.
READINGS	Enter the number of readings using ▲ ▼ ► ◀ keys.
REPEAT AVERAGE	Select to configure REPEAT AVERAGE. Use ► and ◀ keys to display additional selections.
RUN	Select RUN to start the function.
READINGS	Enter the number of readings using ▲ ▼ ► ◀ keys.
NULL (MATH)	Press NULL (MATH) to select the mathematical operation. Use ► and ◀ keys to display additional selections. Refer to Math operations (on page 3-47) for details.


Keys, menus, and selection	Description
OFF	Turn the math function off.
PERCENT	Select to configure PERCENT. Refer to Percent (on page 3-47) for details.
RUN	Select RUN to start the function.
TARGET	Enter the target value using ▲ ▼ ► ◀ keys.
AVERAGE	Select to configure AVERAGE. Refer to Average (on page 3-48) for details.
RUN	Select RUN to start the function.
NULL	Select to configure NULL. Refer to Null (on page 3-49) for details.
RUN	Select RUN to start the function.
LIMITS	Select to configure LIMITS. Refer to Limits (on page 3-51) for details.
RUN	Select RUN to start the function.
HIGH LIMIT	Enter the high limit value using ▲ ▼ ► ◀ keys.
LOW LIMIT	Enter the low limit value using ▲ ▼ ► ◀ keys.
MX+B	Select to configure MX+B. Refer to MX+B (on page 3-52) for details.
RUN	Select RUN to start the function.
SET M	Enter the scale factor (M) value using ▲ ▼ ► ◀ keys.
SET B	Enter the scale factor (B) value using ▲ ▼ ► ◀ keys.
dB	Select to configure dB. Refer to dB (on page 3-55) for details.
RUN	Select RUN to start the function.
dB REL	Enter the relative reference using ▲ ▼ ► ◀ keys.
dBm	Select to configure dBm. Refer to dBm (on page 3-54) for details.
RUN	Select RUN to start the function.
REF RES	Enter the reference resistance using ▲ ▼ ► ◀ keys.
CONFIG (MENU)	Press CONFIG (MENU) to select the menu.
SET ADC	Select to configure autozero. Refer to Autozero (on page 3-38) for details.
AUTO ZERO	Selects the autozero operation. Refer to Autozero (on page 3-38) for details.
ON	Turns the function or operation on.
OFF	Turn the function off.
TRIG SYS	Access trigger system settings. Use ► and ◀ keys to display additional selections.
READ HOLD	Set reading hold. If set, it will hold the stable reading and trigger a beeping sound. Refer to Reading hold (on page 3-36) for details.
STORE RDGS	Set number of readings to be stored.
DELAY	Access delay time settings for the trigger. Refer to Trigger delay (on page 3-35) for details.
AUTO	Select auto delay time for the trigger. AUTO is the default. After selecting AUTO, the menu structure will close.
MANUAL	Select manual delay time, and then select the delay time.
SAMPLE CNT	Select number of samples per trigger.
TRIG CNT	Select number of triggers.
SYSTEM	Access system settings. Use ► and ◀ keys to display additional selections.
SCPI ERR	Check the error queue. Refer to Error codes (on page 6-3) for information about error queue.
INIT MODE	Check the initial mode settings. Refer to Selecting the initial operating mode (on page 2-22) for details.
DEFAULT SET	Recall the factory settings. Refer to Power-on settings (on page 1-6) for details.

Keys, menus, and selection	Description
SAVE DATA	Save the current settings as the power-on state. Only the primary and secondary measurement function, range, resolution, and math functions are saved. Refer to Selecting the initial operating mode (on page 2-22) for details.
SYSTEM VERSION	Display system version. Refer to Viewing system version (on page 2-24) for details.
INSTRUMENT INFO	Display instrument manufacturer and model number.
SERIAL	Display instrument serial number.
DISPLAY	Access display settings. Refer to Turning off measurement display (on page 2-20) for details.
ON	Turn display on.
OFF	Turn display off.
BEEP	Access beeper settings. Refer to Turning the beeper off or on (on page 2-21) for details.
ON	Turn beeper on.
OFF	Turn beeper off.
SELF TEST	Perform a self-test and display results. Refer to Running a self-test (on page 6-2) for details.
LANGUAGE	Access remote command language settings. Refer to Selecting the language (on page 2-23) for details.
DEFAULT	Set default language. The default language is: Model 2110 SCPI.
COMPATIBLE	Set to SCPI-compliant DMM language mode.
INTERFACE	Select communication interface. Refer to Rear panel connection details (on page 2-19).
USB	Access USB settings.
ON	Select USB.
OFF	Disable USB.
GPIB ADDRESS	Enter or change GPIB address.
CALIBRATION	Select calibration settings. Refer to Viewing calibration information (on page 2-24).
CAL COUNT	View the number of times the instrument has been calibrated.
CAL DATE	View the date of the last calibration.

Rear panel overview

The rear panel of the Model 2110 is shown in the following figure. This figure includes important abbreviated information that should be reviewed before using the instrument.

Figure 13: Rear panel

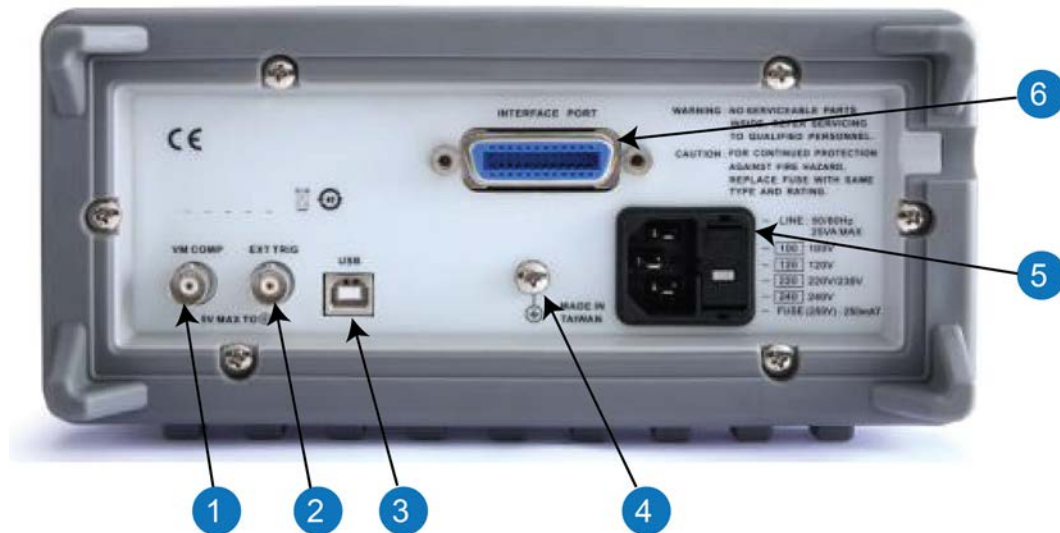

(1) Voltmeter complete output terminal (VM COMP)

The VM COMP output terminal outputs a low-true pulse from a remote interface. Refer to [External triggering](#) (on page 3-32) for details.

(2) External triggering input terminal (EXT TRIG)

Use the EXT TRIG input terminal when choosing external triggering. Refer to [External triggering](#) (on page 3-32) for details.

(3) USB connection

Use the USB connector to connect the instrument to a remote computer. You can use this connection to switch the instrument to remote mode instead of using the front-panel control. Refer to [USB connector](#) (on page 2-19) for details.

(4) Protective earth (safety ground)

Ground screw for connection to protective earth (safety ground). Connect to protective earth using recommended wire size (#16 AWG or larger).

(5) AC line receptacle, power line fuse, and line voltage setting

Provides:

- AC line receptacle. Use to connect to AC power. Refer to [Turning your instrument on and off](#) (on page 2-1) for details.
- Line voltage setting. Configured for line voltages of 100 V, 120 V 220 V, and 240 V. Refer to [Voltage selection](#) (on page 2-2) for details.
- Fuse. Contains the power line fuse. Refer to [Line fuse replacement](#) (on page A-1) for details.

(6) Interface port

If the optional GPIB connection is present in the interface port, you can connect the instrument to a remote computer with an IEEE-488 cable. Refer to [GPIB connector](#) (on page 2-19) for details.

Rear panel connection details

The following topics describe how to connect the cable connections for the communication interfaces.


To properly set up the communications interfaces after connection, see the information in Communication interfaces.

USB connector

The downstream Type B USB-2.0 receptacle located on the rear panel connects to a host.

Use the rear connector to communicate with the instrument over USB by sending the desired commands. Refer to [USB communications](#) (on page C-1) for information about using this connector.


Figure 14: USB connector

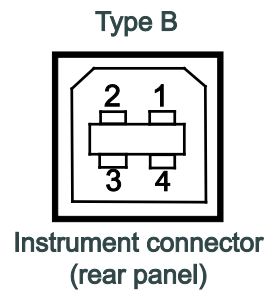

GPIB connector

To connect Model 2110 to the GPIB bus, use a cable equipped with standard IEEE-488 connectors, as shown below. Refer to [GPIB setup](#) (on page C-8) for information about using this connector.

Figure 15: IEEE-488 connector

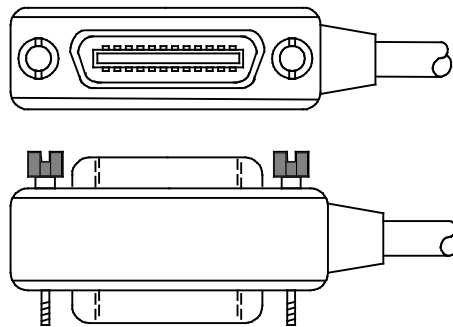

Set the GPIB address

The GPIB address value is set to 16 at the factory. The address can be set to any address value between 0 and 30. However, the address must be unique in the system. It cannot conflict with the address assigned to another instrument or to the GPIB controller.

To change the GPIB address:

1. Press the **SHIFT** key, and then press the **CONFIG** key.
2. Use the **▶** and **◀** keys to select **INTERFACE**.
3. Press **ENTER**.
4. Use the **▶** and **◀** keys to select **GPIB**.
5. Press **ENTER**. The display shows GPIB ADDR.
6. Press **ENTER**.
7. Use the **▶** and **◀** keys to change the GPIB address.
8. When the correct GPIB address displays, press **ENTER** to save the address.

The address value is saved in nonvolatile memory and will not change when the power is turned off and then turned on again.

System operations

This topic provides information about system-related operations. Each system-related operation performs a task that is not measurement-related, but plays an important role in making your measurements.

Turning off measurement display

You have the option to stop measurements from showing on the display. This option allows you to make faster measurements without waiting for the display to update. You can turn off the measurement display during any front-panel or remote measurement operations.

When the measurement display is turned off, the **OFF** indicator will be lit. This indicator does not mean the display is turned off, but only that the acquired readings will not be sent to the display. Turning off the display accelerates the measurement process because there is no input/output delay. Turning off the display does not affect the messages displayed from the RECALL, MENU, and CONFIG front-panel operations.

You can always send a message through the remote interface from your computer to the secondary display, and it will replace the original message.

Measurement display is on by default. If you turn the measurement display off, it stays off until you turn it back on or you turn the instrument power off and then turn it on again.

You can control the display through the front panel or through the remote interface. The remote interface operation overrides the front-panel setting.

Front-panel operation

To turn the measurement display on or off, use the following procedure:

1. Press the **SHIFT** and **CONFIG (MENU)** keys to display the MENU options.
2. Use the **▶** and **◀** keys to display SYSTEM, and then press the **ENTER** key.
3. Use the **▶** and **◀** keys to display DISPLAY, and then press the **ENTER** key.
4. If you want to turn the measurement display on, use the **▶** and **◀** keys to display ON, and then press the **ENTER** key. Go to Step 6.
5. If you want to turn measurement display off, use the **▶** and **◀** keys to display OFF, and then press the **ENTER** key.
6. When finished, press **ESC**.

Remote operation

To turn measurement display off, use the following command:

```
DISPlay OFF
```

To turn measurement display on, use the following command:

```
DISPlay ON
```

To display the message (maximum 16 characters) you type in on the secondary display, use the following command:

```
DISPlay:TEXT <a quoted string>
```

To clear the message displayed, use the following command:

```
DISPlay:TEXT:CLear
```

Turning the beeper off or on

The Model 2110 beeps when certain conditions are met or when an error occurs.

You can only turn off the beeper for some operations. The beeper sound remains in other operations, such as front-panel key-presses.

The beeper is turned on by default. The beeper state is stored in nonvolatile memory, and the default will be restored when the instrument has been turned off or after a remote interface reset.

When the beeper is turned off, you will not hear beeps when the following conditions occur:

- A new minimum or maximum is found in Min/Max operation.
- A stable reading is detected and held.
- The test voltage is within the limits in diode testing.
- The source signal fails the limit testing.

Turning the beeper off has no effect on the following conditions:

- An error occurs.
- Any button on the front panel is pressed.
- The threshold value is exceeded in continuity testing.

You can control the beeper from either the front panel or the remote interface operation.

Front-panel operation

To turn the beeper on or off, use the following procedure:

1. Press the **SHIFT** and **CONFIG (MENU)** keys to display the MENU options.
2. Use the **▶** and **◀** keys to display SYSTEM, and then press the **ENTER** key.
3. Use the **▶** and **◀** keys to display BEEP, and then press the **ENTER** key.
4. If you want to turn the beeper on, use the **▶** and **◀** keys to display ON, and then press the **ENTER** key. Go to Step 6.
5. If you want to turn the beeper OFF, use the **▶** and **◀** keys to display OFF, and then press the **ENTER** key.
6. When finished, press **ESC**.

Remote operation

To turn the beeper off, use the following commands:

```
SYSTem:BEEPer  
SYSTem:BEEPer:STATe OFF
```

To turn the beeper on, use the following commands:

```
SYSTem:BEEPer  
SYSTem:BEEPer:STATe ON
```

Selecting the initial operating mode

The Model 2110 provides the option to save the current operating settings or restore the factory default settings when the instrument is turned on. Refer to [Power-on settings](#) (on page 1-6) for information about default settings.

To select the initial mode, use the following procedure:

1. Press the **SHIFT** and **CONFIG (MENU)** keys to display the MENU options.
2. Use the **▶** and **◀** keys to display SYSTEM, and then press the **ENTER** key.
3. Use the **▲** and **▼** keys to display INIT MODE, and then press the **ENTER** key.
4. If you want to save the current settings, use the **▶** and **◀** keys to display SAVE DATA, and then press the **ENTER** key. Go to Step 6.
5. If you want to restore the default settings, use the **▶** and **◀** keys to display DEFAULT SET, and then press the **ENTER** key.
6. When finished, press **ESC**.

Selecting the language

You can choose the following languages for programming the remote commands.

- **Default:** Select DEFAULT for compatibility with all Model 2110 features and functions as well as KI-Tool and KI-Link software.
- **Compatible:** Select COMPATIBLE for SCPI-compliant DMM language mode. When you select COMPATIBLE, the SYST:IDNS "<Manufacturer>,<Model>" allows you to modify the *IDN? return string to any manufacturer and model number.

The language setting is stored in nonvolatile memory.

To select the language, use the following procedure:

1. Press the **SHIFT** and **CONFIG (MENU)** keys to display the MENU options.
2. Use the **▶** and **◀** keys to display SYSTEM, and then press the **ENTER** key.
3. Use the **▶** and **◀** keys to display LANGUAGE, and then press the **ENTER** key.
4. If you want to use the default language, use the **▶** and **◀** keys to display DEFAULT, and then press the **ENTER** key. Go to Step 6.
5. If you want to use the compatible language, use the **▶** and **◀** keys to display COMPATIBLE, and then press the **ENTER** key.
6. When finished, press **ESC**.

Viewing errors in the error queue

When the **ERR** indicator on the display is lit, it indicates that the instrument has detected an error condition.

In general, the **ERR** indicator and error queue operate as follows:

- The instrument turns the **ERR** indicator off after you view the error queue.
- If there are no error messages in the error queue when you view the queue, the display shows NO ERRORS.
- If there are more than 20 errors found, the last error in the error queue will be replaced with the error -350. The -350 error indicates too many errors.

The instrument clears the error queue when the instrument is turned off, or when the following command is received:

```
*CLS
```

For more information about error conditions, refer to [Error codes](#) (on page 6-3).

To view messages in the error queue, perform the following steps:

1. Press the **SHIFT** and **CONFIG (MENU)** keys to display the MENU options.
2. Use the **▶** and **◀** keys to display SYSTEM, and then press the **ENTER** key.
3. Use the **▶** and **◀** keys to display SCPI ERR, and then press the **ENTER** key. The display shows:
 - ERROR CODE - Refer to [Error codes](#) (on page 6-3) for information.
 - NO ERRORS - Indicates that there are no error messages in the queue.

Viewing system version

The Model 2110 system version is a number that indicates the version of firmware installed on each of the instrument's processors.

To view the system version, use the following procedure:

1. Press the **SHIFT** and **CONFIG (MENU)** keys to display the MENU options.
2. Use the **▶** and **◀** keys to display SYSTEM, and then press the **ENTER** key.
3. Use the **▶** and **◀** keys to display SYSTEM VER, and then press the **ENTER** key. The display shows numbers in the following format:

x.xx-yy-zz

Where:

x.xx - indicates the measurement processor

yy - indicates the I/O processor

zz - indicates the front-panel processor

Viewing calibration information

The Model 2110 can show the date of the last calibration on the display.

To view calibration information, use the following procedure:

1. Press the **SHIFT** and **CONFIG (MENU)** keys to display the MENU options.
2. Use the left and right arrow keys to display CALIBRATE, and then press the **ENTER** key.
3. To view the number of calibrations, use the **▶** and **◀** keys to display CAL COUNT, and then press the **ENTER** key. The display shows the number of calibrations.
4. To view the date of the last calibration, use the **▶** and **◀** keys to display CAL DATE, and then press the **ENTER** key. The display shows the date of the last calibration in the following format:

mm/dd/yyyy

Where: mm = month, dd = day, and yyyy = year.

Basic DMM operation

In this section:

Basic measurement functions	3-1
Triggering and data buffer	3-28
Enhancing measurement performance	3-38

Basic measurement functions

The Model 2110 5½ Digit Multimeter can perform the following measurements:

- Voltage (DC and AC)
- Ratio (DC voltage input / DC voltage reference)
- Current (DC and AC)
- Resistance (2-wire and 4-wire)
- Frequency and period (voltage input or current input)
- Continuity
- Diode testing
- Temperature (RTD and thermocouple)
- Capacitance

Voltage measurements

The instrument is capable of measuring DC voltage (DCV) up to 1000 V and AC voltage (ACV) up to 750 V.

- DC voltage (DCV) measurement ranges: 100 mV, 1 V, 10 V, 100 V, and 1000 V
- AC voltage (ACV) measurement ranges: 100 mV, 1 V, 10 V, 100 V, and 750 V AC-coupled true RMS (1000 V peak)



WARNING

Do not apply more than 1000 V (peak) to the Model 2110. Applying higher voltage is an electric shock hazard and could result in personal injury or death. It may also damage the instrument.

NOTE

To eliminate thermal EMFs caused by the differences between two metals, use copper test leads to connect your source signal to the Model 2110.

NOTE

Use the following procedure and commands to perform basic measurements. Refer to [Enhancing measurement performance](#) (on page 3-38) for details about setting measurement speed and resolution. It also provides information on using other features and settings to optimize measurement performance.

**CAUTION**

Remove voltage from the front-panel input terminals before switching the equipment off. Failure to do so could result in the equipment being damaged.


Front-panel operation

Perform the following steps to measure voltage:

1. Press the **DCV** key to measure DC voltage or the **ACV** key to measure AC voltage.
2. Select a measurement range (auto or manual):
 - Autorange is the power-on default. If manual ranging is selected (MAN indicator on), press **SHIFT** and then **ESC (AUTO)** to select autorange.
 - For manual ranging, press the **RANGE ▲** and **▼** keys to select a measurement range.
3. As shown below, connect the signal to the instrument and observe the reading on the display. If the input signal exceeds the selected range, the overflow message **OVLD** displays.

Connections for DC and AC voltage measurements

Figure 16: Connections for DCV and ACV measurements

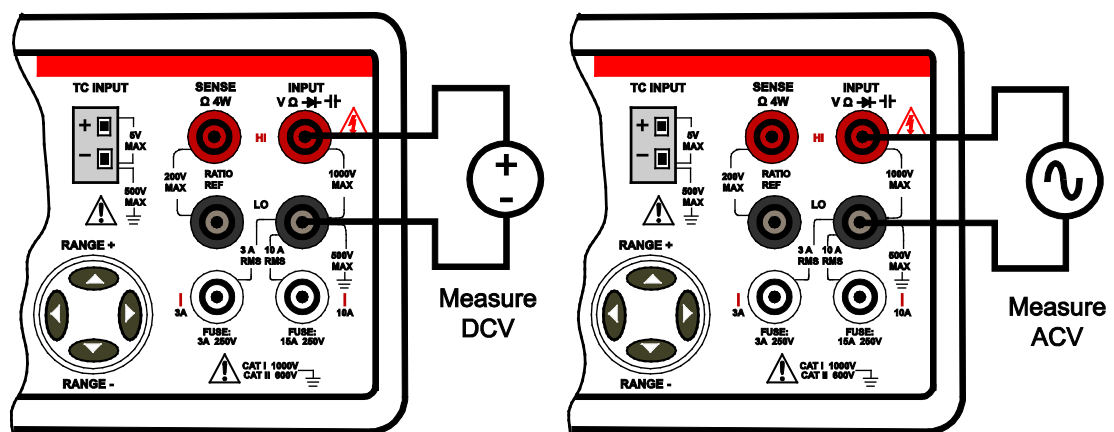

Input resistance:
 10 MΩ on 1000 V, 100 V ranges
 > 10 GΩ on 10 V, 1 V, 100 mv ranges

Input impedance:
 1 MΩ in parallel with < 100 pF

Remote operation

NOTE

Commands that use the <n> parameter can use the MINimum and MAXimum name parameters. MIN selects the minimum value and MAX selects the maximum value.

Use the following commands to select the function (DCV or ACV), set a measure range, set resolution, and perform a measurement:

FUNCTION "VOLTage[:DC]"	Select DCV function
FUNCTION "VOLTage:AC"	Select ACV function
VOLTage[:DC]:RANGE <n>	Set DCV range
VOLTage:AC:RANGE <n>	Set ACV range
<n> = -1000 to 1000	Specify expected DCV reading
= 0 to 750	Specify expected ACV reading
VOLTage[:DC]:RANGE:AUTO 	Enable or disable autorange for DCV
VOLTage:AC:RANGE:AUTO 	Enable or disable autorange for ACV
 = 0 or OFF	Disable autorange
= 1 or ON	Enable autorange
READ?	Perform measurement and acquire reading

Measurement configuration commands can also be used to perform measurements. Use the following commands to select a function (DCV or ACV), set the measure range, set measurement resolution, perform a measurement, and acquire the reading.

MEASure:VOLTage[:DC]? <range>, <resolution>	
MEASure:VOLTage:AC? <range>, <resolution>	
<range> = -1000 to 1000	Expected DCV reading
= 0 to 750	Expected ACV reading
<resolution> = (see Note)	Measurement resolution

NOTE

The resolution setting range for <resolution> depends on the selected function and range. The maximum value for DC measurement is $3.00e-04$ x full-scale range, and the minimum value is $3.00e-07$ x full-scale range. For example, for the DCV 1000 V range, the minimum value is $(3.00e-07 \times 1000 \text{ V} = 3.00e-04)$. The maximum value is $(3.00e-04 \times 1000 \text{ V} = 3.00e-01)$. Therefore, <resolution> = $3.00e-04$ to $3.00e-01$ for the DCV 1000 V range.

The maximum value for AC measurement is $1.00e-04$ x full-scale range, and the minimum value is $1.00e-06$ x full-scale range. For example, for the ACV 750 V range, the minimum value is $(1.00e-06 \times 750 \text{ V} = 1.00e-03)$. The maximum value is $(1.00e-04 \times 750 \text{ V} = 1.00e-01)$. Therefore, <resolution> = $1.00e-03$ to $1.00e-01$ for the ACI 10A range. The 750 V range is treated as a 1000 V range for the purposes of resolution calculations.

Ratio measurements

This feature calculates the ratio of an input DC voltage to a reference DC voltage using the following equation:

$$\text{Ratio} = \frac{\text{DC input voltage}}{\text{DC reference voltage}}$$

NOTE

This function only applies to DC voltage measurement.

NOTE

Use the following procedure and commands to perform basic measurements. Refer to [Enhancing measurement performance](#) (on page 3-38) for details about setting measurement speed and resolution. It also provides information on using other features and settings to optimize measurement performance.

Front-panel operation


Perform the following steps to perform ratio calculations:

1. Press **DCV** to select the DC voltage function.
2. Select a measurement range (auto or manual) for the input signal:
 - Autorange is the power-on default. If manual ranging is selected (MAN indicator on), press **SHIFT** and then **ESC (AUTO)** to select autorange.
 - For manual ranging, press the **RANGE ▲** and **▼** keys to select a measurement range.
3. As shown below, connect the input and reference signals to the instrument:
 - a. Connect the DC input signal to the INPUT HI and LO terminals.
 - b. Connect the reference signal to the SENSE HI and LO terminals.
 - c. Connect the SENSE LO terminal to the INPUT LO terminal.
4. Press **CONFIG** and use the **◀** and **▶** keys to display **RATIO**, and then press **ENTER** (RAT indicator turns on).
5. Observe the ratio reading on the display.

To disable ratio, press any function key.

Connections for ratio measurements

Figure 17: Connections for ratio measurements

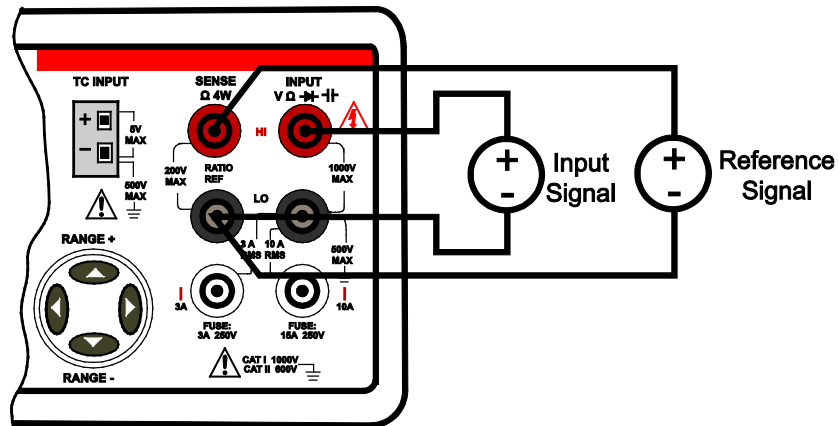

Input resistance:
 10 MΩ on 1000 V, 100 V ranges
 > 10 GΩ on 10 V, 1 V, 100 mv ranges

Remote operation

NOTE

Commands that use the <n> parameter can use the MINimum and MAXimum name parameters. MIN selects the minimum value and MAX selects the maximum value.

Use the following commands to select the ratio function, set a measurement range, and perform a calculation:

FUNCTION "VOLTage[:DC]:RATio"	Select ratio function
VOLTage[:DC]:RANGe <n>	Set DCV range for the input signal
<n> = -1000 to 1000	Expected DCV reading for the input signal
VOLTage[:DC]:RANGe:AUTO 	Enable or disable autorange for the input signal
 = 0 or OFF	Disable autorange
= 1 or ON	Enable autorange
READ?	Perform ratio calculation and acquire reading

A measurement configuration command can also be used for ratio calculations. Use the following command to select the ratio function, set the measure range, set measurement resolution, perform a calculation, and acquire the reading.

MEASure:VOLTage[:DC]:RATio? <range>, <resolution>	
<range> = -1000 to 1000	Expected DCV reading of the input signal
<resolution> = (See Note)	Measurement resolution

NOTE

The resolution setting range for <resolution> depends on the selected function and range. The maximum value for DC measurement is $3.00e-04 \times$ full-scale range, and the minimum value is $3.00e-07 \times$ full-scale range. For example, for ratio 1000 V range, the minimum value is $(3.00e-07 \times 1000 \text{ V} = 3.00e-04)$. The maximum value is $(3.00e-04 \times 1000 \text{ V} = 3.00e-01)$. Therefore, <resolution> = $3.00e-04$ to $3.00e-01$ for the ratio 1000 V range.

Current measurements

The instrument is capable of measuring DC and AC current up to 10 A.

- DC current measurement ranges: 10 mA, 100 mA, 1 A, 3 A, and 10 A
- AC current measurements: 1 A, 3 A, and 10 A

NOTE

Use the following procedure and commands to perform basic measurements. Refer to [Enhancing measurement performance](#) (on page 3-38) for details about setting measurement speed and resolution. It also provides information on using other features and settings to optimize measurement performance.

Front-panel operation

Perform the following steps to measure current:


1. Select a current measurement function:
 - Press **SHIFT** and then **DCV (DCI)** to measure DC current.
 - Press **SHIFT** and then **ACV (ACI)** to measure AC current.
2. Select a measurement range (auto or manual):
 - Autorange is the power-on default. If manual ranging is selected (MAN indicator on), press **SHIFT** and then **ESC (AUTO)** to select autorange.
 - For manual ranging, press the **RANGE ▲** and **▼** keys to select a measurement range.
3. Connect the signal to the instrument as shown below and observe the reading shown on the display. If the input signal exceeds the selected range, the overflow message **OVL**D will be displayed.

Connections for DC and AC current measurements

CAUTION

The maximum input on the 3 A input terminals is 3 A, 250 V. The maximum input on the 10 A input terminals is 10 A. Exceeding these input levels will damage the current fuses.

Figure 18: Connections for DCI and ACI

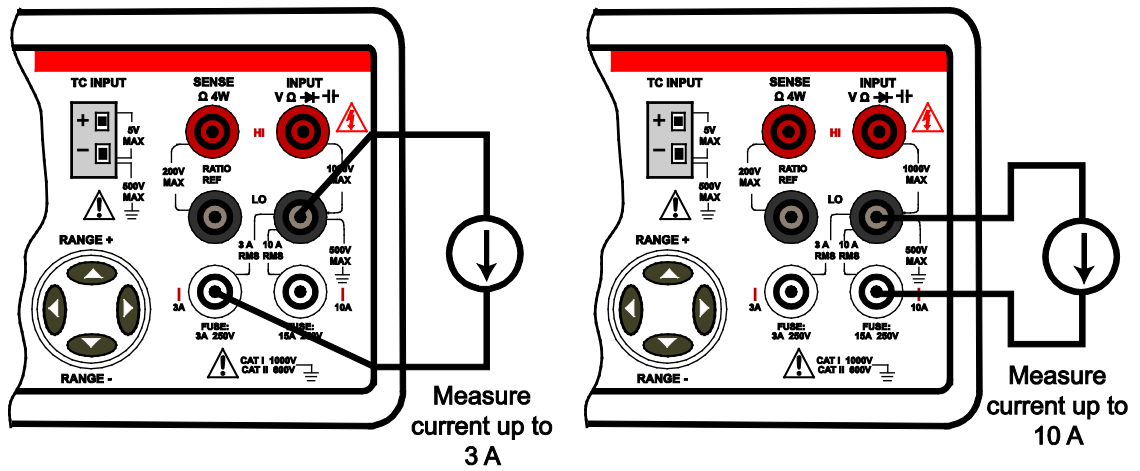

Remote operation

NOTE

Commands that use the <n> parameter can use the MINimum and MAXimum name parameters. MIN selects the minimum value and MAX selects the maximum value.

Use the following commands to select the function (DCI or ACI), set a measure range, and perform a measurement:

<code>FUNCTION "CURRENT[:DC]"</code>	Select the DCI function
<code>FUNCTION "CURRENT:AC"</code>	Select the ACI function
<code>CURRENT[:DC]:RANGE <n></code>	Set the DCI range
<code>CURRENT:AC:RANGE <n></code>	Set the ACI range
<n> = -10 to 10	Expected DCI reading
= 0 to 10	Expected ACI reading
<code>CURRENT[:DC]:RANGE:AUTO </code>	Enable or disable autorange for DCI
<code>CURRENT:AC:RANGE:AUTO </code>	Enable or disable autorange for ACI
 = 0 or OFF	Disable autorange
= 1 or ON	Enable autorange
<code>READ?</code>	Perform the measurement and acquire reading

Measurement configuration commands can also be used to perform measurements. Use the following commands to select a function (DCI or ACI), set the measure range, set measurement resolution, perform a measurement, and acquire the reading.

<code>MEASURE:CURRENT[:DC]? <range>, <resolution></code>	
<code>MEASURE:CURRENT:AC? <range>, <resolution></code>	
<range> = -10 to 10	Expected DCI reading
= 0 to 10	Expected ACI reading
<resolution> = (see Note)	Measurement resolution

NOTE

The resolution setting range for <resolution> depends on the selected function and range. The maximum value for DC measurement is $3.00e-04$ x full-scale range, and the minimum value is $3.00e-07$ x full-scale range. For example, for DCI 10 A range, the minimum value is ($3.00e-07$ x 10 A = $3.00e-07$). The maximum value is ($3.00e-04$ x 10 A = $3.00e-03$). Therefore, <resolution> = $3.00e-06$ to $3.00e-03$ for the DCI 10 A range.

The maximum value for AC measurement is $1.00e-04$ x full-scale range, and the minimum value is $1.00e-06$ x full-scale range. For example, for ACI 10 A range, the minimum value is ($1.00e-06$ x 10 A = $1.00e-05$). The maximum value is ($1.00e-04$ x 10 A = $1.00e-03$). Therefore, <resolution> = $1.00e-05$ to $1.00e-03$ for the ACI 10 A range.

Resistance measurements

There are two measurement methods for resistance:

- 2-wire ohms
- 4-wire ohms

As shown in the figure in [Connections for resistance measurements](#) (on page 3-10), one pair of test leads are used for 2-wire ohms measurement. A test current is applied and the voltage across the resistance under test is measured on the same leads.

As shown in the figure in [Connections for resistance measurements](#) (on page 3-10), two pairs of test leads are used for 4-wire ohms measurements. One pair of test leads applies the test current, and the other set measures the voltage. As a result, 4-wire ohms is more accurate for low-resistance measurements. The disadvantages of 4-wire ohms are a longer settling time and the need to use an extra set of test leads.

The table below lists the measurement ranges (2-wire and 4-wire) and test currents for the instrument.

Resistance ranges and test currents	
Resistance range	Test current
100 Ω	1 mA
1 k Ω	1 mA
10 k Ω	100 μ A
100 k Ω	10 μ A
1 M Ω	1 μ A
10 M Ω	0.1 μ A
100 M Ω	0.1 μ A

NOTE

Use the following procedure and commands to perform basic measurements. Refer to [Enhancing measurement performance](#) (on page 3-38) for details about setting measurement speed and resolution. It also provides information on using other features and settings to optimize measurement performance.

Front-panel operation


Perform the following steps to measure resistance:

1. Connect the device under test to the instrument, as shown below.
2. Select a resistance measurement function:
 - Press **Ω** to select 2-wire ohms.
 - Press **SHIFT** and then **Ω** (**Ω**) to select 4-wire ohms.
3. Select a measurement range (auto or manual):
 - Autorange is the power-on default. If manual ranging is selected (MAN indicator on), press **SHIFT** and then **ESC (AUTO)** to select autorange.
 - For manual ranging, press the **RANGE ▲** and **▼** keys to select a measurement range.
4. Observe the reading shown on the display.

Connections for resistance measurements

Source current flows from INPUT HI to INPUT LO as shown in the following figure.

Figure 19: Connections for resistance measurements

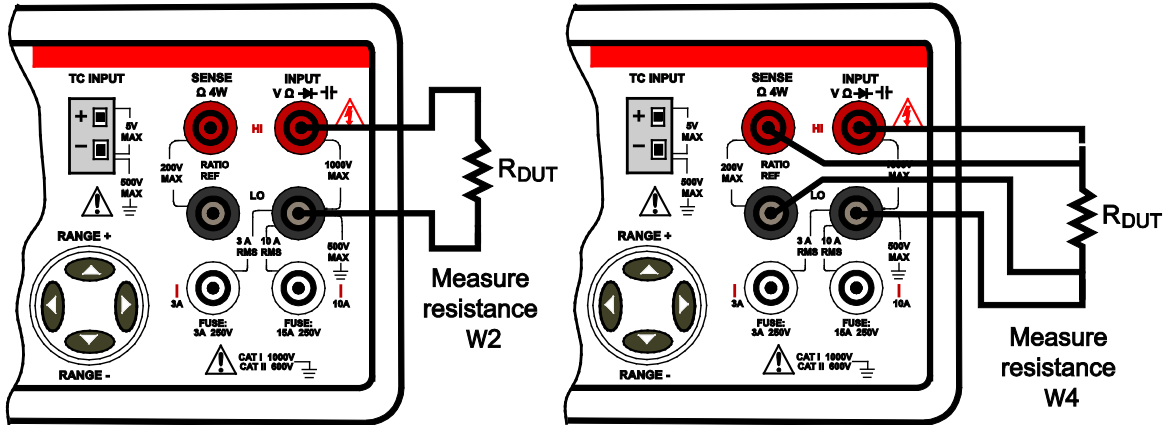

Remote operation

NOTE

Commands that use the <n> parameter can use the MINimum and MAXimum name parameters. MIN selects the minimum value and MAX selects the maximum value.

Use the following commands to select the function (W2 or W4), set a measure range, and perform a measurement:

FUNCtion "RESistance"	Select 2-wire ohms (W2)
FUNCtion "FRESistance"	Select 4-wire ohms (W4)
RESistance:RANGe <n>	Set W2 range
FRESistance:RANGe <n>	Set W4 range
<n> = 0 to 100e6	Expected ohms reading
RESistance:RANGe:AUTO 	Enable or disable autorange for Ω 2
FRESistance:RANGe:AUTO 	Enable or disable autorange for Ω 4
 = 0 or OFF	Disable autorange
= 1 or ON	Enable autorange
READ?	Perform measurement and acquire reading

Measurement configuration commands can also be used to perform measurements. Use the following commands to select a function (W2 or W4), set the measure range, set measurement resolution, perform a measurement, and acquire the reading.

MEASure:RESistance? <range>, <resolution>	
MEASure:FRESistance? <range>, <resolution>	
<range> = 0 to 100e6	Expected ohms reading
<resolution> = (See Note)	Measurement resolution

NOTE

The resolution setting range for <resolution> depends on the selected function and range. The maximum value for DC measurement is $3.00e-04$ x full-scale range, and the minimum value is $3.00e-07$ x full-scale range. For example, for the Ω 2 and Ω 4 $1.00e+08$ Ω range, the minimum value is ($3e-07$ x $1.00e+08$ Ω = 30). The maximum value is ($3.00e-04$ x $1.00e+08$ Ω = $3.00e+04$). Therefore, <resolution> = 30 to $3.00e+04$ for the Ω 2 and Ω 4 $1.00e+08$ Ω range.

Frequency and period measurements

The instrument measures frequency from 3 Hz to 300 kHz (or 3.3 μ s to 333 ms) using the AC voltage ranges (100 mV to 750 V) or AC current ranges (1 A, 3 A, or 10 A).



WARNING

Do not apply more than 1000 V (peak) to the instrument. Applying higher voltage creates an electric shock hazard which could result in personal injury or death. It may also damage the instrument.

NOTE

Use the following procedure and commands to perform basic measurements. Refer to [Enhancing measurement performance](#) (on page 3-38) for details about setting measurement speed and resolution. It also provides information on using other features and settings to optimize measurement performance.


Front-panel operation

Perform the following steps to measure frequency or period:

1. Select the frequency or period measurement function:
 - Frequency: Press the **FREQ** key.
 - Period: Press **FREQ** and **CONFIG**, and with **PERIOD** displayed, press **ENTER**.
2. Select the AC signal (voltage or current) to measure:
 - a. Press **CONFIG**, use the **▶** key to display **INPUT JACK**, and then press **ENTER**.
 - b. Use the **◀** or **▶** key to display **VOLTAGE** or **CURRENT**, and then press **ENTER**.
3. Select a measurement range (auto or manual) for the AC signal to be measured.
 - Autorange is the power-on default. If manual ranging is selected (MAN indicator on), press the **SHIFT** key and then **ESC (AUTO)** to select autorange.
 - For manual ranging, press the **RANGE ▲** and **▼** keys to select a measurement range.
4. As shown below, connect the AC signal to the Model 2110 and observe the reading on the display. If the input signal exceeds the selected range, the overflow message **OVLd** displays.

Connections for frequency and period measurements

Figure 20: Connections for FREQ and PERIOD

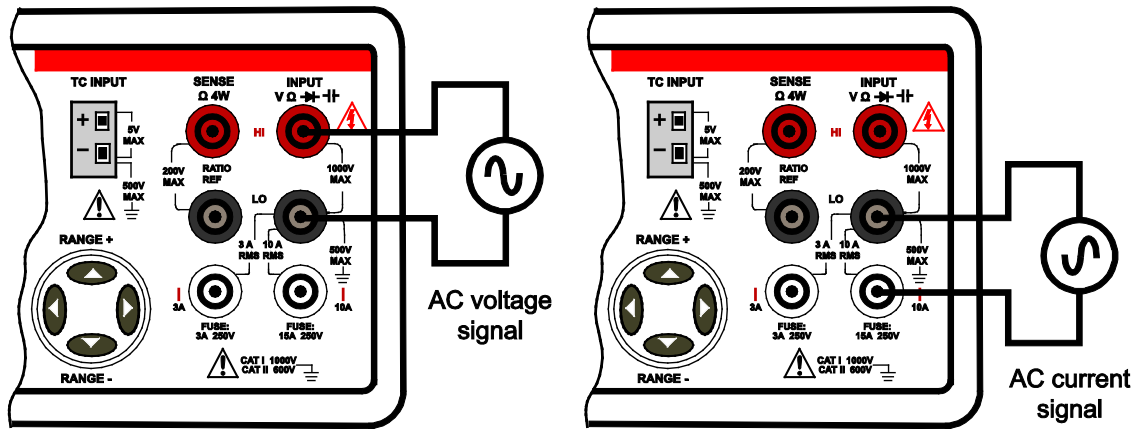

Input impedance:
 1 MΩ in parallel with < 100 pF

Remote operation

NOTE

Commands that use the <n> parameter can use the MINimum and MAXimum name parameters. MIN selects the minimum value and MAX selects the maximum value.

Use the following commands to select the function (frequency or period), set a measure range, set resolution, and perform a measurement:

FUNCTION "FREQUency"	Select frequency function
FUNCTION "FREQUency[:VOLT]"	Select frequency function (voltage input)
FUNCTION "FREQUency:CURR"	Select frequency function (current input)
FUNCTION "PERiod"	Select period function
FUNCTION "PERiod[:VOLT]"	Select period function (voltage input)
FUNCTION "PERiod:CURR"	Select period function (current input)
FREQUency:VOLTage:RANGe <n>	Set AC voltage range for frequency function
FREQUency:CURRent:RANGe <n>	Set AC current range for frequency function
PERiod:VOLTage:RANGe <n>	Set AC voltage range for period function
PERiod:CURRent:RANGe <n>	Set AC current range for period function
<n> = 0 to 750	Expected AC voltage level of the signal
<n> = 0 to 10	Expected AC current level of the signal
FREQUency:VOLTage:RANGe:AUTO 	Frequency autorange for voltage input
FREQUency:CURRent:RANGe:AUTO 	Frequency autorange for current input
PERiod:VOLTage:RANGe:AUTO 	Period autorange for voltage input
PERiod:CURRent:RANGe:AUTO 	Period autorange for current input
 = 0 or OFF	Enable autorange
= 1 or ON	Disable autorange
READ?	Perform measurement and acquire reading

Measurement configuration commands can also be used to perform measurements. Use the following commands to select a function (frequency or period), set measure range, set measurement resolution, perform a measurement, and acquire the reading.

MEASure:FREQUency? <range>, <resolution>

MEASure:PERiod? <range>, <resolution>

 <range> = 0 to 750 Expected AC voltage level of the signal

NOTE

Resolution is ignored for frequency and period.

Continuity measurements

The instrument uses the 1 k Ω range and 5½-digit resolution to measure continuity. The instrument beeps when the test resistance is less than the threshold resistance. The default threshold resistance is 10 Ω , but can set from 1 Ω to 1 k Ω . The resistance value you set is stored in volatile memory and is lost when the instrument is turned off. The source current for continuity measurements is 1 mA.



WARNING

Do not apply more than 1000 V (peak) to the Model 2110. Applying higher voltage creates an electric shock hazard which could cause personal injury or death. It may also damage the instrument.

Front-panel operation

Perform the following steps to measure continuity:

1. Press the **CONT** key to select the continuity function.
2. Press the **CONFIG** key, and with **CONT RES** displayed, press the **ENTER** key.
3. Use the **◀**, **▶**, **▲**, and **▼** keys to set the threshold resistance (1 Ω to 1000 Ω), and then press the **ENTER** key.
4. As shown in [Connections for resistance measurements](#) (on page 3-10) for 2-wire ohms, connect the resistive device to the Model 2110:
 - If the resistance of the device is more than the threshold resistance, **OPEN** is displayed.
 - If the resistance is less than the threshold resistance, the Model 2110 beeps and displays the resistance of the device.

Remote operation

Use the following commands to measure continuity:

FUNCTION "CONTInuity" Select the continuity function.

READ? Measure continuity and acquire the reading.

A MEASure? command can also be used measure continuity and acquire the reading:

MEASure:CONTInuity?

Diode measurements

The Model 2110 uses a 1 mA current source for diode measurements. The 1 V DC measurement range and 5½-digit resolution are used to measure a diode.

The default threshold voltage band is between 0.3 V and 0.8 V, and the reading rate is 0.1 PLC. The threshold voltage band can be adjusted from 0.01 V up to 1.2 V. The Model 2110 beeps when the measured diode voltage is within the threshold band.



WARNING

The positive end of the source signal must be connected to the HI input terminals, and the negative end to the LO input terminals.

Front-panel operation


Perform the following steps to measure the threshold voltage of a diode:

1. Connect the diode to the instrument, as shown below. These connections forward-bias the diode.
2. Press the **SHIFT** key and then the **CONT** (▶) key to select the diode function.
3. To check or change the threshold voltage band, perform the following steps:
 - a. Press the **CONFIG** key, and with **VF-LOW** displayed, press **ENTER**.
 - b. Use the **◀**, **▶**, **▲**, and **▼** keys to set the low threshold voltage (0.01 V to 1.00 V), and then press **ENTER**.
 - c. With **VF-HI** displayed, press **ENTER**.
 - d. Use the **◀**, **▶**, **▲**, and **▼** keys to set the high threshold voltage (0.01 V to 1.20 V), and then press **ENTER**.
4. Observe the voltage reading on the display. The instrument beeps when the reading is within the threshold voltage band.

Connections for diode measurements

Source current flows from INPUT HI to INPUT LO as shown in the following figure.

Figure 21: Connections for diode measurements

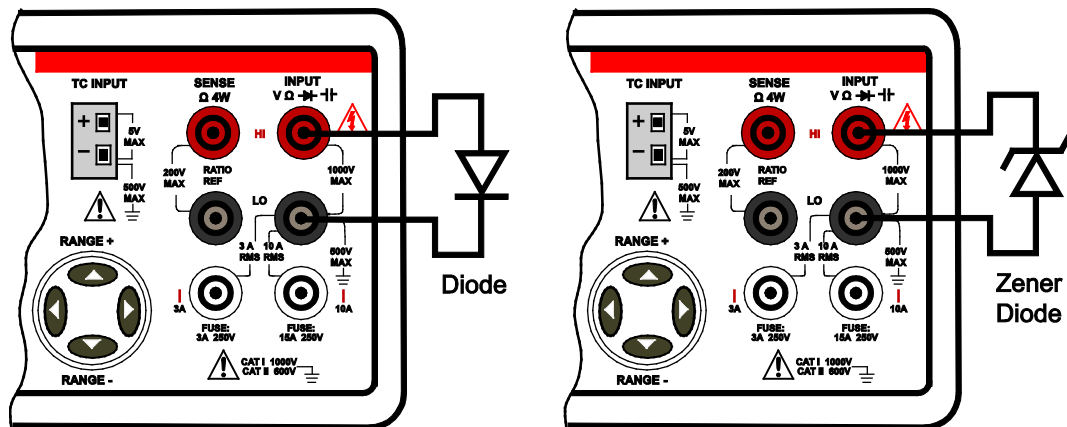

Remote operation

For remote operation, the default threshold voltage band is used for diode measurements.

Use the following commands to measure the threshold voltage of a diode.

FUNCTION "DIODE" Select the diode function.

READ? Measure the diode and acquire the reading.

A MEASURE? command can also be used to perform the measurement and acquire the reading:

MEASURE:DIODE?

Temperature measurement

For temperature measurements, the instrument supports resistance temperature detector (RTD) probes, NTC thermistors, and thermocouple sensors.

In general, RTDs have a better accuracy and long-term stability than thermocouples. For the instrument, the default RTD sensor type is PT100. The default thermocouple sensor is type K.

RTD and thermistor measurements

The instrument can perform temperature measurements using resistance temperature detectors (RTDs). The supported RTD sensor types are PT100, D100, F100, PT385, PT3916, user definable, and SPRTD. The supported thermistor type is NTCT. The instrument supports 2-wire, 3-wire, and 4-wire RTD probes.

The default RTD sensor type is PT100. The temperature measurement range for the PT100 sensor is -200 °C to 850 °C (-328 °F to 1562 °F).

Front-panel operation

Perform the following steps to measure temperature using an RTD or thermistor:


1. Referring to the drawing below, connect the RTD (or thermistor) to the Model 2110.
2. Press the **TEMP** and **CONFIG** keys.
3. Select the sensor:
 - a. Use the ◀ or ▶ key to display **SENSOR** and press **ENTER**.
 - b. Use the ◀ and ▶ keys to display the sensor and press **ENTER**.

Note: If you select the **NTCT**, **SPRTD** or **USER** sensor, you will need to enter coefficient values. See [Entering sensor coefficients](#) (on page 3-19) for details.
4. Select the measurement units:
 - a. Press **CONFIG**, use the ▶ key to display **UNITS**, and then press **ENTER**.
 - b. Use the ◀ or ▶ key to display the units (°C, °F, or K) and press **ENTER**.
5. Select the transducer type (2-wire or 4-wire):
 - a. Press **CONFIG**, use the ▶ key to display **TRANSDUCER**, and then press **ENTER**.
 - b. Use the ◀ or ▶ key to display the transducer type (**2W RTD** or **4W RTD**), and press **ENTER**.
6. Observe the temperature reading on the display.

Connections to measure temperature using an RTD

The following figure shows how to connect RTD probes to the instrument. For the 3-wire probe, make sure to connect the SENSE LO terminal to the INPUT LO terminal. Source current flows from INPUT HI to INPUT LO as shown in the following figure.

Figure 22: Connections for RTD measurements

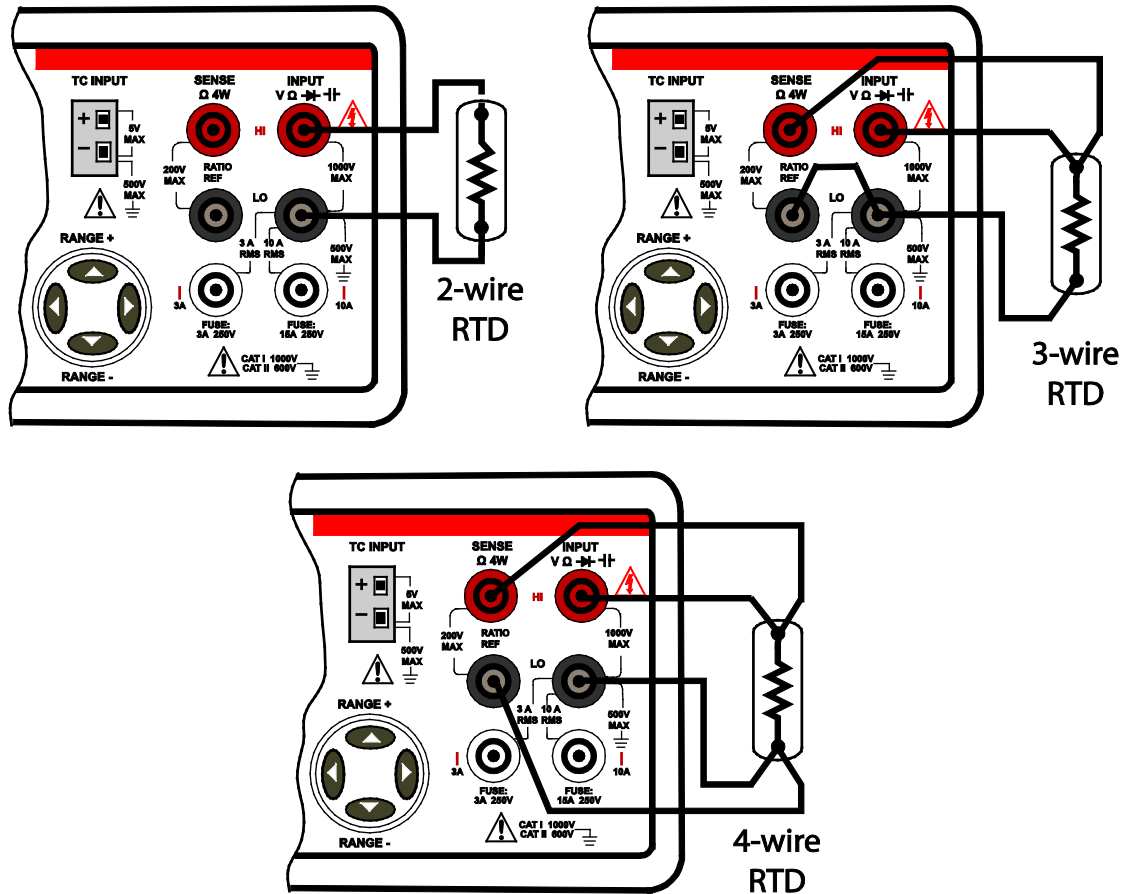

RTD coefficients and temperature calculation

The table below shows the default coefficient values for the PT100, D100, F100, PT385, and PT3916 RTD sensors. For the Model 2110, these values are fixed and cannot be changed. However, if you need to use different coefficient values for these sensors, you can use the USER sensor type. The USER sensor type allows you to enter your own values.

Sensor default coefficients

Sensor type	Alpha (α)	Beta (β)	Delta (δ)	R-Zero
PT100	0.003850	0.10863	1.49990	100 Ω
D100	0.003920	0.10630	1.49710	100 Ω
F100	0.003900	0.11000	1.49589	100 Ω
PT385	0.003850	0.11100	1.50700	100 Ω
PT3916	0.003916	0.11600	1.50594	100 Ω
	A	B	C	
NTCT	1.129241e-3	2.341077e-4	8.77546e-8	n/a

The following equations are used to calculate RTD temperature:

When $t < 0$ °C:

$$R_t = R_0 [1 + At + Bt^2 + Ct^3(t-100)]$$

When 0 °C $\leq t < 630$ °C:

$$R_t = R_0 (1 + At + Bt^2)$$

Where: $A = \alpha(1 + \delta/100)$

$$B = -\alpha\delta \cdot 10^{-4}$$

$$C = -\alpha\beta \cdot 10^{-8}$$

For the standard platinum RTD (SPRTD) sensor, the ITS-90 (International Temperature Scale) standard provides two reference equations for standard platinum thermometers covering a temperature range from 18.8033 K to 1234.93 K. However, one SPRTD usually cannot cover the entire range, so the temperature range is divided into a few subranges.

These subranges depend on the calibration point of the temperature scale and are based on the melting or triple points of various pure substances. For an exact list of the required elements and details about RTD calibration, refer to NIST Technical Note 1265, "Guidelines for Realizing the International Temperature Scale of 1990." In each subrange, the calibration constants required for that subrange are listed.

Entering sensor coefficients

There are three RTD sensor types that allow you to enter coefficient values for sensor parameters. The coefficients are provided with the documentation supplied by the manufacturer of the RTD.

The following sensors allow you to enter coefficient values:

- NTCT sensor
- SPRTD sensor
- USER sensor

Perform the following steps to enter coefficient values:

1. Press the **TEMP** key.
2. Press **CONFIG**, and with **SENSOR** displayed, press **ENTER**.
3. Use the ◀ or ▶ key to display the sensor type (**NTCT**, **SPRTD**, or **USER**) and press **ENTER**.
4. Use the ◀ and ▶ keys to display an RTD parameter and press **ENTER**.
5. Use the ◀, ▶, ▲, and ▼ keys to enter the coefficient value and press **ENTER**.
6. Repeat steps 4 and 5 to set the coefficients for all the RTD parameters.

Remote operation**NOTE**

Commands that use the <n> parameter can use the **MIN**imum and **MAX**imum name parameters. **MIN** selects the minimum value and **MAX** selects the maximum value.

Use the following commands to select the RTD sensor type and set the measurement units:

TEMPerature:RTD:TYPE <name> Select RTD sensor type

<name> = PT100, D100, F100, PT385, PT3916, USER, SPRTD, or NTCT

UNIT <name> Set temperature measurement units

<name> = Cel Celsius

 = Far Fahrenheit

 = K Kelvin

Use the following commands to enter the parameter coefficients for the USER sensor:

TEMPerature:RTD:RZERo <n>

<n> = R-zero value

TEMPerature:RTD:ALPHa <n>

<n> = Alpha value

TEMPerature:RTD:BETA <n>

<n> = Beta value

TEMPerature:RTD:DELTA <n>

<n> = Delta value

Use the following commands to enter the parameter coefficients for the SPRTD sensor:

TEMPerature:SPRTd:RZERo <n>

<n> = R-zero value

TEMPerature:SPRTd:A4 <n>

<n> = A4 value

TEMPerature:SPRTd:B4 <n>

<n> = B4 value

TEMPerature:SPRTd:AX <n>

<n> = AX value

TEMPerature:SPRTd:BX <n>

<n> = BX value

TEMPerature:SPRTd:CX <n>

<n> = CX value

TEMPerature:SPRTd:DX <n>

<n> = DX value

Use the following command to measure temperature:

MEASure:TEMPerature?

Thermocouple measurements

The following table lists the temperature range for the supported thermocouple (TC) types:

Thermocouple temperature measurement ranges

Thermocouple type	Temperature range (°C)	Temperature range (°F)
B	600 to 1820	1112 to 3308
C	0 to 2316	32 to 4200.8
E	-250 to 1000	-418 to 1832
J	-210 to 1200	-346 to 2192
K (default)	-200 to 1372	-328 to 2501.6
N	-200 to 1300	518 to 2372
R	0 to 1767	32 to 3212.6
S	0 to 1767	32 to 3212.6
T	-250 to 400	-418 to 752

Configuration settings for thermocouple temperature measurements:

- Thermocouple type: B, C, E, J, K, N, R, S, T
Default setting: K
- Measurement units: °C or °F
Default setting: °C
- Reference junction: Real or simulated
Default setting: Real

A thermocouple measurement is referenced to a known temperature. The reference junction can be real or simulated.

For a real reference junction, the instrument performs a temperature measurement on a built-in cold junction compensator and uses that reading as the reference point for subsequent thermocouple measurements.

For a simulated reference junction, you enter a temperature reading to use as the reference temperature. An ice bath is typically used in determining a simulated reference junction.

Front-panel operation

Perform the following steps to configure the Model 2110 for thermocouple measurements:

1. Press the **SHIFT** key and then press **TEMP (TCOUP)**.
2. Select the sensor type (**B, C, E, J, K, N, R, S, or T**):
 - a. Press **CONFIG**, and with **TYPE** displayed, press **ENTER**.
 - b. Use the **◀** and **▶** keys to display a thermocouple type and press **ENTER**.
3. Select the temperature measurement units (**°C, °F, or K**):
 - a. Press **CONFIG**, use the **◀** and **▶** keys to display **UNITS**, and press **ENTER**.
 - b. Use the **◀** or **▶** key to display the units and press **ENTER**.
4. Select a reference junction (real or simulated):
 - a. Press **CONFIG**, use the **◀** and **▶** keys to display **RJUNCTION**, and press **ENTER**.
 - b. Use the **◀** or **▶** key to display **REAL** or **SIMULATED** and press **ENTER**.
 - c. If you select **SIMULATED**, use the **◀**, **▶**, **▲**, and **▼** keys to enter the reference temperature, and then press **ENTER**.

Perform the following steps to measure temperature:


1. Connect the thermocouple to the Model 2110, as shown below.
2. Press **SHIFT** and **TEMP (TCOUP)**.
3. Observe the temperature reading on the display.

Perform the following steps to measure the real temperature:

1. Press the **SHIFT** key and then press **TEMP (TCOUP)**.
 - a. Press **CONFIG**, and with **TYPE** displayed, press **ENTER**.
2. Press **CONFIG**, use the **◀** and **▶** keys to display **VIEW REAL**, and then press **ENTER**.
3. Observe the temperature reading (°C) on the display.

Connections to measure temperature using a thermocouple

Figure 23: Connections for thermocouple temperature measurements

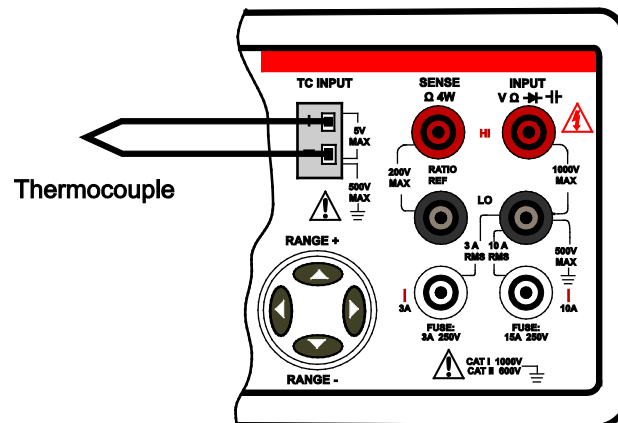

Remote operation**NOTE**

Commands that use the <n> parameter can use the **MIN**imum and **MAX**imum name parameters. **MIN** selects the minimum value and **MAX** selects the maximum value.

Use the following commands to configure temperature measurements:

UNIT <name>	Set temperature units
<name> = Cel	Celsius
= Far	Fahrenheit
= K	Kelvin
TCouple:TYPE <name>	Select the thermocouple type
<name> = B, C, E, J, K, N, R, S, or T	
TCouple:RJUNction:RSElect <name>	Select the reference junction
<name> = REAL	Real reference junction
= SIMulated	Simulated reference junction
TCouple:RJUNction:SIMulated <n>	Set simulated reference temperature
<n> = -100 to 100	Celsius

Use the following command to measure temperature and acquire the reading:

MEASure:TCouple?

Capacitance measurements

The measurement ranges for capacitance measurements are 1 nF, 10 nF, 100 nF, 1 µF, 10 µF, 100 µF, 1 mF, and 10 mF.


Front-panel operation

Perform the following steps to measure capacitance:

1. Connect the capacitance to the Model 2110, as shown below.
2. Press the **SHIFT** and **FREQ (Hz)** keys.
3. Select a measurement range (auto or manual):
 - Autorange is the power-on default. If manual ranging is selected (MAN indicator on), press **SHIFT** and **ESC (AUTO)** to select autorange.
 - For manual ranging, press the **RANGE ▲** and **▼** keys to select a measurement range.
4. Observe the reading on the display.

Connections to measure capacitance

Figure 24: Connections for capacitance

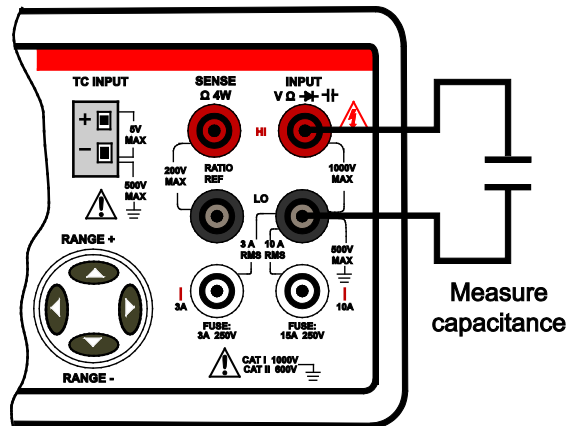

Remote operation

NOTE

Commands that use the <n> parameter can use the MINimum and MAXimum name parameters. MIN selects the minimum value and MAX selects the maximum value.

Use the following commands to select the capacitance function, set a measure range, and perform a measurement:

FUNCTION "CAPacitance"	Select capacitance function
CAPacitance:RANGE <n>	Set capacitance range
<n> = 0 to 10e-3	Specify expected capacitance reading
CAPacitance:RANGE:AUTO 	Enable or disable autorange
 = 0 or OFF	
= 1 or ON	
READ?	Perform measurement and acquire reading

Measurement configuration commands can also be used to perform measurements. Use the following command to select the capacitance function, set the measure range, set display resolution, perform a measurement, and acquire the reading.

MEASure:CAPacitance? <range>, <resolution>	
<range>= 0 to 10e-3	Expected capacitance reading

NOTE

Resolution is ignored for capacitance.

Secondary measurement function

The instrument provides dual measurement capability. When you enable the secondary measurement function, or second function (2ND), you make two measurements at the same time (series measurements). In the following table, the symbol (•) indicates which secondary measurement functions are available for each primary measurement function and the \dashv symbol indicates capacitance. Diode and continuity testing are not available as a secondary function.

Primary function	Secondary function											
	DCV	ACV	DCI	ACI	$\Omega 2/\Omega 4$	FREQ (VOLT)	FREQ (CURR)	PERIOD (VOLT)	PERIOD (CURR)	\dashv	TEMP (RTD)	TCOUPPL
DCV		•	•			•		•				•
ACV	•		•			•		•				•
DCI	•	•		•		•	•	•	•			•
ACI			•				•		•			•
$\Omega 2/\Omega 4$												•
FREQ (VOLT)	•	•	•					•				•
FREQ (CURR)			•	•					•			•
PERIOD (VOLT)	•	•	•			•						•
PERIOD (CURR)			•	•			•					•
\dashv												•
TEMP (RTD)												•
TCOUPPL	•	•	•	•	•	•	•	•	•	•	•	

To simultaneously measure DCI and DCV from the same input source, you have to use three test leads, as shown below. The voltage and current measurements share the same common lead at the INPUT LO terminal. However, the resistance of the external LO test lead and the resistance of the internal current measurement LO circuit affect measurement accuracy.

The resistance of the internal current measurement LO circuit is approximately 3 m Ω . If, for example, the LO test lead is 7 m Ω , the total common resistance is 10 m Ω . If 1 A is being measured by the instrument, the voltage would be affected as follows:

$$1 \text{ A} \times 10 \text{ m}\Omega = 10 \text{ mV}$$

Therefore, 10 mV of error is introduced into the voltage measurement.

Remote operation

The following command is used to select a primary or secondary function:

```
FUNction[1/2] "function"
```

When you use the number one (1) or no number, the primary function is selected. When you use the number two (2), the secondary function is selected. Here are some examples:

```
FUNction "VOLTage[:DC]"           Selects DCV as primary function
FUNction1 "VOLTage[:DC]"          Selects DCV as primary function
FUNction2 "VOLTage[:DC]"          Selects DCV as secondary function
```

Use the following commands to select a primary or secondary function:

```
FUNction[1/2] "VOLTage[:DC]"      DCV function
FUNction[1/2] "VOLTage:AC"        ACV function
FUNction[1/2] "CURRent[:DC]"      DCI function
FUNction[1/2] "CURRent:AC"        ACI function
FUNction[1/2] "FREQuency"         FREQ function
FUNction[1/2] "FREQuency[:VOLT]"  FREQ function (voltage input)
FUNction[1/2] "FREQuency:CURR"    FREQ function (current input)
FUNction[1/2] "PERiod"            PERIOD function
FUNction[1/2] "PERiod[:VOLT]"     PERIOD function (voltage input)
FUNction[1/2] "PERiod:CURR"       PERIOD function (current input)
FUNction[1/2] "RESistance"        Ω2 function
FUNction[1/2] "FRESistance"       Ω4 function
FUNction[1/2] "CAPacitance"       Capacitance function
FUNction[1/2] "TEMPerature"       TEMP (RTD) function
FUNction[1/2] "TCouple"           Thermocouple function
FUNction[1/2] "NONE"              Disable second function
FUNction[1/2]?                    Query the selected primary or secondary function
```

Triggering and data buffer

Triggering is used to initiate one or more measurements by the instrument digital multimeter. Up to 2000 readings can be stored in the data buffer (memory).

You can control instrument trigger operation from the front panel or through a remote interface.

Front panel triggering

There are two trigger modes for front panel operation: Auto triggering and single triggering.

Auto triggering

When the instrument is turned on, it goes into the auto triggering to perform continuous measurements. The reading rate depends on the trigger delay setting, integration time setting, and other instrument settings. See [Setting sample count from the front panel](#) (on page 3-34) to set the delay.

Press the **SHIFT** and **TRIGGER (AUTO)** keys to enable or restore auto triggering.

Single triggering

When you use single triggering, the instrument takes one reading (or a specified number of readings) each time you press the **TRIGGER** key. The reading rate depends on the trigger delay setting, integration rate setting, and other instrument settings. See [Setting trigger delay from the front panel](#) (on page 3-36) to set the delay.

A sample counter determines the number of measurements to perform when the **TRIGGER** key is pressed. After the specified number of measurements are performed, the instrument waits for the **TRIGGER** key to be pressed again. See [Setting sample count from the front panel](#) (on page 3-34) to set the sample count. When the TRIG indicator is displayed, the instrument is ready for the next trigger event.

NOTE

Single triggering is not available for the diode and continuity functions.

To use single triggering, press the **TRIGGER** key to trigger one or more measurements.


Remote triggering

The trigger model for remote operation is shown below.

NOTE

Remote triggering has an infinite trigger count and a maximum sample count of 50,000. When you use remote commands to set the trigger count and sample count and either one of these counts exceeds 9999, the front panel display shows the overflow message OVLD. This is because the front panel can only display four digit numbers.

Figure 26: Remote trigger model

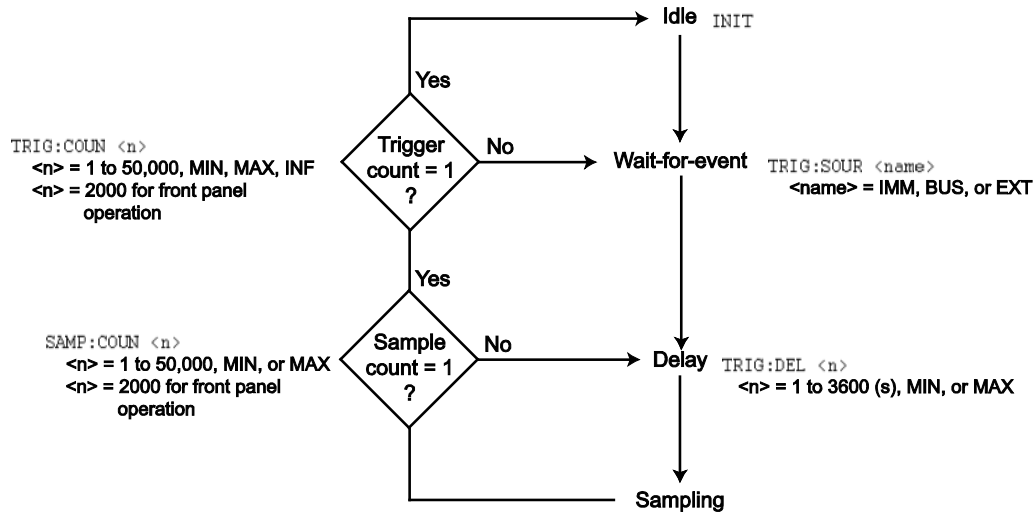

Measurements begin when the instrument leaves the Idle state and then receives a trigger while in the "waiting-for-event" state.

The reading rate depends on the trigger delay setting, integration time setting, and other instrument settings. See [Setting trigger delay using remote operation](#) (on page 3-36) to set the trigger delay.

Sample and trigger counters determine the number of measurements that are performed.

- The sample count is the number of measurements to perform for each trigger event.
- The trigger count is the number of trigger events the instrument accepts before entering the Idle state.

The number of measured readings is the product of the trigger count and sample count. For example, if the trigger count is 10 and the sample count is 20, the total number of measurements is 200 (20 x 10).

See [Setting sample count using remote operation](#) (on page 3-34) and [Setting trigger count using remote operation](#) (on page 3-34) to set the counters.

Triggering example:

Assume the sample count is 10 and the trigger count is two (2). The instrument will accept two trigger events. Upon receiving the first trigger, 10 measurements are performed. When the second trigger is received, 10 more measurements are performed. The instrument then returns to the idle state.

Trigger sources

There are three trigger sources for remote operation: Immediate, software (or bus), and external.

Immediate triggering

When the instrument is in the immediate trigger mode, a trigger is internally generated immediately after it goes into the "wait-for-event" state.

The internal immediate trigger mode is only available using remote operation, and is the default setting for the remote interface.

Use the following command to select internal immediate triggering:

```
TRIGger:SOURce IMMEDIATE
```

Software triggering

Software triggering is similar to single triggering. Instead of using the **TRIGGER** key on the front panel, a command generates a trigger event.

Use the following command to select the software trigger source:

```
TRIGger:SOURce BUS
```

Use the following command to take the instrument out of the idle state and into the "wait-for-event" state:

```
INITiate
```

Use the following command to generate a trigger event:

```
*TRG
```

External triggering


The instrument is triggered by a pulse received from an external instrument. When the rear panel EXT TRIG (external trigger) terminal receives this pulse from the external trigger source, the instrument performs one or more measurements.

After each measurement, the instrument provides an output pulse on the VM COMP (voltmeter complete) terminal. This output pulse can be used to trigger another instrument to perform additional operations.

A typical application for external triggering is to use the instrument with a switch system that also has external triggering capability. The drawing below shows an automated test system to measure 10 DUTs.

The instrument is externally triggered to perform a measurement when a channel closes in the switch system. The switch system then receives the voltmeter complete (VM COMP) pulse when the measurement is complete which then closes the next channel. This handshake sequence between the instrument and switch system continues until all the 10 DUTs are measured.

Figure 27: DUT test system using external triggering

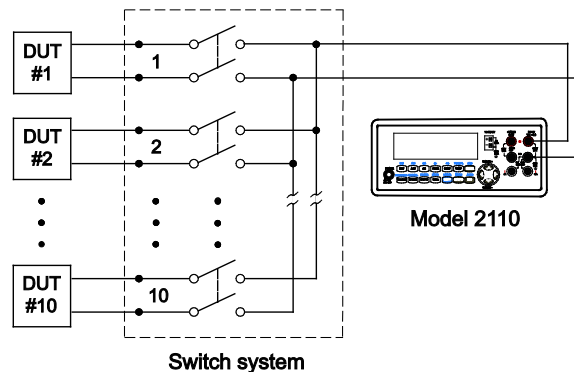


Use the following command to enable external triggering:

```
TRIGger:SOURce EXTernal
```


EXT TRIG terminal

The **EXT TRIG** (external trigger) terminal is located on the instrument's rear panel. Use this terminal to trigger the instrument by sending it a low-true pulse.

In addition, you can trigger the instrument by connecting a simple switch to the **EXT TRIG** terminal.

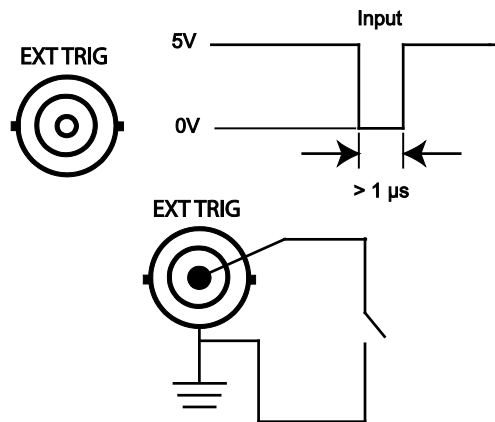Figure 28: EXT TRIG terminal**VM COMP terminal**

The **VM COMP** (voltmeter complete) BNC terminal located on the rear panel outputs a low-true pulse after finishing each measurement.

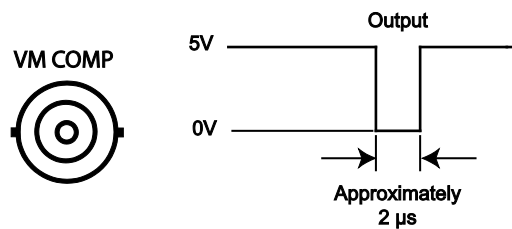Figure 29: VM COMP terminal**Trigger settings**

The following settings are used to configure triggering:

- Sample count
- Trigger count
- Trigger delay
- Reading hold

Sample count, trigger delay, and reading hold can be set from the front panel.

Sample count, trigger count, and trigger delay can be set using remote operation.

NOTE

See [Data buffer](#) (on page 3-37) for information about storing measured readings in the buffer.

Sample count

The sample count is the number of measurements (up to 2000) to perform each time the instrument is triggered.

The sample count is stored in volatile memory. It defaults to one (1) when instrument power is turned off and then turned on again.

Setting sample count from the front panel

Perform the following steps to set the sample count:

1. Press the **SHIFT** and **CONFIG (MENU)** keys to display the MENU options.
2. Use the ◀ and ▶ keys to display **TRIG SYS** and press **ENTER**.
3. Use the ◀ and ▶ keys to display **SAMPLE CNT** and press **ENTER**.
4. Use the ◀, ▶, ▲, and ▼ keys to specify the sample count (1 to 2000) and press **ENTER**.

Setting sample count using remote operation

NOTE

Commands that use the <n> parameter can use the **MINimum** and **MAXimum** name parameters. **MIN** selects the minimum value and **MAX** selects the maximum value.

Use the following command to set the sample count:

```
SAMPlE:COUNT <n>
```

<n> = 1 to 2000 Sample count

Trigger count

For remote operation, the trigger count (up to 2000) specifies how many times the "sample count" measurements can be performed. Trigger count is ignored for front-panel operation.

The trigger count is stored in volatile memory. It defaults to one (1) when instrument power is turned off and then turned on again.

Setting trigger count using remote operation

NOTE

Commands that use the <n> parameter can use the **MINimum** and **MAXimum** name parameters. **MIN** selects the minimum value and **MAX** selects the maximum value.

NOTE

Front-panel trigger count settings are not active. You can only change the trigger count using remote operation.

Use the following command to set the trigger count:

```
TRIGger:COUNT <n>
```

<n> = 1 to 2000 Trigger count

Trigger delay

A trigger delay is normally used to allow an input signal time to settle before making the measurement. Settling time is affected by the measurement range, test cable properties, and the signal source.

The power-on default setting is auto delay. The auto delay period is determined by the selected combination of measurement function, range, integration time, and AC filter speed.

When not using auto trigger delay, you can manually set the delay time from 0 to 3600 seconds. Your trigger delay time is stored in volatile memory; automatic trigger delay will be used when instrument power is turned off and then turned on again.

The following table lists the auto delay times for each measurement function if you do not specify a delay.

Auto trigger delay times

Measurement	Setting	Trigger delay
DCV / DCI	PLC \geq 1	1.5 ms
	PLC $<$ 1	1 ms
ACV / ACI (Remote interface/external trigger/single trigger)	3 Hz	7.0 s
	20 Hz	1.0 s
	200 Hz	600 ms
ACV / ACI (Front panel with auto trigger enabled)	3 Hz	1.5 s
	20 Hz	200 ms
	200 Hz	100 ms
Ω 2 and Ω 4 (PLC \geq 1)	100 Ω to 100 k Ω	1.5 ms
	1 M Ω	15 ms
	10 M Ω to 100 M Ω	100 ms
Ω 2 and Ω 4 (PLC $>$ 1)	100 Ω to 100 k Ω	1.0 ms
	1 M Ω	10 ms
	10 M Ω to 100 M Ω	100 ms
Frequency / Period	Remote interface / external	1.0 s
	Front panel with auto trigger enabled	0 s
Capacitance	1 nF to 10 mF	0 s

Setting trigger delay from the front panel

When not using auto trigger delay, you can manually set the delay time from 0 to 3600 seconds (100 μ s resolution). Your trigger delay time is stored in volatile memory; automatic trigger delay will be used when instrument power is turned off and then turned on again.

To set trigger delay (auto or manual) from the front panel:

1. Press the **SHIFT** and **CONFIG (MENU)** keys to display the **MENU** options.
2. Use the **◀** and **▶** keys to display **TRIG SYS** and press **ENTER**.
3. Use the **◀** and **▶** keys to display **DELAY** and press **ENTER**.
4. Use the **◀** or **▶** key to display **AUTO** or **MANUAL** and press **ENTER**. If you select **AUTO**, you will exit from the menu structure with auto delay enabled.
5. For a manual delay, use the **◀**, **▶**, **▲**, and **▼** keys to specify the trigger delay (0 to 3600 seconds) and press the **ENTER** key.

Setting trigger delay using remote operation

NOTE

Commands that use the <n> parameter can use the **MINimum** and **MAXimum** name parameters. **MIN** selects the minimum value and **MAX** selects the maximum value.

Use the following commands to set trigger delay (auto or manual):

TRIGger:DElay <n>

<n> = 0 to 3600 Trigger delay in seconds (100 μ s resolution)

TRIGger:DElay:AUTO

 = 0 or OFF Disable auto delay
 = 1 or ON Enable auto delay

Reading hold

For front panel operation, the reading hold feature captures and holds a stable reading on the display. Reading hold is not available for remote operation.

A reading is considered stable when three consecutive measurements are within a sensitivity band. When a reading falls outside of the sensitivity band, the instrument issues an audible beep and displays the new stable reading.

This sensitivity band is expressed as a percent of reading on the selected range, and can be set by the user from the front panel. The sensitivity band can be set to 0.01 percent, 0.1 percent, 1.0 percent, or 10.0 percent. The 0.1 percent setting is the power-on default.

Setting reading hold from the front panel

Reading hold is enabled by pressing **SHIFT** and then **TRIGGER** until the HOLD indicator turns on. To disable reading hold, press **SHIFT** again and then press **TRIGGER** (HOLD indicator turns off).

Perform the following steps to change the sensitivity band for reading hold:

1. Press the **SHIFT** and **CONFIG (MENU)** keys to display the **MENU** options.
2. Use the ◀ and ▶ keys to display **TRIG** and press **ENTER**.
3. Use the ◀ and ▶ keys to display **READ HOLD** and press **ENTER**,
4. Use the ◀ and ▶ keys to display the desired band setting (**0.01 %**, **0.1 %**, **1.0 %**, or **10.0 %**) and press **ENTER**.

Data buffer

The instrument can store up to 2000 readings in its volatile memory. The readings are stored in a first-in-first-out (FIFO) order. All the readings are lost when power is turned off.

You can store readings from all measurement functions, math operations, and reading hold. The MEM indicator on the display turns on when the data store is enabled from the front panel.

Front-panel operation

Before using the data store, select and configure a measurement function.

Perform the following steps to store and recall readings:

1. Set the number of readings to store:
 - a. Press the **SHIFT** and **CONFIG (MENU)** keys to display the **MENU** options.
 - b. Use the ◀ and ▶ keys to display **TRIG SYS** and press **ENTER**.
 - c. Use the ◀ and ▶ keys to display **STORE RDGS** and press **ENTER**.
 - d. Use the ◀, ▶, ▲, and ▼ keys to specify the number of readings to store (1 to 2000) and press **ENTER**.
2. Press **STORE** to start the storage process. The MEM display indicator turns on while readings are being stored; wait for the storage process to finish (MEM indicator turns off) before recalling stored readings.
3. Press **SHIFT** and **STORE (RECALL)** to display the first stored reading:
 - To scroll through the stored readings, use the ◀ and ▶ keys.
 - To specify the reading to display, press the ▼ key and use the ◀, ▶, ▲, and ▼ keys to select the reading number, and then press **ENTER**.
4. When finished, press **ESC**.

When using auto triggering, readings are stored into the data buffer immediately after the **STORE** key is pressed. The MEM indicator turns off when the specified number of readings are stored. See [Auto triggering](#) (on page 3-29) for details.

When using single triggering, pressing the **TRIGGER** key after the **STORE** key is pressed allows the first reading to be stored in the data buffer. Each subsequent **TRIGGER** key-press stores another reading until the specified number of readings are stored (MEM indicator turns off). See [Single triggering](#) (on page 3-29) for details.

Remote operation

When the instrument is triggered to start performing measurements, it stores a specified number of measurement readings in the data buffer (memory).

The total number of measurements the instrument takes is the product of the trigger count and sample count. See [Sample count](#) (on page 3-34) and [Trigger count](#) (on page 3-34) for details.

Use the following command to place the instrument in the wait-for-trigger state:

```
INITiate
```

Use the following command to retrieve the stored readings:

```
FETCh?
```

Use the following command to query the number of stored readings:

```
DATA:POINTs?
```

Enhancing measurement performance

The following features and settings can be used to optimize measurement performance:

- [Autozero](#) (on page 3-38)
- [Range selection](#) (on page 3-39)
- [Resolution and integration time](#) (on page 3-41)
- [Digital filter](#) (on page 3-45)
- [Math operations](#) (on page 3-47)

Autozero

During normal operation, two measurements are performed for each reading. The input signal is measured and then zero is measured. For the zero measurement, the input signal is internally disconnected and the zero offset is measured. The instrument then subtracts the zero offset from the signal measurement and displays the reading:

$$\text{Displayed reading} = \text{Input signal measurement} - \text{Zero offset measurement}$$

Autozero results in accurate measured readings by canceling out the zero offset. Auto zero is enabled when the instrument is turned on.

Autozero can be disabled to increase measurement speed at the expense of accuracy. When you select a different measurement function with autozero disabled, autozero will be performed once. Subsequent measurements will not cancel out the zero offset.

Autozero can be disabled or enabled from the front panel or by using remote operation. For remote operation, autozero can be performed once. This allows you to periodically establish a new zero baseline when performing measurements with autozero disabled.

Front-panel operation

Perform the following steps to control autozero:

1. Press the **SHIFT** and **CONFIG (MENU)** keys.
2. Use the **◀** and **▶** keys to display **SET ADC** and press **ENTER**.
3. With **AUTO ZERO** displayed, press **ENTER**.
4. Use the **◀** or **▶** key to display **ON** or **OFF** and press **ENTER**.

Remote operation

Use the following command to use autozero:

SENSe:ZERO:AUTO <name>		Control autozero
<name>	= ON	Enable autozero
	= OFF	Disable autozero
	= ONCE	Perform autozero once

Range selection

For best accuracy and resolution, always use an appropriate range to perform the measurement. With autorange enabled, the instrument will automatically select the optimum measurement range. Autorange is the power-on default setting.

You can select a measurement range (or autorange) in a couple of ways:

- Use the front-panel keys to select a range or control autorange.
- Use a configuration menu to select a range or control autorange.

The difference between autoranging and manual ranging is the settling time. Autorange is convenient, but a manually selected range can usually speed up the process.

If the input signal exceeds the allowable range, the "OVLd" message is displayed. The threshold for readings are 120 percent of the range for maximum and 10 percent of the range for minimum.

NOTE

The measurement range for temperature, continuity, and diode testing is fixed and cannot be changed.

Front-panel operation

Perform the following steps to set measurement range using the front panel keys:

1. Select a measurement function.
2. Select a measurement range or use autorange:
 - Use the **RANGE ▲** and **▼** keys to select a range. The MAN indicator turns on to indicate that manual ranging is being used.
 - Pressing **SHIFT** and then **ESC (AUTO)** toggles the instrument between manual ranging and autorange. When autorange is selected, the MAN indicator is off.

Remote operation

NOTE

Commands that use the <n> parameter can use the MINimum and MAXimum name parameters. MIN selects the minimum value and MAX selects the maximum value.

Use the following commands to set a measurement range:

<function>:RANGe <n>		Specify expected reading	
<function>	= VOLTage[:DC]	<n>	= -1000 to 1000 Volts DC
	= VOLTage:AC		= 0 to 750 Volts AC
	= CURRent[:DC]		= -10 to 10 Amps DC
	= CURRent:AC		= 0 to 10 Amps AC
	= RESistance		= 0 to 100e6 Ohms (2-wire)
	= FRESistance		= 0 to 100e6 Ohms (4-wire)
	= FREQuency[:VOLT]		= 0 to 750 Volts AC (voltage input)
	= FREQuency:CURRent		= 0 to 10 Amps AC (current input)
	= PERiod[:VOLT]		= 0 to 750 Volts AC (voltage input)
	= PERiod:CURRent		= 0 to 10 Amps AC (current input)
	= CAPacitance		= 0 to 10e-3 Farads
<function>:RANGe:AUTO 		Enable or disable autorange	
<function>	= VOLTage[:DC]		= 0 or OFF Disable autorange
	= VOLTage:AC		= 1 or ON Enable autorange
	= CURRent[:DC]		
	= CURRent:AC		
	= RESistance		
	= FRESistance		
	= FREQuency[:VOLT]		
	= FREQuency:CURRent		
	= PERiod[:VOLT]		
	= PERiod:CURRent		
	= CAPacitance		

Resolution and integration time

Integration time can be set for the following measurement functions:

- Number of power line cycles (NPLC) can be set for the DCV, DCI, $\Omega 2$, and $\Omega 4$ functions.
- Bandwidth can be set for the ACV and ACI functions.
- Aperture can be set for the FREQ and PERIOD functions.

Model 2110 has both 5½-digit and 4½-digit display resolution on the front panel for the following measurement functions: DCV, DCI, ACV, ACI, $\Omega 2$, $\Omega 4$, FREQ, PERIOD, TEMP (RTD), and TCOUPL. The actual reading resolution acquired using remote operation can only be set for DCV, DCI, ACV, ACI, $\Omega 2$, and $\Omega 4$.

Integration time and resolution for DC and resistance measurements

Integration time for DCV, DCI, $\Omega 2$, and $\Omega 4$ measurements is expressed as the number of power line cycles (NPLC).

For 50 Hz line power:

$$1 \text{ PLC} = 1/50 = 0.02 \text{ s (per measurement conversion)}$$

For 60 Hz line power:

$$1 \text{ PLC} = 1/60 = 0.0167 \text{ s (per measurement conversion)}$$

The relationship among display resolution, integration time, and reading resolution is shown in the table below. When you set the integration time, the instrument automatically updates the reading resolution. For example, if for the 100 VDC range you set the integration time to 0.006 PLC, the display resolution sets to 4½ digits and the reading resolution automatically sets to 0.02 (0.0002 x 100 V).

The default integration time setting is 1 PLC.

Integration time and resolution settings for DCV

Display resolution	Integration time	Measurement resolution (remote operation)
4½ digits	0.001 PLC	0.0003 x full scale range
4½ digits	0.006 PLC	0.0002 x full scale range
4½ digits	0.02 PLC	0.0001 x full scale range
4½ digits	0.06 PLC	0.00005 x full scale range
5½ digits	0.2 PLC	0.00001 x full scale range
5½ digits	0.6 PLC	0.000005 x full scale range
5½ digits	1 PLC	0.000003 x full scale range
5½ digits	2 PLC	0.000002 x full scale range
5½ digits	10 PLC	0.000001 x full scale range
5½ digits	100 PLC	0.000003 x full scale range

Front-panel operation

Perform the following steps to set display resolution:

1. Select the DCV, DCI, $\Omega 2$, or $\Omega 4$ measurement function.
2. Use the **DIGITS** key to set display resolution. Each key-press toggles the display between 4½ and 5½ digits.

Perform the following steps to set the integration time (speed):

1. Select the DCV, DCI, $\Omega 2$, or $\Omega 4$ measurement function.
2. Press the **CONFIG** key, use the ◀ and ▶ keys to display NPLC, and press **ENTER**.
3. Use the ◀ and ▶ keys to display a PLC value and press **ENTER**.

Remote operation

NOTE

Commands that use the <n> parameter can use the MINimum and MAXimum name parameters. MIN selects the minimum value and MAX selects the maximum value.

Use the following commands to set the integration time:

VOLTtage[:DC]:NPLCycles <n>	Set integration time for DCV
CURRent[:DC]:NPLCycles <n>	Set integration time for DCI
RESistance:NPLCycles <n>	Set integration time for $\Omega 2$
FRESistance:NPLCycles <n>	Set integration time for $\Omega 4$
<n> = 0.001 to 100	Number of power line cycles (NPLC)

Use the following commands to set resolution:

VOLTtage[:DC]:RESolution <n>	Set integration time for DCV
CURRent[:DC]:RESolution <n>	Set integration time for DCI
RESistance:RESolution <n>	Set integration time for $\Omega 2$
FRESistance:RESolution <n>	Set integration time for $\Omega 4$
<n> = (See note)	Measurement resolution

NOTE

The resolution setting range for <resolution> depends on the selected function and range. The maximum value for DC measurement is $3.00e-04 \times$ full-scale range, and the minimum value is $3.00e-07 \times$ full-scale range. For example, for DCV 1000 V range, the minimum value is $(3.00e-07 \times 1000 \text{ V} = 3.00e-04)$. The maximum value is $(3.00e-04 \times 1000 \text{ V} = 3.00e-01)$. Therefore, <resolution> = $3.00e-04$ to $3.00e-01$ for the DCV 1000 V range.

For example, for DCI 10 A range, the minimum value is $(3.00e-07 \times 10 \text{ A} = 3.00e-06)$. The maximum value is $(3.00e-04 \times 10 \text{ A} = 3.00e-03)$. Therefore, <resolution> = $3.00e-06$ to $3.00e-03$ for the DCI 10 A range.

For example, for $\Omega 2$ and $\Omega 4$ $1.00e+08 \Omega$ range, the minimum value is $(3e-07 \times 1.00e+08 \Omega = 30)$. The maximum value is $(3.00e-04 \times 1.00e+08 \Omega = 3.00e+04)$. Therefore, <resolution> = 30 to $3.00e+04$ for the $\Omega 2$ and $\Omega 4$ $1.00e+08 \Omega$ range.

Bandwidth and resolution for AC measurements

An AC filter is used for ACV and ACI measurements. The AC filter affects measurement speed. As shown in the table below, there are three bandwidth settings for the AC filter: Slow, medium, and fast. The slow AC filter is used for higher accuracy while the fast filter is used for fast settling time. The medium filter is a compromise between accuracy and speed.

The default bandwidth setting is 20 Hz (medium). Bandwidth and resolution can be set from the front panel or by using remote programming.

The default AC filter is 20 Hz (medium). The AC bandwidth setting is stored in volatile memory. The medium setting is restored when power to the instrument is cycled.

AC filter bandwidth

Bandwidth	AC filter	Time
3 Hz to 300 kHz	Slow	7 s per reading
20 Hz to 300 kHz	Medium	1 s per reading
200 Hz to 300 kHz	Fast	0.1 s per reading

The AC filter can be set from the front panel or remote operation.

Front-panel operation

Perform the following steps to set the AC filter:

1. Press the **ACV** and **CONFIG** keys.
2. Use the ◀ or ▶ key to display **BAND WIDTH** and press **ENTER**.
3. Use the ◀ or ▶ key to display the bandwidth setting (**3 Hz**, **20 Hz**, or **200 Hz**) and press **ENTER**.

Perform the following steps to set display resolution:

1. Select the **ACV** or **ACI** measurement function.
2. Use the **DIGITS** key to set display resolution. Each key-press toggles the display between 4½ and 5½ digits.

Remote operation

NOTE

Commands that use the <n> parameter can use the **MINimum** and **MAXimum** name parameters. **MIN** selects the minimum value and **MAX** selects the maximum value.

Use the following command to set AC bandwidth:

```
DETECTOR: BANDwidth <n>
```

<n> = 3	3 Hz setting
= 20	20 Hz setting
= 200	200 Hz setting

Use the following commands to set resolution:

VOLTtage: AC: RESolution <n>	Set resolution for ACV
CURRent: AC: RESolution <n>	Set resolution for ACI
<n> = (See Note)	Measurement resolution

NOTE

The resolution setting range for <resolution> depends on the selected function and range. The maximum value for AC measurement is $1.00e-04 \times$ full-scale range, and the minimum value is $1.00e-06 \times$ full-scale range.

For example, for ACV 750 V range, the minimum value is ($1.00e-06 \times 750 \text{ V} = 1.00e-03$). The maximum value is ($1.00e-04 \times 750 \text{ V} = 1.00e-01$). Therefore, <resolution> = $1.00e-03$ to $1.00e-01$ for the ACI 10A range.

For example, for ACI 10 A range, the minimum value is ($1.00e-06 \times 10 \text{ A} = 1.00e-05$). The maximum value is ($1.00e-04 \times 10 \text{ A} = 1.00e-03$). Therefore, <resolution> = $1.00e-05$ to $1.00e-03$ for the ACI 10A range. The 750 V range is treated as a 1000 V range for the purposes of resolution calculations.

Aperture and resolution for frequency and period measurements

For frequency and period measurements, aperture is analogous to integration time. The aperture settings are 0.01 second (4½-digit resolution), 0.1 second (5½-digit resolution), or 1 second (5½-digit resolution). The default aperture is 0.1 second (5½-digit resolution).

You can set display resolution for 4½-digit or 5½-digit resolution. Changing the display resolution may change the aperture. Selecting 4½-digit resolution will set the aperture to 0.01 second. Selecting 5½-digit resolution will set the aperture to 0.1 second.

Resolution cannot be set using remote programming.

Front-panel operation

Perform the following steps to set the aperture (integration time):

1. Select the frequency or period measurement function:
 - To select frequency, press the **FREQ** key.
 - To select period, press **FREQ** and then **CONFIG**. With **PERIOD** displayed, press **ENTER**.
2. Select the **FREQ** or **PERIOD** measurement function.
3. Press the **CONFIG** key, use the ◀ and ▶ keys to display **APERTURE**, and then press **ENTER**.
4. Use the ◀ and ▶ keys to display a aperture time and press **ENTER**.

Perform the following steps to set display resolution:

1. Select the frequency or period measurement function:
 - To select frequency, press the **FREQ** key.
 - To select period, press **FREQ** and then **CONFIG**. With **PERIOD** displayed, press **ENTER**.
2. Use the **DIGITS** key to set display resolution. Each key-press toggles the display between 4½ and 5½ digits.

Remote operation

NOTE

Commands that use the <n> parameter can use the **MIN**imum and **MAX**imum name parameters. **MIN** selects the minimum value and **MAX** selects the maximum value.

Use the following commands to set the aperture time:

<code>FREQuency:APERture <n></code>	Set aperture time for FREQ
<code>PERiod:APERture <n></code>	Set aperture time for PERIOD
<n> = 0.01	0.01 s aperture
= 0.1	0.1 s aperture
= 1	1 s aperture

Digital filter

The digital filter lets you set the filter response to stabilize noisy measurements. The instrument uses a digital filter, which is based on reading conversions. The displayed, stored, or transmitted reading is an average of a number of reading conversions (from 2 to 100).

Filtered readings are stored in stack memory. There are two types of digital filter: Moving average and repeating average.

- The moving average filter places the specified number of reading conversions in a first-in, first-out (FIFO) order. The first measured reading fills up the stack. The filter averages the readings in the stack to yield a single reading.
Each subsequent measurement conversion replaces the oldest reading in the stack. The readings in the stack are again averaged to yield a single reading.
- The repeating average filter waits for the stack to fill with measurement conversions. It then averages the readings in the stack to yield a single reading. For each subsequent measurement, the filter flushes the stack, waits for the stack to fill again, and then averages the readings to yield another single reading.

The digital filter is not available for diode, continuity, frequency, or period measurements.

The digital filter setting is stored in volatile memory. On power-up, the moving average filter is enabled (average 10 readings).

Front-panel operation

Perform the following steps to set and enable the digital filter for the selected function:

1. Select a measurement function. For example, press the **DCV** key to select the DC volts function.
2. Press the **SHIFT** and **DIGITS (FILTER)** keys.
3. Use the ◀ and ▶ keys to display the filter type (**MOVING AVG** or **REPEAT AVG**) and press **ENTER**.
4. Press the ▶ key to display **READINGS** and press **ENTER**.
5. Use the ◀, ▶, ▲, and ▼ keys to specify the number of readings to average and press **ENTER**.
6. With **RUN** displayed, press **ENTER** to enable the filter. The **FILT** indicator turns on when the digital filter is enabled.

Perform the following steps to disable the digital filter for the selected function:

1. Press the **SHIFT** and **DIGITS (FILTER)** keys.
2. Use the ◀ key to display **OFF** and press **ENTER**. The **FILT** indicator turns off.

Remote operation

NOTE

Commands that use the <n> parameter can use the **MIN**imum and **MAX**imum name parameters. **MIN** selects the minimum value and **MAX** selects the maximum value.

Use the following commands to configure and enable the digital filter:

<code>AVERage:TCONtrol <name></code>		Select filter type
<name>	= MOVing	Moving average filter
	= REPeat	Repeating average filter
<code>AVERage:COUNT <n></code>		Set number of readings to average
<n>	= 2 to 100	Number of readings to average
<code>AVERge:STATe </code>		Enable or disable digital filter
	= 0 or OFF	Disable digital filter
	= 1 or ON	Enable digital filter

Math operations

The instrument can perform the following math operations:

- PERCENT
- AVERAGE
- NULL
- LIMITS
- MX+B
- dB
- dBm

You can apply these math operations to all measurement functions except continuity and diode testing. The MATH indicator for the display turns on when a math operation is enabled.

Percent

This mathematical function calculates the ratio of a measured reading to a specified target value in the form of a percentage. The equation to calculate percent is shown as follows:

$$\text{Percent} = \frac{\text{Input reading}}{\text{Target value}} \cdot 100$$

The set target value is stored in volatile memory and is cleared after the instrument has been turned off or a remote interface reset occurs.

Front-panel operation

Perform the following steps to use the percent math function:

1. Press the **SHIFT** and **NULL (MATH)** keys.
2. Use the ◀ and ▶ keys to display **PERCENT** and press **ENTER**.
3. Use the ◀ and ▶ keys to display **TARGET** and press **ENTER**.
Note that if you select the **RUN** menu option instead, the percent function will enable using the current target value.
4. Use the ◀, ▶, ▲, and ▼ keys to enter the target value. Note that the polarity sign can be toggled between plus and minus.
5. Press the **ENTER** key. The MATH indicator turns on.

You can disable the math operation by pressing a different function key. You can also disable it from the math menu as follows:

1. Press the **SHIFT** and **NULL (MATH)** keys.
2. Use the ◀ and ▶ keys to display **OFF** and press **ENTER**.

Remote operation**NOTE**

Commands that use the <n> parameter can use the **MIN**imum and **MAX**imum name parameters. **MIN** selects the minimum value and **MAX** selects the maximum value.

Use the following commands to configure and control the percent math function:

<code>CALCulate:FUNCTION PERCent</code>	Select the percent math function
<code>CALCulate:PERCent:TARGet <n></code>	Set target value
<code><n></code>	= (see Note) Set target value (1 μ resolution)

NOTE

The target value setting range depends on the selected function. For example, for DCV, the target value can be set from -1200 to 1200.

<code>CALCulate:STATe </code>	Enable or disable math operations
<code></code>	= 0 or OFF Disable math
	= 1 or ON Enable math

Average

When the average math function is enabled, the instrument performs measurements and displays the average reading in the secondary display. It can also display the minimum and maximum readings, as well as the reading count.

The data acquired by the average math function is stored in volatile memory. It is lost when power to the instrument is cycled or when the remote interface is reset.

The average math function can be used from the front panel or by using remote operation.

Front-panel operation

Perform the following steps to use the average math function:

1. Press the **SHIFT** and **NULL (MATH)** keys.
2. Use the **◀** and **▶** keys to display **AVERAGE** and press **ENTER**.
3. With **RUN** displayed, press **ENTER**. The **MATH** indicator turns on.
The primary (top) display shows the measured readings, and the secondary (bottom) display shows the average (**AVG**) reading of the measurements that have already been performed.
4. Use the **◀** and **▶** keys to change the secondary display to show the maximum (**MAX**) minimum (**MIN**) readings, and the reading count (**COUNT**).

You can disable the math operation by pressing a different function key. You can also disable it from the math menu as follows:

1. Press the **SHIFT** and **NULL (MATH)** keys.
2. Use the **◀** and **▶** keys to display **OFF** and press **ENTER**.

Remote operation

Use the following commands to configure and control the average math function:

CALCulate:FUNCTION AVERAge	Select the average math function
CALCulate:STATE 	Enable or disable math operations
 = 0 or OFF	Disable math
= 1 or ON	Enable math

Use the following commands to acquire the count, minimum, maximum, and average readings:

```
CALCulate:AVERAge:MINimum?
CALCulate:AVERAge:MAXimum?
CALCulate:AVERAge:AVERAge?
CALCulate:AVERAge:COUNT?
```

Null

When the null feature is enabled, the displayed reading is the difference between the measured input signal and the stored null (also called relative) value:

$$\text{Displayed reading} = \text{Measured input reading} - \text{Null value}$$

You can acquire the null (relative) value by measurement or by specifying the value. The null value is stored in volatile memory, which will be cleared when power to the instrument is cycled.

Typical uses of the null feature:

- Cancel out test-lead resistance that can result in inaccurate low-level resistance Measurements. The subsequent resistance measurement reading will exclude the test lead resistance.
- Establish a baseline level (such as a voltage) that will shift the measured reading. For example, If a 5 V null level is set, the measurement of a 5 V input signal will be displayed as 0 V.

The null feature is available for all functions (except continuity and diode).

The null feature and other math functions may not be used at the same time.

The null feature can be used from the front panel or by using remote operation.

Front-panel operation

Perform the following steps to use a measured value as the null value:

1. Select and configure a measurement function.
2. Connect the null signal or device to the input of the instrument.
To null out test-lead resistance, connect the test leads to the input and short them together.
3. Press the **NULL** key. The MATH indicator turns on and display reads zero (or near zero).
4. Disconnect the null signal or device and connect the signal or device to be measured. Each reading on the display is the result of the measured reading minus the null value.

Perform the following steps to enter a null value:

1. Select and configure a measurement function. For example, press the **DCV** key to select the DC volts function.
2. Press the **SHIFT** and **NULL (MATH)** keys.
3. Use the ◀ and ▶ keys to display **NULL** and press **ENTER**.
4. Use the ◀ and ▶ keys to display **NULL VALUE** and press **ENTER**.
Note that if you select the **RUN** menu option instead, the null feature will enable using the present null value.
5. Use the ◀, ▶, ▲, and ▼ keys to set the null value. Note that the polarity sign can be toggled between plus and minus.
6. Press the **ENTER** key. The MATH indicator turns on.

You can disable the math operation by pressing the NULL key. You can also disable it from the math menu as follows:

1. Press the **SHIFT** and **NULL (MATH)** keys.
2. Use the ◀ and ▶ keys to display **OFF** and press **ENTER**.

Remote operation

NOTE

Commands that use the <n> parameter can use the **MIN**imum and **MAX**imum name parameters. **MIN** selects the minimum value and **MAX** selects the maximum value.

Use the following commands to configure and control the null feature:

<code>CALCulate:FUNCTION NULL</code>	Select the null feature
<code>CALCulate:NULL:OFFSet <n></code>	Set the null value
<code><n> = (see Note)</code>	Set value (1 μ resolution)

NOTE

The null value setting range depends on the selected function. For example, for DCV, the null value can be set from -1200 to 1200.

<code>CALCulate:STATe </code>	Enable or disable the null feature
<code> = 0 or OFF</code>	Disable the null feature
<code>= 1 or ON</code>	Enable the null feature

Limits

Limit testing allows you to set high and low limit values. When the reading falls outside these limits, the instrument beeps and displays the "HI" or "LO" message.

The limit values are stored in volatile memory. The values are reset to zero when the instrument is turned off. Limits can be used with all measurements (except continuity and diode measurements).

Front-panel operation

Perform the following steps to use the limits feature:

1. Press the **SHIFT** and **NULL (MATH)** keys.
2. Use the ◀ and ▶ keys to display **LIMITS** and press **ENTER**.
3. Set the high and low limits:
 - a. Use the ◀ and ▶ keys to display **HIGH LIMIT** and press **ENTER**.
Note that if you select the **RUN** menu option instead, the limits feature will enable using the present limit values.
 - b. Use the ◀, ▶, ▲, and ▼ keys to set the high limit. Note that the polarity sign can be toggled between plus and minus. Press the **ENTER** key.
 - c. Use the ◀ and ▶ keys to display **LOW LIMIT** and press **ENTER**.
 - d. Use the ◀, ▶, ▲, and ▼ keys to set the low limit and press **ENTER**.
4. With **RUN** displayed, press **ENTER**. The MATH indicator turns on and limit testing starts.

You can disable the math operation by pressing a different function key. You can also disable it from the math menu as follows:

1. Press the **SHIFT** and **NULL (MATH)** keys.
2. Use the ◀ and ▶ keys to display **OFF** and press **ENTER**.

Remote operation**NOTE**

Commands that use the <n> parameter can use the MINimum and MAXimum name parameters. MIN selects the minimum value and MAX selects the maximum value.

Use the following commands to configure and control limit testing:

CALCulate:FUNCTION LIMit	Select the limits feature
CALCulate:LIMit:LOWer <n>	Set the lower limit
CALCulate:LIMit:UPPer <n>	Set the upper limit
<n> = (see Note)	Set value (1 μ resolution)

NOTE

The limit value setting range depends on the selected function. For example, for DCV, the limit value can be set from -1200 to 1200.

CALCulate:STATe 	Enable or disable the null feature
 = 0 or OFF	Disable the null feature
= 1 or ON	Enable the null feature

MX+B

This math function multiplies a scale factor (M) to the measured reading (X), and then adds an offset (B). The result of the calculation (Y) is displayed on the instrument:

$$Y = MX + B$$

This math function is used to perform slope calculations on a series of measured readings.

You can enable this math function and set the values of the "M" and "B" from the front panel or by using remote operation. These values are stored in volatile memory and are lost when the instrument is turned off.

Front-panel operation

Perform the following steps to use the MX+B function:

1. Press the **SHIFT** and **NULL (MATH)** keys.
2. Use the ◀ and ▶ keys to display **MX+B** and press **ENTER**.
3. Set the "M" and "B" values:
 - a. Use the ◀ and ▶ keys to display **SET M** and press **ENTER**.
 Note that if you select the RUN menu option instead, MX+B will enable using the present "M" and "B" values.
 - b. Use the ◀, ▶, ▲, and ▼ keys to set the "M" value. Note that the polarity sign can be toggled between plus and minus. Press the **ENTER** key.
 - c. Use the ◀ and ▶ keys to display **SET B** and press **ENTER**.
 - d. Use the ◀, ▶, ▲, and ▼ keys to set the "B" value and press **ENTER**.
4. With **RUN** displayed, press **ENTER**. The MATH indicator turns on.

You can disable the math operation by pressing a different function key. You can also disable it from the math menu as follows:

1. Press the **SHIFT** and **NULL (MATH)** keys.
2. Use the ◀ and ▶ keys to display **OFF** and press **ENTER**.

Remote operation

NOTE	
Commands that use the <n> parameter can use the MIN imum and MAX imum name parameters. MIN selects the minimum value and MAX selects the maximum value.	

Use the following commands to configure the MX+B math function:

<code>CALCulate:FUNCTION MXB</code>	Select the MX+B math function
<code>CALCulate:MXB:MMFactor <n></code>	Set the "M" value
<code>CALCulate:MXB:MBFactor</code>	Set the "B" value
<n> = (see Note)	Set value (1 μ resolution)

NOTE	
The MX+B value setting range depends on the selected function. For example, for DCV, the value can be set from -1200 to 1200.	

<code>CALCulate:STATe </code>	Enable or disable the null feature
 = 0 or OFF	Disable the null feature
= 1 or ON	Enable the null feature

dBm

The dBm math function is defined as decibels above or below a 1 mW reference. With a user-programmable reference impedance, the instrument reads 0 dBm when the voltage needed to dissipate 1 mW through the reference impedance is applied. The relationship between dBm, a reference impedance, and the voltage is defined by the following equation:

$$10 \log \left[\frac{\left(\frac{V_{IN}^2}{R_{REF}} \right)}{1mW} \right]$$

Where: V_{IN} is the input signal voltage
 Z_{REF} is the reference impedance

The reference resistance (Z_{REF}) can be set from 50 Ω to 8000 Ω and can be set from the front panel or by using remote programming. Changing the reference resistance does not affect a stored null (relative) value.

The reference resistance value is stored in volatile memory. The reference resistance defaults to 600 Ω when power to the instrument is cycled.

This feature is available for DCV and ACV only.

Front-panel operation

Perform the following steps to use the dBm function:

1. Select the **DCV** or **ACV** function.
2. Press the **SHIFT** and **NULL (MATH)** keys.
3. Use the **◀** and **▶** keys to display **dBm** and press **ENTER**.
4. Use the **◀** and **▶** keys to display **REF RES** and press **ENTER**.
Note that if you select the **RUN** menu option instead, the percent function will enable using the current target value.
5. Use the **◀**, **▶**, **▲**, and **▼** keys to enter the reference resistance and press **ENTER**.
6. With **RUN** displayed, press **ENTER**. The MATH indicator turns on.

You can disable the math operation by pressing a different function key. You can also disable it from the math menu as follows:

1. Press the **SHIFT** and **NULL (MATH)** keys.
2. Use the **◀** and **▶** keys to display **OFF** and press **ENTER**.

Remote operation**NOTE**

Commands that use the <n> parameter can use the **MIN**imum and **MAX**imum name parameters. **MIN** selects the minimum value and **MAX** selects the maximum value.

Use the following commands to configure and control the dBm math function:

<code>CALCulate:FUNCTION DBM</code>	Select the dBm math function
<code>CALCulate:DBM:REFerence <n></code>	Set reference resistance value
<n> = 50 to 8000	Set reference (in ohms)
<code>CALCulate:STATe </code>	Enable or disable math operations
 = 0 or OFF	Disable math
= 1 or ON	Enable math

dB

The instrument expresses dB in terms of the dBm function as follows:

$$\text{dB} = (\text{input signal in dBm}) - (\text{relative value in dBm})$$

The dB relative value can be set from -200 to 200 dBm and can be set from the front panel or by using remote programming.

The dB relative value is stored in volatile memory and defaults to 0 dBm when power to the instrument is cycled.

This feature is available for DCV and ACV only.

NOTE

Since dB is calculated in terms of the dBm function, the dBm REF RES value has an effect on the dB result.

Front-panel operation

Perform the following steps to use the dBm function:

1. Select the **DCV** or **ACV** function.
2. Press the **SHIFT** and **NULL (MATH)** keys.
3. Use the ◀ and ▶ keys to display **dB** and press **ENTER**.
4. Use the ◀ and ▶ keys to display **dB REL** and press **ENTER**.
Note that if you select the **RUN** menu option instead, the dB function will enable using the present relative value.
5. Use the ◀, ▶, ▲, and ▼ keys to enter the reference resistance and press **ENTER**. The **MATH** indicator turns on.

You can disable the math operation by pressing a different function key. You can also disable it from the math menu as follows:

1. Press the **SHIFT** and **NULL (MATH)** keys.
2. Use the ◀ and ▶ keys to display **OFF** and press **ENTER**.

Remote operation**NOTE**

Commands that use the <n> parameter can use the **MIN**imum and **MAX**imum name parameters. **MIN** selects the minimum value and **MAX** selects the maximum value.

Use the following commands to configure and control the dB math function:

<code>CALCulate:FUNCTION DB</code>	Select the dB math function
<code>CALCulate:DB:REFERENCE <n></code>	Set the relative value
<n> = 0 to 200.00	Set value (in dBm)
<code>CALCulate:STATE </code>	Enable or disable math operations
 = 0 or OFF	Disable math
= 1 or ON	Enable math

Theory of operation

In this section:

AC voltage measurements and crest factor	4-1
DMM resistance measurement methods.....	4-3
Reference junctions	4-4
Accuracy calculations.....	4-5

AC voltage measurements and crest factor


The root-mean-square (RMS) value of any periodic voltage or current is equal to the value of the DC voltage or current which delivers the same power to a resistance as the periodic waveform does.

Crest factor is the ratio of the peak value to the RMS value of a particular waveform. This is represented by the following equations:

$$CF = \frac{V_P}{V_{RMS}} \quad \text{or} \quad CF = \frac{I_P}{I_{RMS}}$$

The crest factor of various waveforms is different, because the peak-to-RMS ratios are variable. For example, the crest factor for a pulse waveform is related to the duty cycle; as the duty cycle decreases, the crest factor increases. The RMS calculations and crest factor (CF) for various waveforms are shown in the following figures.

Figure 30: RMS calculations and crest factor

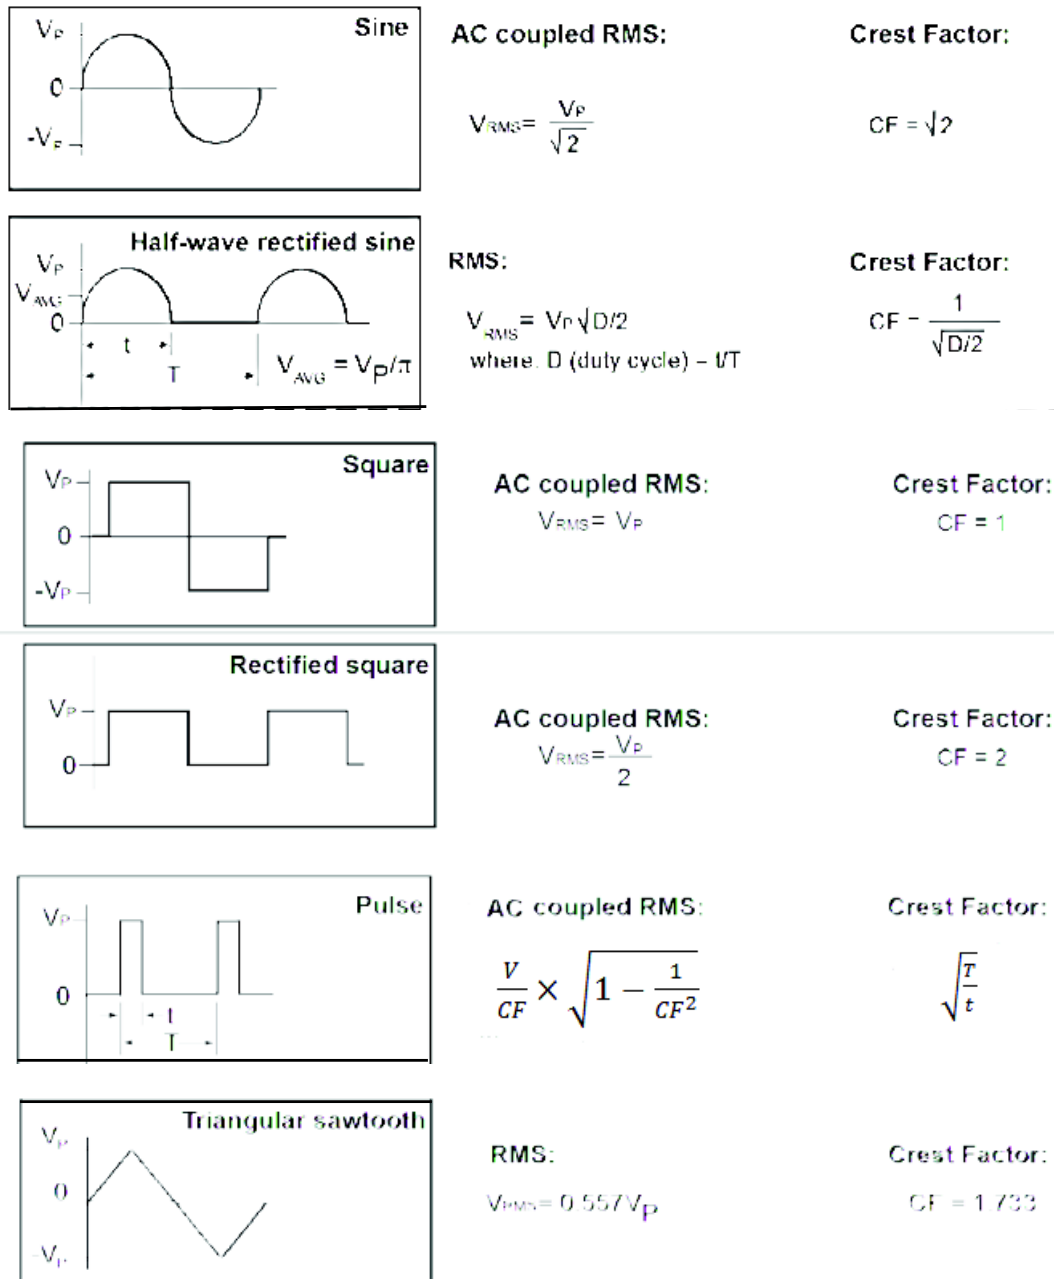

The Model 2110 is an AC-coupled RMS instrument. For an AC waveform with DC content, the DC component is removed before the RMS is calculated.

Crest factor is a relative measurement of the harmonic content of a particular waveform and reflects the accuracy of the measurement. For a rectangular pulse train, the higher the crest factor, the higher the harmonic content of the waveform. This is not always true when making spectral comparisons between different types of waveforms. A sine wave, for example, has a crest factor of 1.414, and a square wave has a crest factor of 1. The sine wave has a single spectral component and the square wave has components at all odd harmonics of the fundamental.

Additional error uncertainties are also specified for non-sinusoidal waveforms of specific crest factors and frequencies.

DMM resistance measurement methods


The Model 2110 uses the constant-current method to measure resistance. The constant-current method sources a constant current (I_{SOUR}) to the device under test (DUT) and measures the voltage (V_{MEAS}). Resistance (R_{DUT}) is then calculated and displayed using the known current and measured voltage ($R_{DUT} = V_{MEAS}/I_{SOUR}$).

The constant-current method is shown below. The test current sourced to the DUT depends on the selected measurement range. For example, for the 100 Ω range, the test current is 1 mA. Because the voltmeter of the Model 2110 has very high input impedance, virtually all the test current (1 mA) flows through the DUT. For $DUT \leq 1 \text{ k}\Omega$, 4-wire ohms measurements should be used as shown. Because the voltage is measured at the DUT, voltage drop in the test leads is eliminated (this voltage could be significant when measuring low-ohm DUT).


Resistance measurement range	Test current
100 ohm	1 mA
1 Kohm	1 mA
10 Kohm	100 μA
100 Kohm	10 μA
1 Mohm	1 μA
10 Mohm	0.1 μA
100 Mohm	0.1 μA

The 2-wire constant-current method is shown below.

Figure 31: Two-wire constant-current source method

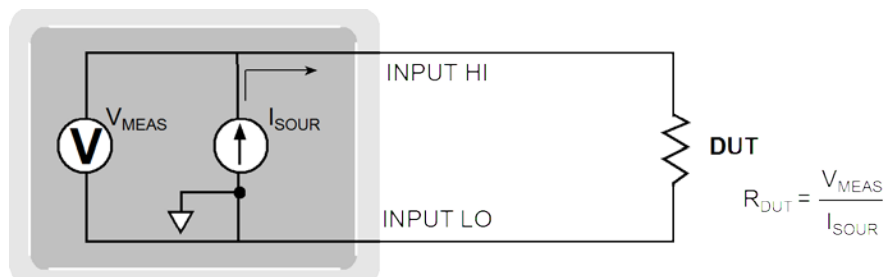

The 4-wire constant-current method is shown below.

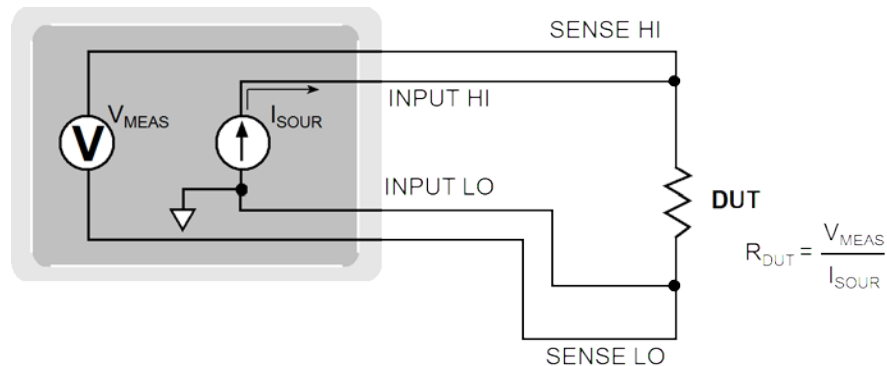Figure 32: Four-wire constant-current source method

Reference junctions

A reference junction is the cold junction in a thermocouple circuit that is held at a stable, known temperature. The cold junction is where dissimilar wire connections must be made. As long as the temperature of the cold junction is known, the Model 2110 can factor in the reference temperature to calculate the actual temperature reading at the thermocouple.

The standard reference temperature is the ice point (0° C). The ice point can be precisely controlled, and the National Institute of Standards and Technology (NIST) uses it as the fundamental reference for its voltage-to-temperature conversion tables. However, other known temperatures can be used.

There are two ways for the Model 2110 to acquire the cold junction temperature:

- The instrument can measure the cold junction using internal transducers.
- The user can enter the known temperature value.

These two references are known as:

- Real (internal) reference junction
- Simulated reference junction

These reference junctions are explained in the following paragraphs.

Real (internal) reference junction

Real implies that temperature transducers are used to measure the cold junction. This value is influenced and changed by different climate conditions and environments. The Model 2110 measures the temperature of the cold junction, measures the input voltage, and then calculates the temperature reading at the thermocouple.

Simulated reference junction

An example of a simulated reference junction is an ice bath. The copper wire to thermocouple wire connections are immersed (but electrically isolated) in the ice bath, known to be 0 °C. The temperature measured becomes an offset to the simulated reference temperature. The simulated reference temperature for the Model 2110 can be set from -100 °C to 100 °C. The Model 2110 measures the input voltage and factors in the simulated reference temperature to calculate the temperature reading at the thermocouple.

Accuracy calculations

The following information discusses how to calculate accuracy for both DC and AC characteristics.

Calculating DC and AC characteristics accuracy

DC characteristics accuracy is calculated as follows:

$$\text{Accuracy} = \quad \% \text{ of reading} + \% \text{ of range}$$

As an example of how to calculate the actual reading limits, assume that you are measuring 5V on the 10V range. You can compute the reading limit range from one-year DCV accuracy specifications as follows:

$$\begin{aligned} \text{Accuracy} &= 0.012\% \text{ of reading} + 0.004\% \text{ of range} \\ &0.012\% * 5 \text{ V} + 0.004\% * 10 \text{ V} \\ &0.0006 \text{ V} + 0.0004 \text{ V} \\ &0.0010 \text{ V} \end{aligned}$$

Thus, the actual reading range is $5 \text{ V} \pm 1 \text{ mV}$ or from 4.999 V to 5.001 V.

DC current, AC voltage, AC current, and resistance calculations are performed in exactly the same manner using the pertinent specifications, ranges, and input signal values.

Remote commands

In this section:

Programming syntax	5-1
Common commands	5-4
Introduction to SCPI language	5-10
SCPI signal oriented measurement commands	5-14
SCPI command subsystem reference.....	5-19
CALCulate subsystem.....	5-28
DISPlay subsystem	5-34
INPut subsystem	5-35
SENSe subsystem	5-37
SYSTem subsystem.....	5-66
TRIGger subsystem	5-67

Programming syntax

The information in this section describes syntax for both common commands and Standard Commands for Programmable Instruments (SCPI). For information that is not described here, see the IEEE-488.2 and SCPI standards.

Command format used in this manual

The format used to show commands in this manual is described in the following topics.

Command syntax

The command syntax shows most commands (and some parameters) as a mixture of upper and lowercase letters. The uppercase letters indicate the abbreviated spelling for the command. For shorter program lines, send the abbreviated form. For better program readability, send the long form.

For example, in the following syntax statement:

```
VOLTage[:DC]:RANGe {<range>|MINimum|MAXimum}
```

VOLT and VOLTAGE are both acceptable forms. You can use upper or lowercase letters. Therefore, VOLTAGE, volt, and Volt are all acceptable. Other forms, such as VOL and VOLTAG, will generate an error.

Long-form and short-form versions

A SCPI command word can be sent in its long-form or short-form version. For example, this manual lists commands in the [SCPI command subsystem reference](#) (on page 5-19) topic using the long-form version. However, the short-form version is indicated by upper case characters.

Examples:

```
:SYSTem:REMOte    long-form
:SYST:REM         short-form
:SYSTem:REM       long-form and short-form combination
```

Each command word must be in long-form or short-form, and not something in between. For example, :SYSTe:REMO will generate an error. The command will not be executed.

Short-form rules

Use the following rules to determine the short-form version of any SCPI command:

- If the length of the command word is four letters or less, no short form version exists. For example, :AUTO = AUTO
- The following rules apply to command words that exceed four letters:
 - If the fourth letter of the command word is a vowel, delete it and all the letters after it. For example :immediate = :imm
 - Rule exception: The short form version of the following command uses only the first two letters of the word :TCouple = :tc
 - If the fourth letter of the command word is a consonant, retain it but drop all the letters after it. For example, :format = :form
 - If the command contains a question mark (; query) or a non-optional number included in the command word, you must include it in the short-form version. Example: :delay? = :del?
- Command words or characters that are enclosed in brackets ([]) are optional and need not be included in the program message

Angle brackets

Angle brackets (< >) are used to denote a parameter type. Do not include the brackets in the program message. For example:

```
:HOLD:STATe <b>
```

The indicates that a Boolean-type parameter is required. Thus, to enable the Hold feature, you must send the command with the ON or 1 parameter as follows:

```
:HOLD:STATe ON or 1
```

Brackets []:

Some command words are enclosed in brackets ([]). These brackets are used to denote an optional command word that does not need to be included in the program message. For example:

```
:INITiate[:IMMEDIATE]
```

These brackets indicate that :IMMEDIATE is implied (optional) and does not have to be used. Thus, the above command can be sent in one of two ways:

```
:INITiate or :INTiate:IMMEDIATE
```

Notice that the optional command is used without the brackets. When using optional command words in your program, do not include the brackets.

Braces

Braces ({ }) enclose the parameter choices for a given command string. The braces are not sent with the command string.

Vertical bar

A vertical bar (|) separates multiple parameter choices for a given command string.

Using the MIN and MAX parameters

You can substitute **MIN**imum or **MAX**imum in place of a parameter for many commands. For example, consider the following command:

```
VOLTage[:DC]:RANGe MINimum
```

Instead of specifying a specific voltage range, you can substitute **MIN** to set the range to its minimum value or **MAX** to set the range to its maximum value.

IEEE-488.2 common commands

The IEEE-488.2 standard defines a set of common commands that perform functions like reset, self-test, and status operations. Common commands always begin with an asterisk (*), are four to five characters in length, and may include one or more parameters. The command keyword is separated from the first parameter by a blank space.

Use a semicolon (;) to separate multiple commands, as shown below:

```
*RST; *CLS; *ESE 32; *OPC?
```

Refer to [Common commands](#) (on page 5-4) for more information about common commands.

Querying parameter settings

You can query the current value of most parameters by adding a question mark (?) to the command. The following command sets the sample count to 10 readings:

```
SAMP:COUN 10
```

Then you can query the sample count by executing:

```
SAMP:COUN?
```

You can also query the minimum or maximum count allowed using the following commands:

```
SAMP:COUN? MIN  
SAMP:COUN? MAX
```

NOTE

If you send two query commands without reading the response from the first, and then attempt to read the second response, you may receive some data from the first response followed by the complete second response. To avoid this, do not send a query command without reading the response. When you cannot avoid this situation, send a device clear before sending the second query command.

SCPI command terminators

A command string sent to the instrument must terminate with a <new line> character. The IEEE-488.2 EOI (end-or-identify) message is interpreted as a <new line> character and can be used to terminate a command string in place of a <new line> character. A <carriage return> followed by a <new line> is also accepted. Command string termination will always reset the current SCPI command path to the root level.

Common commands

Common commands (summarized in [Common command summary](#) (on page 5-5)) are device commands that are common to all devices on the bus. These commands are designated and defined by the IEEE-488.2 standard. Most of these commands are described in detail in this section.

Common command summary

The following table lists the IEEE-488.2 common commands used by the instrument.

Mnemonic	Name	Description
*CLS	Clear status	Clear the Status Byte Summary Register and all event registers.
*ESE <NRf>	Event enable command	Enable bits in the Standard Event Enable Register. The selected bits are then reported to the Status Byte.
*ESE?	Event enable query	Query the Standard Event Enable Register. The instrument returns a decimal value that corresponds to the binary-weighted sum of all bits set in the register.
*ESR?	Event status register query	Query the Standard Event Status Register. The instrument returns a decimal value that corresponds to the binary-weighted sum of all bits set in the register.
*IDN?	Identification query	Returns the manufacturer, model number, serial number, and firmware revision levels of the instrument.
*OPC	Operation complete command	This command sets the OPC bit.
*OPC?	Operation complete query	Returns "1" to the output buffer after the command is executed.
*PSC 	Power-on status clear	Clear the Status Byte and Standard Event Register enable masks when power is turned on (*PSC 1). When *PSC 0 is in effect, the Status Byte and Standard Event Register enable masks are not cleared when power is turned on. [Stored in nonvolatile memory].
*PSC?	Power-on status clear query	Query the power-on status clear setting. Returns "0" (*PSC 0) or "1" (*PSC 1).
*RST	Reset command	Reset the instrument to the power-on configuration.
*SRE <NRf>	Service request enable command	Enable bits in the Status Byte Enable Register.
*SRE?	Service request enable query	Query the Status Byte Enable Register.
*STB?	Status byte query	Query the Status Byte Summary Register.
*TRG	Trigger command	Sends a bus trigger to the instrument.

Common command reference

This topic provides a detailed reference for all common commands.

*CLS — clear status

This command clears the Status Byte Summary Register and all event registers.

*ESE <NRf> — event enable command

This command enables bits in the Standard Event Enable Register. The selected bits are then reported to the Status Byte.

Usage

```
*ESE 1
*SRE 32
```

Details

Use the *ESE command and the appropriate decimal value for each bit to set the enable register mask. Refer to [Standard Event Register](#) (on page B-9) for information about values. For example, enable “operation complete” by using the *ESE 1 command.

*ESE? — event enable query

This query command queries the Standard Event Enable Register.

Usage

```
*ESE?
```

Details

The instrument returns a decimal value that corresponds to the binary-weighted sum of all bits set in the register. Refer to [Standard Event Register](#) (on page B-9) for information about values.

*ESR? — event status register query

This query command queries the value of the Standard Event Status Register. This query command clears the Standard Event Register.

Usage

```
*ESR?
```

Details

The instrument returns a decimal value that corresponds to the binary-weighted sum of all bits set in the register. Refer to [Standard Event Register](#) (on page B-9) for information about values.

*IDN? — identification query

This query command reads the instrument's identification code.

Usage

*IDN?

Details

The identification code includes the manufacturer, model number, serial number, and firmware revision level and is sent in a format consisting of four fields delimited by commas as follows:

manufacturer

model

serial number

firmware revision level

Format: x.xx-yy-zz

Where:

x.xx - indicates the firmware revision number
for the measurement processor

yy - indicates the I/O processor

zz - indicates the front-panel processor

For example,

KEITHLEY INSTRUMENTS INC.,MODEL 2110,1311126,01.00-01-01

*OPC — operation complete command

Set the Operation Complete bit (bit 0) in the Standard Event Register after all pending commands have been executed.

*OPC? — operation complete query

This query command places a "1" in the output queue.

Usage

*OPC?

Details

When *OPC is sent, the OPC bit in the Standard Event Register will set after all pending command operations are complete. When *OPC? is sent, an ASCII "1" is placed in the Output Queue after all pending command operations are complete.

Typically, either one of these commands is sent after the INITiate command. The INITiate command is used to take the instrument out of idle in order to perform measurements.

After all programmed operations are completed, the instrument returns to the idle state, at which time all pending commands (including *OPC and/or *OPC?) are executed. After the last pending command is executed, the OPC bit and/or an ASCII "1" is placed in the Output Queue.

*PSC — power-on status clear

This command enables or disables the power-on status clear function.

Usage

*PSC 0
*PSC 1

Details

When *PSC 1 is in effect, the Status Byte and Standard Event Register enable masks are cleared when power is turned on. *PSC 1 is the default.

When *PSC 0 is in effect, the Status Byte and Standard Event Register enable masks are not cleared when power is turned on.

The command is stored in nonvolatile memory.

*PSC? — power-on status clear query

This query command returns the power-on status clear setting.

Usage

*PSC?

Details

Query the power-on status clear setting. Returns "0" (*PSC 0) or "1" (*PSC 1).

*RST — reset command

This command resets the instrument to the power-on configuration.

Usage

*RST

Details

Reset the instrument to the power-on configuration. This command does not clear the error queue. Refer to [Power-on settings](#) (on page 1-6) for information about power-on configuration.

***SRE <NRf> — service request enable command**

This command sets or clears the individual bits of the Service Request Enable Register.

Usage

*SRE 1
*SRE 32

Details

The individual bits of the Service Request Enable Register can be set or cleared by using the *SRE common command. To read the Service Request Enable Register, use the *SRE? query command. The Service Request Enable Register clears when power is cycled or a parameter value of 0 is sent with the *SRE command (for example, *SRE 0).

Set the instrument for an SRQ interrupt by using *SRE 32.

***SRE? — service request enable command query**

This command queries the Status Byte Enable Register.

Usage

*SRE?

Details

The instrument returns a decimal value which corresponds to the binary-weighted sum of all bits set in the register.

***STB? — status byte query**

The *STB? command is similar to a serial poll, but it is processed like any other instrument command.

Usage

*STB?

Details

The *STB? command returns the same result as a serial poll, but the “request service” bit (bit 6) is not cleared if a serial poll has occurred.

***TRG — trigger command**

Use the *TRG command to issue a trigger to the instrument. It has the same effect as a group execute trigger (GET).

Usage

*TRG

Details

Use the *TRG command as an event to control operation. The instrument reacts to this trigger if BUS is the programmed arm control source. The control source is programmed from the TRIGger subsystem.

Introduction to SCPI language

Topic overview

This section contains reference information on programming the Model 2110 with the SCPI commands. It is organized as follows:

SCPI parameter types

The SCPI language defines several different data formats to be used in program messages and response messages:

Numeric parameters <n>

Commands that require numeric parameters will accept all commonly used decimal representations of numbers, including optional signs, decimal points, and scientific notation.

Special values for numeric parameters like **MINimum**, **MAXimum**, and **DEFault** are also accepted. You can also send engineering unit suffixes with numeric parameters (for example, M, K, or u). If only specific numeric values are accepted, the instrument will automatically round the input numeric parameters. The following command uses a numeric parameter:

```
VOLTage[:DC]:RANGe <range> | MINimum | MAXimum
```

Discrete parameters <name>

Discrete parameters are used to program settings that have a limited number of values (for example, BUS, IMMEDIATE, EXTERNAL). They have a short form and a long form just like command keywords. You can mix upper- and lowercase letters. Query responses will always return the short form in all uppercase letters. The following command uses discrete parameters:

```
TRIGger:SOURce BUS | IMMEDIATE | EXTERNAL
```

Numeric representation format parameters <Nrf>

Numeric representation format parameters are numbers that can be expressed as an integer (e.g., 8), a real number (e.g., 23.6), or an exponent (2.3E6). The following command uses a numeric parameter:

```
CALCulate:PERCent:TARGET 100e6
```

Boolean parameters

Boolean parameters are used to enable or disable an instrument operation. 0 or OFF disables the operation, and 1 or ON enables the operation. For example, use the ON parameter to enable auto ranging. When you query a Boolean setting, the instrument will always return 0 or 1.

```
:CURRent:AC:RANGe:AUTO ON
```

String parameters <string>

String parameters can contain virtually any set of ASCII characters. A string must begin and end with matching quotes; either with a single quote or with a double quote. You can include the quote delimiter as part of the string by typing it twice without any characters in between. The following command uses a string parameter:

```
DISPlay:TEXT <a quoted string>
```

Commands and command parameters

Common commands and SCPI commands may or may not use a parameter. The following are some examples:

*SAV <NRf>	Parameter (NRf) required
*RST	No parameter used
:INITiate:CONTinuous 	Parameter required
:SYSTem:PRESet	No parameter used.

Put at least one space between the command word and the parameter. Refer to [SCPI parameter types](#) (on page 5-10) for information about SCPI parameters.

Query commands

This type of command requests (queries) the currently programmed status. It is identified by the question mark (?) at the end of the fundamental form of the command. Most commands have a query form, for example:

```
:SAMP:COUNT?           Queries the sample count.
```

Program messages

A program message is made up of one or more command words sent by the computer to the instrument. Each common command is simply a three letter acronym preceded by an asterisk (*). SCPI commands are categorized in the :STATus subsystem and are used to help explain how command words are structured to formulate program messages.

:STATus		Path (Root)
:QUEStionable	Path	
:ENABle <n>		Command and parameter
:ENABle?		Query command
:PRESet		Command

Single command messages

The above command structure has three levels. The first level is made up of the root command (:STATus) and serves as a path. The second level is made up of another path (:OPERation) and a command (:PRESet). The third path is made up of one command for the :OPERation path. The three commands in this structure can be executed by sending three separate program messages as follows:

```
:stat:ques:enab <n>
:stat:ques:enab?
:stat:pres
```

In each of the above program messages, the path pointer starts at the root command (:stat) and moves down the command levels until the command is executed.

Multiple command messages

You can send multiple command messages in the same program message as long as they are separated by semicolons (;). The following example shows two commands in one program message:

```
:stat:ques; :stat:ques:enab <n>
```

When the above message is sent, the first command word is recognized as the root command (:stat). When the next colon is detected, the path pointer moves down to the next command level and executes the command. When the path pointer sees the colon after the semicolon (;), it resets back to the root level and starts over.

Commands that are on the same command level can be executed without having to retype the entire command path. For example:

```
:stat:ques:enab <n>; enab?
```

After the first command (:enab) is executed, the path pointer is at the third command level in the structure. Since :enab? is also on the third level, it can be typed in without repeating the entire path name. Notice that the leading colon for :enab? is not included in the program message. If a colon were included, the path pointer would reset to the root level and expect a root command. Since :enab? is not a root command, an error would occur.

Command path rules

- Each new program message must begin with the root command, unless it is optional (for example, [:SENSE]). If the root is optional, simply treat a command word on the next level as the root.
- The colon (:) at the beginning of a program message is optional and need not be used. For example:

```
:stat:pres = stat:pres
```

- When the path pointer detects a colon (:) it moves down to the next command level. An exception is when the path pointer detects a semicolon (;), which is used to separate commands within the program message (see next rule).
- When the path pointer detects a colon (:) that immediately follows a semicolon (;), it resets back to the root level.
- The path pointer can only move down. It cannot be moved up a level. Executing a command at a higher level requires that you start over at the root command.

Using common commands and SCPI commands in the same message

Both common commands and SCPI commands can be used in the same message as long as they are separated by semicolons (;). A common command can be executed at any command level and will not affect the path pointer. For example:

```
:stat:ques:enab <n>; *ESE <n>
```

Program message terminator (PMT)

Each program message must be terminated with a LF (line feed), EOI (end or identify), or an LF+EOI. The bus will hang if your computer does not provide this termination. The following example shows how a multiple command program message must be terminated:

```
*rst;*cls <PMT>
```

Command execution rules

Command execution rules are as follows:

- Commands execute in the order that they are presented in the program message.
- An invalid command generates an error and is not executed.
- Valid commands that precede an invalid command in a multiple command program message are executed.
- Valid commands that follow an invalid command in a multiple command program message are ignored.

Output Data

Type

The instrument provides the following types of output data:

- Non-reading queries
- Single reading (IEEE-488.2)
- Multiple readings (IEEE-488.2)
- Single reading (USB)
- Multiple readings (USB)

Format

Output data will be in one of the following formats.

< 80 ASCII character string
 SD.DDDDDDDDESDD<nl>
 SD.DDDDDDDDESDD,.....<nl>
 SD.DDDDDDDDESDD<cr><nl>
 SD.DDDDDDDDESDD,.....<cr><nl>
 S Negative sign or positive sign
 D Numeric digits
 E Exponent
 <nl> newline character
 <cr> carriage return character

SCPI signal oriented measurement commands

The signal oriented measurement commands configure the instrument for measurement and acquire measurement readings. You can use these high-level instructions to control the measurement process. These commands are summarized in the following table.

Signal oriented measurement command summary

Command	Description
:CONFigure:<function> <range>, <resolution>	Configures instrument for measurements on the specified function.
:CONFigure?	Returns active function.
:FETCh?	Requests latest readings.
:INITiate	Changes the state of the triggering system to wait-for-trigger.
:READ?	Performs an :INITiate and a :FETCh?.
:MEASure:<function> <range>, <resolution>	Performs a :CONFigure: <function>, and a :READ?.

:CONFigure:<function> [<range>|MIN|MAX|DEF,<resolution>|MIN|MAX|DEF]

This command configures the instrument to a specific setup for a specified measurement function. This command does not initiate the measurement. The :READ? command is then typically used to trigger a specified number of measurements.

Parameters

NOTE

All <range> and <resolution> parameters also include MIN, MAX, and DEF. N/A indicates that the <range> and/or <resolution> parameters are not applicable for the <function>.

<function>	<range>	<resolution> (see note 1)	Description (see note 2)
CURRent[:DC]	-10 to 10	3.00e-07 to 3.00e-04	Amperes
CURRent:AC	0 to 10	1.00e-06 to 1.00e-04	Amperes
VOLTage[:DC]	-1000 to 1000	3.00e-07 to 3.00e-04	Voltage
VOLTage:AC	0 to 750	1.00e-06 to 1.00e-04	Voltage
CAPacitance	0 to 10e-3	N/A	Farads
VOLTage[:DC]:RATio	-1000 to 1000	3.00e-07 to 3.00e-04	Voltage
RESistance	0 to 100e6	3.00e-07 to 3.00e-04	Ohms
FRESistance	0 to 100e6	3.00e-07 to 3.00e-04	Ohms
FREQuency[:VOLTage]	0 to 750	N/A	Voltage
FREQuency:CURRent	0 to 10	N/A	Amperes
PERiod[:VOLTage]	0 to 750	N/A	Voltage
PERiod:CURRent	0 to 10	N/A	Amperes
CONTinuity	N/A	N/A	N/A
DIODE	N/A	N/A	N/A
TCouple	N/A	N/A	N/A
TEMPerature	N/A	N/A	N/A

NOTE

1. Do not use the number of digits to specify a resolution; instead, use the same units as the measurement function. For example, specify the resolution in volts and the frequency in hertz. The resolutions provided are of range. Refer to [Bandwidth and resolution for AC measurements](#) (on page 3-43) for more information about AC measurements. Refer to [Integration time and resolution for DC and resistance measurements](#) (on page 3-41) for information about DC measurements.

2. Information listed in the description column is for reference only. This column lists the measurement unit for the <function>. Do not include units in commands.

Query

Command	Description
CONFigure?	Query the selected function.

Details

The CONFigure command offers a little more flexibility than the MEASure? command. The multimeter sets the parameters for the requested function, range and resolution. You have an option to change the configuration. The CONFigure command does not initiate the measurement. To initiate the measurement, use INITiate or READ? command.

When this command is sent, the instrument will be configured as follows:

- The function specified by this command is selected.
- The range and resolution are selected as specified.
- All other controls related to the selected function are defaulted to the *RST values.

This command is automatically asserted when the :MEASure? command is sent.

Example

CONF:VOLT[:DC] 10,0.001	Configure 1 mV resolution digits on the 10 VDC range.
CONF:FREQ 1K Hz,0.1 Hz	Configure 1000 Hz input, 0.1 Hz resolution.

Also see

[:INITiate](#) (on page 5-17)

[:READ\[1|2\]?](#) (on page 5-17)

[:FETCh\[1|2\]?](#) (on page 5-16)

:FETCh[1|2]?

The FETCh? command transfers readings to the instrument's output buffer. The INITiate command is used to store readings in the instrument's internal memory.

Parameters

[1]	1 stands for the specified function which will act on the primary display.
[2]	2 stands for the 2ND specified function which will act on the secondary display.

Details

The FETCh? and INITiate commands provide the lowest level of control for measurement triggering and reading retrieval, but offer the most flexibility.

After you have configured the instrument, use INITiate command to change the state of the triggering system from the "idle" state to the "wait-for-trigger" state. The instrument will start the measurements when the specified trigger condition requirements are met after it receives the INITiate command. The results are sent to the internal memory and stored until you are ready to read them.

The FETCh? command sends the data in the instrument's internal memory to the output buffer where you can read it into your bus controller.

The FETCh? command does not affect the instrument setup.

The FETCh? command does not trigger measure operations; it simply requests the last available readings. Note that this command can repeatedly return the same readings. Until there are new readings, this command continues to return the old readings.

Example

INIT	Change state of triggering system to wait for trigger state.
FETCh?	Sends the data in the instrument's internal memory to the output buffer.

Also see

[:INITiate](#) (on page 5-17)

[:DATA:POINTS?](#) (on page 5-66)

:INITiate

Change the state of the triggering system from the “idle” state to “wait-for-trigger” state. The meter will start to make measurements when a required triggering condition is met after the INITiate command is received. Readings are stored in memory until you are ready to read them. Use FETCh? command to retrieve your measurements results.

:READ[1|2]?

The READ? command changes the state of the trigger system from the “idle” state to the “wait-for-trigger” state. When the specified trigger condition requirements are met after the instrument receives the READ? command, the measurement will be initiated. The results are sent to the output buffer right away. You must enter the reading data into your bus controller or the instrument will stop making measurements when the output buffer fills. Readings are not stored in the instrument’s internal memory when using the READ? command. Using the READ? command has a similar effect as using the INITiate command followed immediately by the FETCh? command, except readings are not buffered internally.

Parameters

[1]	1 stands for the specified function which will act on the primary display.
[2]	2 stands for the specified function which will act on the secondary display.

Example

```
:READ2?
```

Also see

:INITiate

[:FETCh\[1|2\]?](#) (on page 5-16)

:MEASure[:<function>]? <range>|MIN|MAX|DEF,<resolution>|MIN|MAX|DEF

This command configures the instrument to a specific setup for measurements on the specified function. The :READ? command is then typically used to trigger a specified number of measurements.

Parameters

NOTE

All <range> and <resolution> parameters also include MIN, MAX, and DEF. N/A indicates that the <range> and/or <resolution> parameters are not applicable for the <function>.

<function>	<range>	<resolution> (see note 1)	Description (see note 2)
CURRent[:DC]	-10 to 10	3.00e-07 to 3.00e-04	Amperes
CURRent:AC	0 to 10	1.00e-06 to 1.00e-04	Amperes
VOLTage[:DC]	-1000 to 1000	3.00e-07 to 3.00e-04	Voltage
VOLTage:AC	0 to 750	1.00e-06 to 1.00e-04	Voltage
CAPacitance	0 to 10e-3	N/A	Farads
VOLTage[:DC]:RATio	-1000 to 1000	3.00e-07 to 3.00e-04	Voltage
RESistance	0 to 100e6	3.00e-07 to 3.00e-04	Ohms
FRESistance	0 to 100e6	3.00e-07 to 3.00e-04	Ohms
FREQuency[:VOLTage]	0 to 750	N/A	Voltage
FREQuency:CURRent	0 to 10	N/A	Amperes
PERiod[:VOLTage]	0 to 750	N/A	Voltage
PERiod:CURRent	0 to 10	N/A	Amperes
CONTinuity	N/A	N/A	N/A
DIODE	N/A	N/A	N/A
TCouple	N/A	N/A	N/A
TEMPerature	N/A	N/A	N/A

NOTE

1. Do not use the number of digits to specify a resolution; instead, use the same units as the measurement function. For example, specify the resolution in volts and the frequency in hertz. The resolutions provided are of range. Refer to [Bandwidth and resolution for AC measurements](#) (on page 3-43) for more information about AC measurements. Refer to [Integration time and resolution for DC and resistance measurements](#) (on page 3-41) for information about DC measurements.

2. Information listed in the description column is for reference only. This column lists the measurement unit for the <function>. Do not include units in commands.

Details

This command combines all of the other signal oriented measurement commands to perform a single measurement and acquire the reading.

Although it does not offer much flexibility, using the MEASure? command is the simplest way to program the instrument for measurements. You specify the measurement function, range and resolution, the instrument automatically sets the other parameters for you, make the measurement and send the result to the output buffer.

Example

MEASure:VOLT[:DC]? 10,0.001	Measure 4 ½ digits on the 10 Vdc range.
MEAS:CURR:AC? 1,1E-5	Measure 5 ½ digits on the 1 A range.

Also see

[:INITiate](#) (on page 5-17)
[:READ\[1|2\]?](#) (on page 5-17)
[:FETCh\[1|2\]?](#) (on page 5-16)
[:CONFigure:<function> \[<range>|MIN|MAX|DEF.<resolution>|MIN|MAX|DEF\]](#) (on page 5-15)

SCPI command subsystem reference

The following SCPI subsystems are available on the Model 2110. The subsystem commands are summarized in the following tables.

- CALCulate subsystem (Refer to [CALCulate subsystem summary](#) (on page 5-20))
- DISPlay subsystem (Refer to [DISPlay subsystem summary](#) (on page 5-21))
- INPUt subsystem (Refer to [INPUt subsystem summary](#) (on page 5-21))
- SENSE subsystem (Refer to [SENSE subsystem summary](#) (on page 5-22))
- STATus subsystem summary (Refer to [STATus subsystem summary](#) (on page 5-26))
- SYSTem subsystem (Refer to [SYSTem subsystem summary](#) (on page 5-26))
- TRIGger subsystem (Refer to [TRIGger subsystem summary](#) (on page 5-27))

This section include commands that are device-specific to the Model 2110. Although not included in the 1999.0 version of the SCPI standard, these commands are compliant to the SCPI format and they follow the syntax rules of the standard. Device specific commands are indicated in the command description.

Many of the required SCPI commands are accepted by the instrument, but are not described in this manual for simplicity or clarity. Most of these non-documented commands duplicate the functionality of a command already described in this section.

CALCulate subsystem summary

Command	Description
:CALCulate	Path to configure math calculations.
:FUNction <name>	Specify math function: PERCent , AVERage, NULL, LIMit, MXB, DB, or DBM. PERCent is the default math function.
:FUNction?	Query the present math function. Returns PERC, AVER, NULL, LIM, MXB, DB or DBM.
:STATe 	Enable or disable calculation for the specified math function. Where: 0 = off and 1 = on. Default is ON.
:STATe?	Query state of math function. Returns 0 (off) or 1 (on).
:PERCent	Path to configure percent calculations. PERCent is the default math function.
:TARGet <n> MIN MAX	Specify target value, MIN, or MAX for PERCent calculation.
:TARGet? [MIN MAX]	Query the target value for percent math function.
:AVERage	Path to query reading values.
:MINimum?	Query the minimum value found during the Min/Max operation.
:MAXimum?	Query the maximum value found during the Min/Max operation.
:AVERage?	Query the average value of all readings taken since the Min/Max operation has been enabled.
:COUNT?	Query the number of readings taken since Min/Max has been enabled.
:NULL	Path to configure the Null register.
:OFFset <n> MIN MAX	Store a null value, MIN or MAX in the instrument's Null Register.
:OFFset? [MIN MAX]	Query the null value.
:LIMit	Path to configure limit testing.
:LOWer <n> MIN MAX	Specify the lower limit for limit testing. You can set the value to any number from 0 to $\pm 120\%$ of the highest range, for the present function.
:LOWer? [MIN MAX]	Query the lower limit for the limit testing.
:UPPer <n> MIN MAX	Specify the upper limit for limit testing. You can set the value to any number from 0 to $\pm 120\%$ of the highest range, for the present function.
:UPPer? [MIN MAX]	Query the upper limit for the limit testing.
:MXB	Path to configure MXB.
:MMFactor <n> MIN MAX	Specify "m" factor for mx+b (-100e-6 to 100e-6) or MINimum MAXimum.
:MMFactor? [MIN MAX]	Query the value of m.
:MBFactor <n> MIN MAX	Specify "b" factor for mx+b (-100e-6 to 100e-6) or MINimum MAXimum.
:MBFactor? [MIN MAX]	Query the value of b.
:DB	Path to configure dB Relative Register.
:REFerence <n> MIN MAX	Store a relative value in the dB Relative Register (any number between 0 dBm and ± 200 dBm) or MINimum MAXimum.
:REFerence? [MIN MAX]	Query the dB relative value.
:DBM	Path to configure the dBm reference value.
:REFerence <n> MIN MAX	Specify the dBm reference value. Choose from: 50 ~ 8000 Ω or MINimum MAXimum.
:REFerence? [MIN MAX]	Query the dBm reference value.
:DATA:FEED RDG_STORE, ['CALC' ' ']	Specifies whether readings taken using the INITiate command are stored in the multimeter's internal memory (default) or not stored at all.
:DATA:FEED?	Query the reading memory state. Return "CALC" or "".

DISPlay subsystem summary

Command	Description
:DISPlay 	Turn on or off front panel display. Where: 0 = off and 1 = on.
:DISPlay:TEXT <a>	Define ASCII message "a" (up to 16 characters in length). The message will display on the secondary display.
:DISPlay:TEXT:CLEAr	Clear the message shown on the front panel display.
:DISPlay?	Query the display setting. Returns 0 (off) or 1 (on).

INPUt subsystem summary

Command	Description
IMPedance	
:AUTO 	Specify auto impedance. Where: 0 = off and 1 = on.
:AUTO?	Query impedance state. Returns 0 (off) or 1 (on).

SENSE subsystem summary

See the following table for the SENSE command summary. Refer to [Power-on settings](#) (on page 1-6) for information about default values for SENSE commands.

Command	Description
[:SENSE]	Path to sense commands.
:FUNCTION[1 2]	Path to FUNCTION, FUNCTION1, and FUNCTION2. FUNCTION1 displays the selected function on the primary display. FUNCTION2 displays the selected function on the secondary display.
<a>	Specify one of the following functions to measure (enclosed function in quotation marks): "VOLTage:AC" "VOLTage[:DC]" "VOLTage[:DC]:RATio" "CURRent:AC" "CURRent[:DC]" "FREQuency[:VOLT]" "FREQuency:CURR" "FREStance" "PERiod[:VOLT]" "PERiod:CURR" "RESistance" "DIODE" "TCouple" "TEMPerature" "CONTInuity" Note: DIODE and CONTInuity are not SCPI compliant parameters.
:FUNCTION?	Query function. Returns function name.
:VOLTage[:DC]	Path to configure DC voltage.
:RANGe <n> MIN MAX	Specify the range: 100 mV, 1 V, 10 V, 100 V, 1000 V, MIN, or MAX.
? [MIN MAX]	Query the range.
:AUTO 	Enable or disable auto range. Where: 0 = OFF and 1 = ON.
:AUTO?	Query auto range.
:RESolution <n> MIN MAX	Specify resolution: <n> = 3.00e-07 to 3.00e-04 of range, MIN, or MAX. Refer to Integration time and resolution for DC and resistance measurements (on page 3-41) for more information about valid values for n.
:RESolution? [MIN MAX]	Query the resolution.
:NPLCycles <n> MIN MAX	Specify the integration time in number of power line cycles for the selected function: 0.001, 0.006, 0.02, 0.06, 1, 2, 10, MIN, or MAX. Refer to Integration time and resolution for DC and resistance measurements (on page 3-41) for more information about valid values for n.
:NPLCycles?[MIN MAX]	Query NPLCycles.
:VOLTage:AC	Path to configure AC voltage.
:RANGe <n> MIN MAX	Specify range: 100 mV, 1 V, 10 V, 100 V, MIN, or MAX.
? [MIN MAX]	Query the range.
:AUTO 	Enable or disable auto range. Where: 0 = OFF and 1 = ON.

Command	Description
:AUTO?	Query auto range.
:RESolution <n> MIN MAX	Specify resolution. Where <n> = 1.00e-06 to 1.00e-04 of range, MIN, or MAX. Refer to Bandwidth and resolution for AC measurements (on page 3-43) for more information about valid values for n.
:RESolution?	Query the resolution.
:CURRENT:AC	Path to configure AC current.
:RANGe <n> MIN MAX	Specify range:0 to 10, MIN, or MAX.
? [MIN MAX]	Query the range for AC voltage.
:AUTO 	Enable or disable auto range. Where: 0 = OFF and 1 = ON.
:AUTO?	Query auto range.
:RESolution <n> MIN MAX	Specify resolution. Where <n> = 1.00e-06 to 1.00e-04 of range, MIN, or MAX. Refer to Bandwidth and resolution for AC measurements (on page 3-43) for more information about valid values for n.
:RESolution? [MIN MAX]	Query the resolution.
:CURRENT[:DC]	Path to configure DC current.
:RANGe <n> MIN MAX	Specify range: 10 mA, 100 mA, 1 A, 3 A, 10 A, MIN, or MAX.
? [MIN MAX]	Query the range for DC voltage.
:AUTO 	Enable or disable auto range. Where: 0 = off and 1 = on.
:AUTO?	Query auto range.
:RESolution <n> MIN MAX	Specify resolution: <n> = 3.00e-07 to 3.00e-04 of range, MIN, or MAX. Refer to Integration time and resolution for DC and resistance measurements (on page 3-41) for more information about valid values for n.
:RESolution ?	Query the resolution.
:NPLCycles <n> MIN MAX	Specify the integration time in number of power line cycles for the selected function: 0.001, 0.006, 0.02, 0.06, 1, 2, 10, MIN, or MAX. Refer to Integration time and resolution for DC and resistance measurements (on page 3-41) for more information about valid values for n.
:NPLCycles? [MIN MAX]	Query NPLCycles.
:RESistance	Path to configure resistance (2-wire Ω).
:RANGe <n> MIN MAX	Specify range: 0 to 100e6, MIN, or MAX.
? [MIN MAX]	Query resistance range.
:AUTO 	Enable or disable auto range. Where: 0 = OFF and 1 = ON.
:AUTO?	Query auto range.
:RESolution <n> MIN MAX	Specify resolution: <n> = 3.00e-07 to 3.00e-04 of range, MIN, or MAX. Refer to Integration time and resolution for DC and resistance measurements (on page 3-41) for more information about valid values for n.
:RESolution? [MIN MAX]	Query the resistance resolution.
:NPLCycles <n> MIN MAX	Specify the integration time in number of power line cycles for the selected function: 0.001, 0.006, 0.02, 0.06, 1, 2, 10, MIN, or MAX. Refer to Integration time and resolution for DC and resistance measurements (on page 3-41) for more information about valid values for n.
:NPLCycles?	Query NPLCycles.
:FRESistance	Path to configure fresistance (4-wire Ω).
:RANGe <n> MIN MAX	Specify range: 0 to 100e6, MIN, or MAX.
? [MIN MAX]	Query the fresistance range.
:AUTO 	Enable or disable auto range. Where, 0 = OFF and 1 = ON.
:AUTO?	Query auto range.

Command	Description
:RESolution <n> MIN MAX	Specify resolution: <n> = 3.00e-07 to 3.00e-04 of range, MIN, or MAX. Refer to Integration time and resolution for DC and resistance measurements (on page 3-41) for more information about valid values for n.
:RESolution? [MIN MAX]	Query the resistance resolution.
:NPLCycles <n> MIN MAX	Specify the integration time in number of power line cycles for the selected function: 0.02, 0.1, 1, 2, 10, 100, MIN, or MAX.
:NPLCycles? [MIN MAX]	Query NPLCycles.
:FREquency	Path to configure frequency.
[:VOLTage]	Path to configure voltage. Voltage is the default.
:RANGe <n> MIN MAX	Specify range: 0 to 750, MIN, or MAX.
? [MIN MAX]	Query range.
:AUTO 	Enable or disable auto range. Where: 0 = OFF and 1 = ON.
:AUTO?	Query auto range setting.
:CURRent	Path to configure current.
:RANGe <n> MIN MAX	Specify range.
? [MIN MAX]	Query range.
:APERture <n> MIN MAX	Specify the aperture time for the selected function: 0.01, 0.1, 1, MIN, or MAX.
:APERture? [MIN MAX]	Query the aperture time for frequency function.
:PERiod	Path to configure period.
[:VOLTage]	Path to period voltage.
:RANGe <n> MIN MAX	Specify range: 0 to 750, MIN, or MAX.
? [MIN MAX]	Query the period range setting.
:AUTO 	Enable or disable auto range. Where: 0 = OFF and 1 = ON.
:AUTO?	Query auto range setting.
:CURRent	Path to configure current.
:RANGe <n> MIN MAX	Specify range.
? [MIN MAX]	Query the range.
:APERture <n> MIN MAX	Specify the aperture time for the selected function: 0.01, 0.1, 1, MIN, or MAX. Default = 100 ms.
:APERture? [MIN MAX]	Query the aperture time for period function.
:UNIT <name>	Specify units for temperature measurement (Cel means Celsius, Far means Fahrenheit, and K means Kelvin).
:UNIT?	Query units for temperature measurement.
:TCouple	Path to configure thermocouple.
:TYPE <name>	Specify thermocouple sensor type (E, J, K, N, R, S, or T).
?	Query thermocouple sensor type.
:RJUNction	Path to thermocouple reference junction.
:RSElect <name>	Specify reference junction type, real or simulated. (REAL or SIMulated).
:RSElect?	Query the reference junction type.
:SIMulated <n> MIN MAX	Specify the default temperature of the simulated reference junction.
:SIMulated? [MIN MAX]	Query the default temperature of the simulated reference junction.
:REAL <n> MIN MAX	Path to offset voltage of the real reference junction. Specify the offset voltage of the real reference junction (value), MIN, or MAX.
:REAL? [MIN MAX]	Query the offset voltage of the real reference junction.
:TEMPerature	Path to temperature measurements.

Command	Description
:RTD	Path to resistance temperature detector (RTD).
:TYPE <name>	Specify temperature type: PT100, D100, F100, P385, PT3916, USER, SPRTD, or NTCT.
:TYPE?	Query the RTD temperature type.
:RZERo <n> MIN MAX	Specify the R-Zero constant for the user defined RTD type (value).
:RZERo?	Query the R-Zero constant for the user defined RTD type.
:ALPHa <n> MIN MAX	Specify the alpha constant for the user type (value).
:ALPHa?	Query the alpha constant for the user type.
:BETA <n> MIN MAX	Specify the beta constant for the user type.
:BETA?	Query the beta constant for the user type.
:DELTA <n> MIN MAX	Set the delta constant for the user type (value).
:DELTA?	Query the delta constant for the user type.
:SPRTD	Path to the sensor R value at 0 degree Celsius.
:RZERo <n> MIN MAX	Specify the sensor R value at 0 degree Celsius (value).
:RZERo?	Query the sensor R value at 0 degree Celsius.
:A4 <n> MIN MAX	Specify the A4 coefficient (value).
:A4? [MIN MAX]	Query the A4 coefficient.
:B4 <n> MIN MAX	Specify the B4 coefficient (value).
:B4? [MIN MAX]	Query the B4 coefficient.
:AX <n> MIN MAX	Specify the AX coefficient (value).
:AX? [MIN MAX]	Query the AX coefficient.
:BX <n> MIN MAX	Specify the BX coefficient (value).
:BX? [MIN MAX]	Query the BX coefficient.
:CX <n> MIN MAX	Specify the CX coefficient (value).
:CX? [MIN MAX]	Query the CX coefficient.
:DX <n> MIN MAX	Specify the DX coefficient (value).
:DX? [MIN MAX]	Query the DX coefficient.
:TRANsducer <name>	Configure transducer. Where: FRTD = 4-wire as the RTD measurement and RTD = 2-wire as the RTD measurement.
:DETEctor	Path to configure detector.
:BANDwidth <n> MIN MAX	Specify bandwidth range (3, 20, 200).
:BANDwidth? [MIN MAX]	Query bandwidth range.
:ZERO	Path to configure auto zero.
:AUTO <name>	Specify auto zero configuration: OFF, ONCE, or ON.
:AUTO?	Query auto zero. Returns 0 (off) or 1 (on). ONCE returns 0 (off).
:AVERage	Path to configure average.
:TCONtrol <name>	Specify MOVing or REPeat.
:TCONtrol?	Query average type.
:COUNt <n> MIN MAX	Specify count (value).
:COUNt? [MIN MAX]	Query count.
:STATe 	Specify ON or OFF.
:STATe?	Query state. Returns 0 (off) or 1 (on).

STATus subsystem summary

See the following table for the STATus command summary. Refer to the following topics for additional information on status commands.

- [Common commands](#) (on page 5-4)
- [Status model](#) (on page B-1)

Command	Description
STATus:	
:QUESTionable	Path to configure the Questionable Data Enable Register.
:ENABle <Nrf>	Enable bits in the Questionable Data Enable Register. The selected bits are then reported to the Status Byte. A 0 value clears the Questionable Data Enable Register.
:ENABle?	Query the Questionable Data Enable Register. The instrument returns a binary-weighted decimal representing the bits set in the Questionable Data Enable Register.
:EVENT?	Query the Questionable Data Event Register. The instrument returns a decimal value which corresponds to the binary-weighted sum of all bits set in the register. Clear the Questionable Data Event Register.
:PRESet	Clear all bits in the Questionable Data Enable Register.

SYSTEM subsystem summary

Command	Description
:SYSTem	Path to system commands.
:BEEPer	Issue a single beeping tone.
:STATe 	Turn the beeper on or off. Where: 0 = off and 1 = on.
:STATe?	Query state of beeper. Returns 0 (off) 1 (on).
:ERRor?	Query the instrument's error queue. Up to 20 errors can be stored in the queue. Errors are retrieved in first-in-first-out (FIFO) order. Each error string may contain up to 80 characters.
:LOCal	Place the instrument in the local mode. All keys on the front panel are fully functional.
:REMote	Place the instrument in the remote mode. All keys on the front panel, except the LOCAL key, are disabled.
:VERSion?	Query the present SCPI version.
:DATA:POINTs?	Query the number of readings stored in the instrument's internal memory.

TRIGger subsystem summary

Command	Description
TRIGger	
:SOURce <name>	Specify a trigger source. The instrument will accept a software (BUS) trigger, an immediate internal trigger (IMMediate), or a hardware trigger from the rear-panel (EXT TRIG) terminal.
:SOURce?	Query the trigger source.
:COUNT <n> MIN MAX DEF INF	Specify the number of triggers the instrument will accept before returning to the "idle" state. (1 to 50,000, MIN, MAX, or INF). The INFinite parameter instructs the instrument to take triggers continuously.
:COUNT?	Query measure count. Returns the number of triggers the instrument will accept before returning to the "idle" state.
:DElay <n> MIN MAX DEF	Set delay time (0 to 3600 sec., MIN or MAX).
:DElay? [MIN MAX DEF]	Query the trigger delay time
:AUTO 	Enable or disable auto delay. Where: 0 = off and 1 = on.
:AUTO?	Query state of delay. Returns 0 (off) or 1 (on).
:SAMPle	Path to trigger sample.
:COUNT <n> MIN MAX DEF	Set the number of readings (samples) the instrument takes per trigger (1 to 50,000, MIN or MAX)
:COUNT? [MIN MAX DEF]	Query the sample count.

CALCulate subsystem

The commands in this subsystem configure and control the Calculate subsystems and are summarized in [CALCulate subsystem summary](#) (on page 5-20).

There are ten math operations. Only one of them can be enabled at a time. They either store data for later use or perform mathematical operations on the readings. Note that the math operations are available to all measurement functions except continuity and diode testing.

CALCulate:AVERage:AVERage?

This command reads the average value of all readings taken since the Min/Max operation was enabled. The instrument clears the value when Min/Max is turned on, when the power is turned off, or a remote interface reset occurs.

CALCulate:AVERage:COUNT?

This command reads the average value of all readings taken since the Min/Max operation was enabled. The instrument clears the value when Min/Max is turned on, when the power is turned off, or a remote interface reset occurs.

CALCulate:AVERage:MINimum?

This command reads the minimum value found during the Min/Max operation. The instrument clears the value when Min/Max is turned on, when the power is turned off, or a remote interface reset occurs.

CALCulate:AVERage:MAXimum?

This command reads the maximum value found during the Min/Max operation. The instrument clears the value when Min/Max is turned on, when the power is turned off, or a remote interface reset occurs.

CALCulate:DB:REFerence <n>|MIN|MAX

This command is used to store a relative value in the dB Relative Register. You must turn on the math operation before writing to the math register.

Parameters

parameters	description
<n>	Set the dB value to any value between 0 to ± 200.00 .
MINimum	Set value to the minimum.
MAXimum	Set value to the maximum.

Query

command	description
CALCulate:DB:REFerence?	Query the dB relative value.
CALCulate:DB:REFerence? MIN	Query the minimum value.
CALCulate:DB:REFerence? MAX	Query the maximum value.

CALCulate:DBM:REFerence <n>|MIN|MAX

This command is used to set the dBm reference resistance value in ohms.

Parameters

parameter	description
<n>	You can set the relative value to any number between 50 ~ 8000 Ω .
MINimum	Set value to the minimum.
MAXimum	Set value to the maximum.

Query

command	description
CALCulate:DBM:REFerence?	Query the dBm reference value.
CALCulate:DBM:REFerence? MIN	Query the minimum value.
CALCulate:DBM:REFerence? MAX	Query the maximum value.

CALCulate:FUNction <name>

This command is used to configure the math function for the calculate commands. You can only select one function at a time.

Parameters

<name>	Description
PERCent	Select percent math calculation. The default function is percent.
AVERage	Select average math calculation.
NULL	Select the null feature.
LIMit	Select the limits feature to configure and control limits testing.
MXB	Select MX+B polynomial math calculation.
DB	Select the MX+B calculations.
DBM	Select the dBm reference resistance value.

Query

command	description
FUNCTION?	Query the measurement function.

CALCulate:LIMit:LOWer <n>|MIN|MAX

This command is used to specify the lower limit for limit testing. The actual limit depends on which measurement function is currently selected.

For example, a limit value of 1 is 1V for the volts functions (DCV or ACV), 1A for the current functions (DCI or ACI), 1 Ω on the ohms functions (2 or 4), and 1 (C, F, or K) for the temperature function. A limit value is not range sensitive. A limit of 1 for DCV is 1V on all measurement ranges.

Parameter

<n>	description
0 to \pm 120% of the highest range	Set the lower limit for limit testing. You can set the value to any number from 0 to \pm 120% of the highest range, for the present function.
MINimum	Set specified limit to 0.
MAXimum	Set specified limit to \pm 120% of the highest range.

Query

command	description
CALCulate:LIMit:LOWer?	Query the lower limit for the limit testing.
CALCulate:LIMit? MIN	Query the minimum value.
CALCulate:LIMit? MAX	Query the maximum value.

CALCulate:LIMit:UPPer <n>|MIN|MAX

This command is used to specify the upper limit for limit testing. The actual limit depends on which measurement function is currently selected.

For example, a limit value of 1 is 1V for the volts functions (DCV or ACV), 1A for the current functions (DCI or ACI), 1 Ω on the ohms functions (2-wire or 4-wire), and 1 (C, F, or K) for the temperature function. A limit value is not range sensitive. A limit of 1 for DCV is 1V on all measurement ranges.

Parameters

<n>	description
0 to \pm 120% of the highest range	Set the upper limit for limit testing. You can set the value to any number from 0 to \pm 120% of the highest range, for the present function.
MINimum	Set value to the minimum.
MAXimum	Set value to the maximum.

Query

command	description
CALCulate:LIMit:UPPer?	Query the upper limit for the limit testing.
CALCulate:LIMit:UPPer? MIN	Query the minimum upper limit.
CALCulate:LIMit:UPPer? MAX	Query the maximum upper limit.

CALCulate:MXB:MBFactor <n>|MIN|MAX

This command is used to define the "b" factor for the mx+b calculation.

Parameters

<n>	description
	Set a value for b. The value is measurement function dependent.
MINimum	Set value to the minimum.
MAXimum	Set value to the maximum.

Query

command	description
CALCulate:MXB:MBFactor?	Query the value of b.
CALCulate:MXB:MBFactor? MIN	Query the minimum value of b.
CALCulate:MXB:MBFactor? MAX	Query the maximum value of b.

CALCulate:MXB:MMFactor <n>|MIN|MAX

This command is used to define the "m" factor for the MX+B calculation.

Parameters

<n>	description
	Set a value for m. The value is measurement function dependent.
MINimum	Set value to the minimum.
MAXimum	Set value to the maximum.

Query

command	description
CALCulate:MXB:MMFactor?	Query the value of m.
CALCulate:MXB:MMFactor? MIN	Query the minimum value of m.
CALCulate:MXB:MMFactor? MAX	Query the maximum value of m.

CALCulate:NULL:OFFSet <n>|MIN|MAX

This command stores a null value in the instrument's Null Register. You must turn on the math operation before writing to the math register.

Parameters

<n>	description
0 to \pm 120% of the highest range	Select the null (relative) value. You can set the null value to any number between 0 and \pm 120% of the highest range.
MINimum	Set value to the minimum.
MAXimum	Set value to the maximum.

Query

command	description
CALCulate:NULL:OFFSet?	Query the null value.
CALCulate:NULL:TARGet? MIN	Query the null minimum value for null math function.
CALCulate:NULL:TARGet? MAX	Query the null maximum value for null math function.

CALCulate:PERCent:TARGet <n>|MIN|MAX

This command specifies the target value for percent math function. The instrument clears the value when Min/Max is turned on, when the power is turned off, or a remote interface reset occurs.

Parameters

<n>	description
	Specify the measurement function dependent target value.

MINimum	Set to minimum value..
MAXimum	Set to maximum value.

Query

command	description
CALCulate:PERCent:TARGet?	Query the target value for percent math function.
CALCulate:PERCent:TARGet? MIN	Query the target minimum value for percent math function.
CALCulate:PERCent:TARGet? MAX	Query the target maximum value for percent math function.

**CALCulate:STATe **

Turn the selected math function on or off.

Parameters

	description
0 or OFF	Turn selected math function on.
1 or ON	Turn selected math function off.

Query

command	description
CALCulate:STATe?	Query the state of the selected math function. Returns 0 (off) or 1 (on).

DATA:FEED RDG_STORE,'CALCulate'|"

This command selects whether readings taken using the INITiate command are stored in the multimeter's internal memory (default) or not stored at all. In the default state (DATA:FEED RDG_STORE,'CALC'), up to 2000 readings are stored in memory when INITiate is executed. The MEASure? And CONFigure commands automatically select 'CALC'. With memory disabled (DATA:FEED RDG_STORE,""), readings taken using INITiate are not stored. This may be useful with the Min/Max operation since it allows you to determine an average of the readings without storing the individual values. An error will be generated if you attempt to transfer readings to the output buffer using the FETCh? command.

parameter	description
'CALC'	Stores up to 2000 readings in memory when INITiate is executed.
' '	Readings taken using INITiate are not stored.

Query

command	description
DATA:FEED?	Query the reading memory state. Returns "CALC" or "".

DISPlay subsystem

The display subsystem controls the display of the instrument and is summarized in [DISPlay subsystem summary](#) (on page 5-21).

DISPlay

This command stops measurements from showing on the display.

Parameters

	description
0 or OFF	Turn measurement display off.
1 or ON	Turn measurement display on.

Query

command	description
DISPlay?	Query state of measurement display. Returns 0 (off) or 1 (on).

Details

This command is used to enable and disable the front panel display circuitry. In the OFF mode an OFF indicator is shown on the display. Refer to [Turning off measurement display](#) (on page 2-20) for information about how this command controls the display.

Section

Example

DISPlay ON	Turns on the display.
------------	-----------------------

DISPlay:TEXT <a>

This command displays text on the secondary display (second line of the front panel display).

Parameters

<a>	description
A maximum of any 16 ASCII characters.	String parameters can contain virtually any set of ASCII characters. A string must begin and end with matching quotes; either with a single quote or with a double quote. You can include the quote delimiter as part of the string by typing it twice without any characters in between.

Query

command	description
DISPlay:TEXT?	Query the message sent to the front panel display.

Details

The message can be up to 16 characters; any additional characters will be truncated.

Example

DISPlay:TEXT "Hello World 1234"	Displays the string you type in.
---------------------------------	----------------------------------

DISPlay:TEXT:CLEAr

This command clears text messages from the secondary display.

Parameters

command	description
DISPlay:Text:CLEAr	Clears the message.

Example

DISPlay:TEXT:CLEAr	Clears the message.
--------------------	---------------------

INPut subsystem

The command in the INPut subsystem is used to configure and control the measurement units for TEMP, ACV, and DCV.

INPut:IMPedance:AUTO

This command turns the automatic input resistance mode on or off for DC voltage measurements. With AUTO ON, the input resistance is set to >10 GΩ for the 100mV, 1V and 10V ranges. With AUTO OFF, the input resistance is fixed at 10 M ohm for all ranges.

Parameters

	description
0 or OFF	Turn automatic input resistance mode off.
1 or ON	Turn automatic input resistance mode on.

Query

command	description
INPut:IMPedance:AUTO?	Query the input resistance mode. Returns 0 (off) or 1 (on).

Details

This command is device-specific to the Model 2110.

SENSe subsystem

The sense subsystem controls measurement configuration and is summarized in [SENSe subsystem summary](#) (on page 5-22).

[SENSe:]AVERAge:COUNT <n>|MIN|MAX

Use this command to set the number of readings the digital filter stores before calculating the average of the stored readings. The digital filter averages the readings to yield a single reading.

Parameters

<n>	description
2 to 100	Select the number of readings the digital filter stores before calculating the average.
MINimum	Select the minimum value.
MAXimum	Select the maximum value.

Query

command	description
[SENSe:]AVERAge:COUNT?	Query the number of readings to average.
[SENSe:]AVERAge:COUNT? MIN	Query the minimum number of readings to average.
[SENSe:]AVERAge:COUNT? MAX	Query the maximum number of readings to average.

Details

Refer to [Digital filter](#) (on page 3-45) for more information about using this command.

[SENSe:]AVERAge:STATE

Use this command to turn the digital filter on or off.

Parameters

	description
0 or OFF	Turn the digital filter off.
1 or ON	Turn the digital filter on.

Query

command	description
[SENSe:]AVERAge:STATE?	Query the state of the digital filter. Returns 0 (off) or 1 (on).

Details

Refer to [Digital filter](#) (on page 3-45) for more information about using this command.

[SENSe:]AVERAge:TCONtrol <name>

Use this command to select the digital filter type.

Parameters

<name>	description
MOVing	Select the moving average filter.
REPeat	Select the moving average filter.

Query

command	description
[SENSe:]AVERAge:TCONtrol?	Query the type of digital filter. Returns 0 (off) or 1 (on).

Details

Refer to [Digital filter](#) (on page 3-45) for more information about using this command.

[SENSe:]CAPacitance:RANGe <n>|MIN|MAX

Use this command to select the capacitance range.

Parameters

<n>	description
0 to 10e-3	Specify the value of the expected capacitance reading.
MINimum	Select the minimum value.
MAXimum	Select the maximum value.

Query

command	description
[SENSe:]CAPacitance:RANGe	Query the capacitance range.
[SENSe:]CAPacitance:RANGe? MIN	Query the minimum capacitance range.
[SENSe:]CAPacitance:RANGe? MAX	Query the maximum capacitance range.

Details

The measurement ranges for capacitance measurements are 1 nF, 10 nF, 100 nF, 1 μ F, 10 μ F, 100 μ F, 1 mF, and 10 mF.

Resolution is ignored for capacitance. Refer to [Capacitance measurements](#) (on page 3-24) for more information about this command.

**[SENSe:]CAPacitance:RANGe:AUTO **

This command turns capacitance autorange on or off.

Parameters

	description
0 or OFF	Turn autorange off.
1 or ON	Turn autorange on.

Query

command	description
[SENSe:]CAPacitance:RANGe:AUTO?	Query autorange state.

[SENSe:]CURRent:AC:RANGe <range>|MIN|MAX

Use this command to select the function (ACI) and set a measurement range.

Parameters

<n>	description
0 to 10	Select the measurement range in amps.
MINimum	Select the minimum value.
MAXimum	Select the maximum value.

Query

command	description
[SENSe:]CURRent:AC:RANGe?	Query the measurement range.
[SENSe:]CURRent:AC:RANGe? MIN	Query the minimum range.
[SENSe:]CURRent:AC:RANGe? MAX	Query the maximum range.

[SENSe:]CURRent:AC:RESolution <n>|MIN|MAX

Use this command to select resolution for AC current measurements (ACI).

Parameters

<n>	description
(1.00e-06 to 1.00e-04) * ACI range	Select the resolution of the measurement.
MINimum	Select the minimum value.
MAXimum	Select the maximum value.

Query

command	description
[SENSe:]CURRent:AC:RESolution?	Query the measurement resolution.
[SENSe:]CURRent:AC:RESolution? MIN	Query the minimum resolution.
[SENSe:]CURRent:AC:RESolution? MAX	Query the maximum resolution.

Details

Refer to [Bandwidth and resolution for AC measurements](#) (on page 3-43) for more information about resolution.

[SENSe:]CURRent[:DC]:NPLCycles <n>|MIN|MAX

Use this command to select the integration time for DC current measurements. Integration time for DCI measurements is expressed as the number of power line cycles (NPLC).

Parameters

<n>	description
0.001	Select 0.001 NPLC.
0.006	Select 0.006 NPLC.
0.02	Select 0.02 NPLC.
0.06	Select 0.06 NPLC.
0.2	Select 0.2 NPLC.
0.6	Select 0.6 NPLC.
1	Select 1 NPLC.
2	Select 2 NPLC.
10	Select 10 NPLC.
100	Select 100 NPLC.
MINimum	Select the minimum value.
MAXimum	Select the maximum value.

Query

command	description
[SENSe:]CURRent[:DC]:NPLCycles?	Query the NPLCycles.
[SENSe:]CURRent[:DC]:NPLCycles? MIN	Query the minimum value.
[SENSe:]CURRent[:DC]:NPLCycles? MAX	Query the maximum value.

Details

Refer to [Integration time and resolution for DC and resistance measurements](#) (on page 3-41) for more information about NPLC.

[SENSe:]CURRent[:DC]:RANGe <n>|MIN|MAX

Use this command to select the function (DCI) and set a measure range.

Parameters

<n>	description
-10 to 10	Select the measurement range in amps.
MINimum	Select the minimum value.
MAXimum	Select the maximum value.

Query

command	description
[SENSe:]CURRent[:DC]:RANGe?	Query the measurement range.
[SENSe:]CURRent[:DC]:RANGe? MIN	Query the minimum range.
[SENSe:]CURRent[:DC]:RANGe? MAX	Query the maximum range.

[SENSe:]CURRent[:DC]:RESolution <n>|MIN|MAX

Use this command to select integration time for DC current measurements (DCI).

NOTE

When you set the integration time, the instrument automatically updates the reading resolution.

Parameters

<n>	description
(3.00e-07 to 3.00e-04) * DCI range	Select the resolution of the measurement.
MINimum	Select the minimum value.
MAXimum	Select the maximum value.

Query

command	description
[SENSe:]CURRent[:DC]:RESolution?	Query the resolution setting.
[SENSe:]CURRent[:DC]:RESolution? MIN	Query the minimum resolution setting.
[SENSe:]CURRent[:DC]:RESolution? MAX	Query the maximum resolution setting.

Details

Refer to [Integration time and resolution for DC and resistance measurements](#) (on page 3-41) more information about resolution.

[SENSe:]CURRent:AC:RANGe:AUTO

This command turns AC current autorange on or off.

Parameters

	description
0 or OFF	Turn autorange off.
1 or ON	Turn autorange on.

Query

command	description
CURRent:AC:RANGe:AUTO?	Query autorange state.

[SENSe:]CURRent[:DC]:RANGe:AUTO

This command turns DC current autorange on or off.

Parameters

	description
0 or OFF	Turn autorange off.
1 or ON	Turn autorange on.

Query

command	description
CURRent [:DC] :RANGe :AUTO?	Query autorange state.

[SENSe:]DETEctor:BANDwidth <n>|MIN|MAX

Use this command to specify the lowest frequency expected in the input signal. The instrument selects the slow, medium or fast AC filter based on the frequency you specify.

Parameters

<n>	description
3	Slow AC filter. 3 Hz. 3 - any value. < 3 will error. A floor calculation is performed.
20	Medium AC filter. 20 Hz.
200	Fast AC filter. 200 Hz. This is the default value.
MINimum	Select the minimum value.
MAXimum	Select the maximum value.

Query

command	description
[SENSe:]DETEctor:BANDwidth?	Query the bandwidth.
[SENSe:]DETEctor:BANDwidth? MIN	Query the minimum bandwidth.
[SENSe:]DETEctor:BANDwidth? MAX	Query the maximum bandwidth.

Details

Refer to [Bandwidth and resolution for AC measurements](#) (on page 3-43) more information about bandwidth.

[SENSe:]FRESistance:NPLCycles <n>|MIN|MAX

Use this command to select the integration time for 4-wire measurements. Integration time for 4-wire measurements is expressed as the number of power line cycles (NPLC).

Parameters

<n>	description
0.001	Select 0.001 NPLC.
0.006	Select 0.006 NPLC.
0.02	Select 0.02 NPLC.
0.06	Select 0.06 NPLC.
0.2	Select 0.2 NPLC.
0.6	Select 0.6 NPLC.
1	Select 1 NPLC.
2	Select 2 NPLC.
10	Select 10 NPLC.
100	Select 100 NPLC.
MINimum	Select the minimum value.
MAXimum	Select the maximum value.

Query

command	description
[SENSe:]FRESistance:NPLCycles?	Query the NPLCycles.
[SENSe:]FRESistance:NPLCycles? MIN	Query the minimum value.
[SENSe:]FRESistance:NPLCycles? MAX	Query the maximum value.

Details

Refer to [Integration time and resolution for DC and resistance measurements](#) (on page 3-41) more information about NPLC.

[SENSe:]FRESistance:RANGe <n>|MIN|MAX

Use this command to set a measure range for 4-wire (Ω) measurements.

Parameters

<n>	description
0 to 100e6	Select the measurement range in ohms.
MINimum	Select the minimum value.
MAXimum	Select the maximum value.

Query

command	description
[SENSe:]FRESistance:RANGe	Query the measurement range.
[SENSe:]FRESistance:RANGe? MIN	Query the minimum range.
[SENSe:]FRESistance:RANGe? MAX	Query the maximum range.

[SENSe:]FRESistance:RANGe:AUTO

This command turns autorange on or off for Ω4.

Parameters

	description
0 or OFF	Turn autorange off.
1 or ON	Turn autorange on.

Query

command	description
[SENSe:]FRESistance:RANGe:AUTO?	Query Ω4 autorange state.

[SENSe:]FRESistance:RESolution <n>|MIN|MAX

Use this command to set a measured resolution for 4-wire (Ω4) measurements.

NOTE

When you set the integration time, the instrument automatically updates the reading resolution.

Parameters

<n>	description
(3.00e-07 to 3.00e-04) * Ω4 range	Select the resolution of the measurement.
MINimum	Select the minimum value.
MAXimum	Select the maximum value.

Query

command	description
[SENSe:]FRESistance:RESolution?	Query the resolution setting.
[SENSe:]FRESistance:RESolution? MIN	Query the minimum resolution setting.
[SENSe:]FRESistance:RESolution? MAX	Query the maximum resolution setting.

Details

Refer to [Integration time and resolution for DC and resistance measurements](#) (on page 3-41) more information about resolution.

[SENSe:]FREQUency:APERture <n>|MIN|MAX

Use this command to select the aperture time for frequency function. For frequency and period measurements, aperture time is analogous to integration time.

Parameters

<n>	description
0.01 second	4½-digit resolution.
0.1 second	5½-digit resolution.
1 second	5½-digit resolution. This is the default value. 0.01 to 1 ceiling math.
MINimum	Select the minimum value.
MAXimum	Select the maximum value.

Query

command	description
[SENSe:]FREQUency:APERture?	Query the aperture time.
[SENSe:]FREQUency:APERture? MIN	Query the minimum aperture time.
[SENSe:]FREQUency:APERture? MAX	Query the maximum aperture time.

Details

Refer to [Aperture and resolution for frequency and period measurements](#) (on page 3-44) for more information about aperture time.

[SENSe:]FREQUency:CURRent:RANGe <n>|MIN|MAX

Use this command to select the current range for the frequency function.

Parameters

<n>	description
0 to 750	Set the expected level of the signal.
MINimum	Select the minimum value.
MAXimum	Select the maximum value.

Query

command	description
[SENSe:]FREQUency:CURRent:RANGe?	Query the measurement range.
[SENSe:]FREQUency:CURRent:RANGe? MIN	Query the minimum range.
[SENSe:]FREQUency:CURRent:RANGe? MAX	Query the maximum range.

[SENSe:]FREQUency[:VOLTage]:RANGe <n>|MIN|MAX

Use this command to select the function (frequency), and set a measure range.

Parameters

<n>	description
0 to 750	Set AC voltage range for frequency function. The expected AC voltage level of the signal.
MINimum	Select the minimum value.
MAXimum	Select the maximum value.

Query

command	description
[SENSe:]FREQUency[:VOLTage]:RANGe?	Query the measurement range.
[SENSe:]FREQUency[:VOLTage]:RANGe? MIN	Query the minimum range.
[SENSe:]FREQUency[:VOLTage]:RANGe? MAX	Query the maximum range.

[SENSe:]FREQUency[:VOLTage]:RANGe:AUTO

This command turns autorange on or off.

Parameters

	description
0 or OFF	Turn autorange off.
1 or ON	Turn autorange on.

Query

command	description
[SENSe:]FREQUency[:VOLTage]:RANGe:AUTO?	Query autorange state.

[SENSe:]FUNcTion [1|2] "<function>"

This command selects the measurement function listed in the function parameter. You can also use this command to turn off the secondary display.

Parameters

<function>	description
"CURRent[:DC]"	Select amps function DC.
"CURRent:AC"	Select amps function AC.
"VOLTage[:DC]"	Select volts function DC.
"VOLTage:AC"	Select volts function AC.
"VOLTage[:DC]:RATio"	Select DC ratio measurements. This parameter is only valid only when used with FUNC1.
"CAPacitance"	Select capacitance measurements.
"RESistance"	Select 2- wire ohms function.
"FRESistance"	Select 4- wire ohms function.
"FREQuency[:VOLTage]"	Select voltage frequency measurement.
"FREQuency:CURRent"	Select current frequency measurement.
"PERiod[:VOLTage]"	Select voltage period measurement.
"PERiod:CURRent"	Select current period measurement.
"CONTinuity"	Select continuity measurement.
"DIODE"	Select diode measurement.
"TCouple"	Select thermocouple temperature measurement.
"TEMPerature"	Select temperature measurement.
"NONE"	Select to turn off secondary display. This parameter is only valid only when used with FUNC2.

Query

command	description
FUNCTION?	Query the measurement function and return a quoted string.

Details

Refer to [Secondary measurement function](#) (on page 3-26) for information about the instrument's dual measurement capability.

Specify a measurement function and enclose it in quotes in the command string.

Optionally, include one of the following parameter to indicate primary or secondary display:

- 1 for primary display. For example FUNCTION1.
- 2 for secondary display.

If you do not specify a display, the display parameter defaults to a 1 for the primary display.

Include "NONE" to turn off secondary display. This is only valid only when used with FUNCTION2.

Example

FUNCTION "VOLTage:AC"	Specifies Voltage AC as the measurement function and primary display as the display.
FUNCTION2 "CAPacitance"	Specifies capacitance as the measurement function and the second display as the display.
FUNCTION2 "NONE"	Turn off secondary display.

[SENSe:]PERiod:APERture <n>|MIN|MAX

Use this command to set the aperture time for period function. For frequency and period measurements, aperture time is analogous to integration time.

Parameters

<n>	description
0.01	4½-digit resolution.
0.1	5½-digit resolution.
1	5½-digit resolution. This is the default value.

Query

command	description
[SENSe:]PERiod:APERture?	Query the aperture time.
[SENSe:]PERiod:APERture? MIN	Query the minimum aperture time.
[SENSe:]PERiod:APERture? MAX	Query the maximum aperture time.

Details

Refer to [Aperture and resolution for frequency and period measurements](#) (on page 3-44) for more information about aperture time.

[SENSe:]PERiod:VOLTage:RANGe <n>|MIN|MAX

Use this command to select the function (period), and set a measure range.

Parameters

<n>	description
0 to 750.	Set AC voltage range value for period function.
MINimum	Select the minimum value.
MAXimum	Select the maximum value.

Query

command	description
[SENSe:]PERiod:VOLTage:RANGe?	Query the measurement range.
[SENSe:]PERiod:VOLTage:RANGe? MIN	Query the minimum range.
[SENSe:]PERiod:VOLTage:RANGe? MAX	Query the maximum range.

[SENSe:]PERiod:VOLTage:RANGe:AUTO

This command turns autorange on or off for the period voltage function.

Parameters

	description
0 or OFF	Turn autorange off.
1 or ON	Turn autorange on.

Query

command	description
[SENSe:]PERiod:VOLTage:RANGe:AUTO?	Query autorange state.

[SENSe:]RESistance:RANGe <n>|MIN|MAX

Use this command to select the function (Ω) and set a measure range.

Parameters

<n>	description
0 to 100e6	Select the measurement range value in ohms.
MINimum	Select the minimum value.
MAXimum	Select the maximum value.

Query

command	description
[SENSe:]RESistance:RANGe?	Query the measurement range.
[SENSe:]RESistance:RANGe? MIN	Query the minimum range.
[SENSe:]RESistance:RANGe? MAX	Query the maximum range.

[SENSe:]RESistance:RANGe:AUTO

This command turns autorange on or off for resistance.

Parameters

	description
0 or OFF	Turn autorange off.
1 or ON	Turn autorange on.

Query

command	description
[SENSe:]RESistance:RANGe:AUTO?	Query autorange state.

[SENSe:]RESistance:RESolution <n>|MIN|MAX

Use this command to set a measurement resolution for 2-wire (Ω) measurements.

NOTE

When you set the integration time, the instrument automatically updates the reading resolution.

Parameters

<n>	description
(3.00e-07 to 3.00e-04) * Ω 2 range	Select the resolution of the measurement.
MINimum	Select the minimum value.
MAXimum	Select the maximum value.

Query

command	description
[SENSe:]RESistance:RESolution?	Query the resolution setting.
[SENSe:]RESistance:RESolution? MIN	Query the minimum resolution setting.
[SENSe:]RESistance:RESolution? MAX	Query the maximum resolution setting.

Details

Refer to [Aperture and resolution for frequency and period measurements](#) (on page 3-44) more information about resolution.

[SENSe:]RESistance:NPLCycles <n>|MIN|MAX

Use this command to select the integration time for 2-wire measurements. Integration time for 2-wire measurements is expressed as the number of power line cycles (NPLC).

Parameters

<n>	description
0.001	Select 0.001 NPLC.
0.006	Select 0.006 NPLC.
0.02	Select 0.02 NPLC.
0.06	Select 0.06 NPLC.
0.2	Select 0.2 NPLC.
0.6	Select 0.6 NPLC.
1	Select 1 NPLC.
2	Select 2 NPLC.
10	Select 10 NPLC.
100	Select 100 NPLC.
MINimum	Select the minimum value.
MAXimum	Select the maximum value.

Query

command	description
[SENSe:]RESistance:NPLCycles?	Query the NPLCycles.
[SENSe:]RESistance:NPLCycles? MIN	Query the minimum value.
[SENSe:]RESistance:NPLCycles? MAX	Query the maximum value.

Details

Refer to [Integration time and resolution for DC and resistance measurements](#) (on page 3-41) more information about resolution.

[SENSe:]TCouple:RJUNction:REAL <n>|MIN|MAX

Use this command to select the offset voltage of the real reference junction.

Parameters

<n>	description
-100 to 100	Select the offset voltage value of the real reference junction.
MINimum	Select the minimum value.
MAXimum	Select the maximum value.

Query

command	description
[SENSe:]TCouple:RJUNction:REAL?	Query the offset voltage of the real reference junction.

Details

Refer to the [Temperature measurement](#) (on page 3-17) section for more information about offset value.

[SENSe:]TCouple:RJUNction:RSElect <name>

Use this command to select a reference junction type, real or simulated.

Parameters

<name>	description
REAL	Select a real reference junction type.
SIMulated	Select a simulated reference junction type.

Query

command	description
[SENSe:]TCouple:RJUNction:RSElect?	Query the reference junction type, real or simulated.

Details

Refer to [Thermocouple measurements](#) (on page 3-22) for more information about sensor type.

[SENSe:]TCouple:RJUNction:SIMulated <n>|MIN|MAX

Use this command to select the default temperature of the simulated reference junction.

Parameters

<n>	description
-100 to 100	Select the default temperature value in degrees Celsius.
MINimum	Select the minimum value.
MAXimum	Select the maximum value.

Query

command	description
[SENSe:]TCouple:RJUNction:SIMulated?	Query the default temperature of the simulated reference junction.

Details

Refer to the following topic in the [Temperature measurement](#) (on page 3-17) section for more information about sensor type. [Thermocouple measurements](#) (on page 3-22).

[SENSe:]TCouple:TYPE <name>

Use this command to select thermocouple sensor type.

Parameters

<name>	description
B	Thermocouple type B.
C	Thermocouple type C.
E	Thermocouple type E.
J	Thermocouple type J.
K	Thermocouple type K.
N	Thermocouple type N.
R	Thermocouple type R.
S	Thermocouple type S.
T	Thermocouple type T.

Query

command	description
[SENSe:]TCouple:TYPE?	Query thermocouple sensor type. Returns type parameter.

Details

Refer to [Thermocouple measurements](#) (on page 3-22) for information about thermocouple types.

Example

TCouple:TYPE J	Select type J.
----------------	----------------

Also see

[\[SENSe:\]UNIT <name>](#) (on page 5-61)

[\[SENSe:\]TCouple:RJUNction:RSElect <name>](#) (on page 5-53)

[SENSe:]TEMPerature:RTD:ALPHA <n>|MIN|MAX

Use this command to select the alpha constant for the user defined RTD type.

Parameters

<n>	description
Alpha value	Select the alpha constant value.
MINimum	Select the minimum value.
MAXimum	Select the maximum value.

Query

command	description
[SENSe:]TEMPerature:RTD:ALPHA?	Query the alpha constant for the user defined RTD type.
[SENSe:]TEMPerature:RTD:ALPHA? MIN	Query the minimum alpha constant for the user defined RTD type.
[SENSe:]TEMPerature:RTD:ALPHA? MAX	Query the maximum alpha constant for the user defined RTD type.

Details

Refer to the following topic in the [Temperature measurement](#) (on page 3-17) section for more information about RTD type: [RTD coefficients and temperature calculation](#) (on page 3-19).

[SENSe:]TEMPerature:RTD:BETA <n>|MIN|MAX

Use this command to select the beta constant for the user defined RTD type.

Parameters

<n>	description
Beta value	Select the beta constant value.
MINimum	Select the minimum value.
MAXimum	Select the maximum value.

Query

command	description
[SENSe:]TEMPerature:RTD:BETA?	Query the beta constant for the user defined RTD type.
[SENSe:]TEMPerature:RTD:BETA? MIN	Query the minimum beta constant for the user defined RTD type.
[SENSe:]TEMPerature:RTD:BETA? MAX	Query the maximum beta constant for the user defined RTD type.

Details

Refer to the following topic in the [Temperature measurement](#) (on page 3-17) section for more information about RTD type: [RTD coefficients and temperature calculation](#) (on page 3-19).

[SENSe:]TEMPerature:RTD:DELTA <n>|MIN|MAX

Use this command to select the delta constant for the user defined RTD type.

Parameters

<n>	description
Delta value	Select the delta constant value.
MINimum	Select the minimum value.
MAXimum	Select the maximum value.

Query

command	description
[SENSe:]TEMPerature:RTD:DELTA?	Query the delta constant for the user defined RTD type.
[SENSe:]TEMPerature:RTD:DELTA? MIN	Query the minimum delta constant for the user defined RTD type.
[SENSe:]TEMPerature:RTD:DELTA? MAX	Query the maximum delta constant for the user defined RTD type.

Details

Refer to the following topic in the [Temperature measurement](#) (on page 3-17) section for more information about RTD type: [RTD coefficients and temperature calculation](#) (on page 3-19)

[SENSe:]TEMPerature:RTD:TYPE <name>

Use this command to select the RTD sensor type for temperature measurement with RTD.

Parameters

<name>	description
PT100	Select RTD type PT100.
D100	Select RTD type D100.
F100	Select RTD type F100.
PT385	Select RTD type PT385.
PT3916	Select RTD type PT3916.
USER	Select RTD type USER.
SPRTD	Select RTD type SPRTD.
NTCT	Select RTD type NTCT.

Query

command	description
[SENSe:]TEMPerature:RTD:TYPE?	Query the RTD type for temperature measurement with RTD.

Details

Refer to [Thermocouple measurements](#) (on page 3-22) and [RTD coefficients and temperature calculation](#) (on page 3-19) for information about RTD coefficients.

[SENSe:]TEMPerature:RTD:RZERO <n>|MIN|MAX

Use this command to select the R-Zero constant for the user defined RTD type.

Parameters

<n>	description
R-Zero value.	Select the R-Zero value.
MINimum	Select the minimum value.
MAXimum	Select the maximum value.

Query

command	description
[SENSe:]TEMPerature:RTD:RZERO?	Query the R-Zero constant for the user defined RTD type.
[SENSe:]TEMPerature:RTD:RZERO? MIN	Query the minimum R-Zero constant for the user defined RTD type.
[SENSe:]TEMPerature:RTD:RZERO? MAX	Query the maximum R-Zero constant for the user defined RTD type.

Details

Refer to the following topic in the [Temperature measurement](#) (on page 3-17) section for more information about RTD type: [RTD coefficients and temperature calculation](#) (on page 3-19).

[SENSe:]TEMPerature:SPRTD:RZERO <n>|MIN|MAX

Use this command to set the sensor R value at 0 degree Celsius.

Parameters

<n>	description
value	Select sensor R value at 0 degree Celsius.
MINimum	Select the minimum value.
MAXimum	Select the maximum value.

Query

command	description
[SENSe:]TEMPerature:SPRTD:RZERO?	Query the sensor R value at 0 degree Celsius.
[SENSe:]TEMPerature:SPRTD:RZERO? MIN	Query the minimum sensor R value at 0 degree Celsius.
[SENSe:]TEMPerature:SPRTD:RZERO? MAX	Query the maximum sensor R value at 0 degree Celsius.

Details

Refer to the following topic in the [Temperature measurement](#) (on page 3-17) section for more information about SPRTD type: [RTD coefficients and temperature calculation](#) (on page 3-19).

[SENSe:]TEMPerature:SPRTD:A4 <n>|MIN|MAX

Use this command to set the A4 coefficient for the SPRTD sensor:

Parameters

<n>	description
value	A4 value.
MINimum	Select the minimum value.
MAXimum	Select the maximum value.

Query

command	description
[SENSe:]TEMPerature:SPRTD:A4?	Query the sensor A4 coefficient.
[SENSe:]TEMPerature:SPRTD:A4? MIN	Query the minimum sensor A4 coefficient.
[SENSe:]TEMPerature:SPRTD:A4? MAX	Query the maximum sensor A4 coefficient.

Details

Refer to the following topic in the [Temperature measurement](#) (on page 3-17) section for more information about the A4 coefficient: [RTD coefficients and temperature calculation](#) (on page 3-19).

[SENSe:]TEMPerature:SPRTD:B4 <n>|MIN|MAX

Use this command to set the B4 coefficient for the SPRTD sensor:

Parameters

parameter	description
<n>	B4 value.
MINimum	Select the minimum value.
MAXimum	Select the maximum value.

Query

command	description
[SENSe:]TEMPerature:SPRTD:B4?	Query the sensor B4 coefficient.
[SENSe:]TEMPerature:SPRTD:B4? MIN	Query the minimum sensor B4 coefficient.
[SENSe:]TEMPerature:SPRTD:B4? MAX	Query the maximum sensor B4 coefficient.

Details

Refer to the following topic in the [Temperature measurement](#) (on page 3-17) section for more information about the B4 coefficient: [RTD coefficients and temperature calculation](#) (on page 3-19).

[SENSe:]TEMPerature:SPRTD:AX <n>|MIN|MAX

Use this command to set the AX coefficient for the SPRTD sensor.

Parameters

<n>	description
value	Select the AX coefficient for the SPRTD sensor.
MINimum	Select the minimum value.
MAXimum	Select the maximum value.

Query

command	description
[SENSe:]TEMPerature:SPRTD:AX?	Query the sensor AX coefficient.
[SENSe:]TEMPerature:SPRTD:AX? MIN	Query the minimum sensor AX coefficient.
[SENSe:]TEMPerature:SPRTD:AX? MAX	Query the maximum sensor AX coefficient.

Details

Refer to the following topic in the [Temperature measurement](#) (on page 3-17) section for more information about the AX coefficient: [RTD coefficients and temperature calculation](#) (on page 3-19).

[SENSe:]TEMPerature:SPRTD:BX <n>|MIN|MAX

Use this command to set the BX coefficient for the SPRTD sensor.

Parameters

<n>	description
value	Select the BX coefficient for the SPRTD sensor.
MINimum	Select the minimum value.
MAXimum	Select the maximum value.

Query

command	description
[SENSe:]TEMPerature:SPRTD:BX?	Query the sensor BX coefficient.
[SENSe:]TEMPerature:SPRTD:BX? MIN	Query the minimum sensor BX coefficient.
[SENSe:]TEMPerature:SPRTD:BX? MAX	Query the maximum sensor BX coefficient.

Details

Refer to the following topic in the [Temperature measurement](#) (on page 3-17) section for more information about the BX coefficient: [RTD coefficients and temperature calculation](#) (on page 3-19).

[SENSe:]TEMPerature:SPRTD:CX <n>|MIN|MAX

Use this command to set the CX coefficient for the SPRTD sensor.

Parameters

<n>	description
value	Select the CX coefficient for the SPRTD sensor.
MINimum	Select the minimum value.
MAXimum	Select the maximum value.

Query

command	description
[SENSe:]TEMPerature:SPRTD:CX?	Query the sensor CX coefficient.
[SENSe:]TEMPerature:SPRTD:CX? MIN	Query the minimum sensor CX coefficient.
[SENSe:]TEMPerature:SPRTD:CX? MAX	Query the maximum sensor CX coefficient.

Details

Refer to the following topic in the [Temperature measurement](#) (on page 3-17) section for more information about the CX coefficient: [RTD coefficients and temperature calculation](#) (on page 3-19).

[SENSe:]TEMPerature:SPRTD:DX <n>|MIN|MAX

Use this command to set the DX coefficient for the SPRTD sensor.

Parameters

<n>	description
value	Select the DX coefficient for the SPRTD sensor.
MINimum	Select the minimum value.
MAXimum	Select the maximum value.

Query

command	description
[SENSe:]TEMPerature:SPRTD:DX?	Query the sensor DX coefficient.
[SENSe:]TEMPerature:SPRTD:DX? MIN	Query the minimum sensor DX coefficient.
[SENSe:]TEMPerature:SPRTD:DX? MAX	Query the maximum sensor DX coefficient.

Details

Refer to the following topic in the [Temperature measurement](#) (on page 3-17) section for more information about the DX coefficient: [RTD coefficients and temperature calculation](#) (on page 3-19).

[SENSe:]TEMPerature:TRANsducer <name>

Use this command to select the temperature transducer type.

Parameters

<name>	description
RTD	Select transducer type RTD.
FRTD	Select transducer typeFRTD.

Query

command	description
[SENSe:]TEMPerature:TRANsducer:TYPE?	Query the temperature transducer type.

Details

Refer to the following topic in the [Temperature measurement](#) (on page 3-17) section for more information about RTD measurement: [RTD coefficients and temperature calculation](#) (on page 3-19).

[SENSe:]UNIT <name>

Use this command to select units for temperature measurement.

Parameters

<name>	description
Cel	Celsius.
Far	Fahrenheit
K	Kelvin

Query

command	description
[SENSe:]UNIT?	Query unit sensor type. Returns type.

Details

Select units for temperature measurement. Cel means Celsius, Far means Fahrenheit, and K means Kelvin. Refer to the following topics in the [Temperature measurement](#) (on page 3-17) section for more information about units: [RTD coefficients and temperature calculation](#) (on page 3-19) and [Entering sensor coefficients](#) (on page 3-19)

[SENSe:]VOLTage:AC:RANGe <n>|MIN|MAX

Use this command to select the function (ACV) and set a measurement range.

Parameters

<n>	description
0 to 750	Select the measurement range in volts.
MINimum	Select the minimum value.
MAXimum	Select the maximum value.

Query

command	description
[SENSe:]VOLTage:AC:RANGe?	Query the measurement range.
[SENSe:]VOLTage:AC:RANGe? MIN	Query the minimum range.
[SENSe:]VOLTage:AC:RANGe? MAX	Query the maximum range.

[SENSe:]VOLTage:AC:RANGe:AUTO

This command turns autorange on or off for AC voltage measurements.

Parameters

	description
0 or OFF	Turn autorange off.
1 or ON	Turn autorange on.

Query

command	description
[SENSe:]VOLTage:AC:RANGe:AUTO?	Query AC voltage autorange state.

[SENSe:]VOLTage:AC:RESolution <n>|MIN|MAX

Use this command to select resolution for AC voltage measurements (ACV).

Parameters

<n>	description
(1.00e-06 to 1.00e-04) * ACV range	Select the resolution of the measurement.
MINimum	Select the minimum value.
MAXimum	Select the maximum value.

Query

command	description
[SENSe:]VOLTage:AC:RESolution?	Query the measurement resolution.
[SENSe:]VOLTage:AC:RESolution? MIN	Query the minimum resolution.
[SENSe:]VOLTage:AC:RESolution? MAX	Query the maximum resolution.

Details

Refer to [Bandwidth and resolution for AC measurements](#) (on page 3-43) more information about resolution.

[SENSe:]VOLTage[:DC]:RANGe <n>MIN|MAX

Use this command to select the function (DCV) and set a measurement range.

Parameters

<n>	description
-1000 to 1000	Select the measurement range in volts.
MINimum	Select the minimum value.
MAXimum	Select the maximum value.

Query

command	description
[SENSe:]VOLTage[:DC]:RANGe?	Query the measurement range.
[SENSe:]VOLTage[:DC]:RANGe? MIN	Query the minimum range.
[SENSe:]VOLTage[:DC]:RANGe? MAX	Query the maximum range.

[SENSe:]VOLTage[:DC]:RANGe:AUTO

This command turns autorange on or off for DC voltage measurements.

Parameters

	description
0 or OFF	Turn autorange off.
1 or ON	Turn autorange on.

Query

command	description
[SENSe:]VOLTage[:DC]:RANGe:AUTO?	Query DC voltage autorange state.

[SENSe:]VOLTage[:DC]:NPLCycles <n>|MIN|MAX

Use this command to select the integration time for voltage measurements. Integration time for DCV measurements is expressed as the number of power line cycles (NPLC).

Parameters

<n>	description
0.001	Select 0.001 NPLC.
0.006	Select 0.006 NPLC.
0.02	Select 0.02 NPLC.
0.06	Select 0.06 NPLC.
0.2	Select 0.2 NPLC.
0.6	Select 0.6 NPLC.
1	Select 1 NPLC.
2	Select 2 NPLC.
10	Select 10 NPLC.
100	Select 100 NPLC.
MINimum	Select the minimum value.
MAXimum	Select the maximum value.

Query

command	description
[SENSe:]VOLTage[:DC]:NPLCycles?	Query the NPLCycles.
[SENSe:]VOLTage[:DC]:NPLCycles? MIN	Query the minimum value.
[SENSe:]VOLTage[:DC]:NPLCycles? MAX	Query the maximum value.

Details

Refer to [Integration time and resolution for DC and resistance measurements](#) (on page 3-41) more information about NPLC.

[SENSe:]VOLTage[:DC]:RESolution <n>|MIN|MAX

Use this command to select resolution for DC voltage measurements (DCV).

Parameters

<n>	description
(3.00e-07 to 3.00e-04) * DCV range	Select the resolution of the measurement.
MINimum	Select the minimum value.
MAXimum	Select the maximum value.

Query

command	description
[SENSe:]VOLTage[:DC]:RESolution?	Query the measurement range.
[SENSe:]VOLTage[:DC]:RESolution? MIN	Query the minimum range.
[SENSe:]VOLTage[:DC]:RESolution? MAX	Query the maximum range.

Details

Refer to [Integration time and resolution for DC and resistance measurements](#) (on page 3-41) more information about resolution.

[SENSe:]ZERO:AUTO <name>

Use this command to turn autozero mode on, on once, and off. The OFF and ONCE have a similar effect. OFF mode does not issue a new offset measurement until the multimeter goes to the "WAIT-FOR-TRIGGER" state.

Parameters

<name>	description
OFF	Turn autozero off.
ON	Turn autozero on.
ONCE	ONCE issues an immediate offset.

Query

command	description
[SENSe:]ZERO:AUTO?	Query the auto zero mode. Returns 1 for on, 0 for off and once.

Details

Refer to [Autozero](#) (on page 3-38) for more information about autozero.

SYSTem subsystem

The SYSTem subsystem contains miscellaneous commands that are summarized in [SYSTem subsystem summary](#) (on page 5-26).

:BEEPer

This command turns the beeper on or off for limit tests.

Parameters

	description
0 or OFF	Turn beeper off.
1 or ON	Turn beeper on.

Query

command	description
BEEPer?	Query the state of the beeper. Returns 0 (off) or 1 (on).

Example

BEEPer ON	Turns on the beeper.
-----------	----------------------

:DATA:POINTs?

Query the number of readings stored in the instrument's internal memory.

Parameters

None.

Query

command	description
:DATA:POINTs?	Query the number of readings stored in the multimeter's internal memory.

SYSTem:ERRor?

Query the multimeter's error queue. Up to 20 errors can be stored in the queue. Errors are retrieved in first-in-first-out (FIFO) order. Each error string may contain up to 80 characters.

Query

This query command returns an error code. For example:

```
-102 Syntax error
```

Refer to [Error codes](#) (on page 6-3) for information about the error codes.

SYSTem:VERSion?

Query the present SCPI version.

Query

This query command returns the SCPI version. For example:
1991.0

SYSTem:LOCal

Place the instrument in the local mode. All keys on the front panel are fully functional.

Query

None.

SYSTem:REMote

Place the multimeter in the remote mode. All buttons on the front panel, except the LOCAL button, are disabled.

Query

None.

TRIGger subsystem

The commands in this subsystem configure and control the trigger operations and are summarized in [TRIGger subsystem summary](#) (on page 5-27).

When the instrument is triggered to start performing measurements, it stores a specified number of measurement readings in the data buffer (memory).

The total number of measurements the instrument takes is the product of the trigger count and sample count. See [Sample count](#) (on page 3-34) and [Trigger count](#) (on page 3-34) for details.

Use the following command to place the instrument in the wait-for-trigger state:

[:INITiate](#) (on page 5-17)

Use the following command to retrieve the stored readings:

[:FETCh\[1|2\]?](#) (on page 5-16)

Use the following command to query the number of stored readings:

[:DATA:POINts?](#) (on page 5-66)

SAMPlE:COUNT <n>|MIN|MAX

Use this command to set the number of readings (samples) the instrument takes per trigger. Select a number from 1 to 50,000 readings per trigger.

Parameters

<n>	description
1 to 50,000	Select the number of readings (samples) the instrument takes per trigger.
MINimum	Select the minimum value.
MAXimum	Select the maximum value.

Query

command	description
SAMPlE:COUNT?	Query the number of samples.
SAMPlE:COUNT? MIN	Query the minimum number of samples.
SAMPlE:COUNT? MAX	Query the maximum number of samples.

TRIGger:COUNT <n>|MIN|MAX|INFinite

Use this command to specify the number of triggers the instrument will accept before returning to the “idle” state. Select from 1 to 50,000 triggers. Trigger count is ignored while in local operation.

Parameters

<n>	description
1 to 50,000	Select value for the number of triggers.
MINimum	Select the minimum value.
MAXimum	Select the maximum value.
INFinite	Select INFinite to instruct the instrument to take triggers continuously.

Query

command	description
TRIGger:COUNT?	Query the number of triggers. Returns “9.9000000E+37” when you select the infinite trigger count.
TRIGger:COUNT? MIN	Query the minimum number of triggers.
TRIGger:COUNT? MAX	Query the maximum number of triggers.

TRIGger:DElay <n>|MIN|MAX

Use this command to select a trigger delay time in seconds. The delay is the time between the trigger signal and each sample that follows. Specify a delay time from 0 to 3600 seconds.

Parameters

<n>	description
0 to 3600	Specify a delay time from 0 to 3600 seconds.

Query

command	description
TRIGger:DElay?	Query the trigger delay time.
TRIGger:DElay? MAX	Query the minimum trigger delay time.
TRIGger:DElay? MIN	Query the maximum trigger delay time.

Details

Refer to [Trigger delay](#) (on page 3-35) for information about sources.

TRIGger:DElay:AUTO

Turn automatic trigger delay on or off.

The delay is determined by function, range, integration time, and AC filter setting. Specifying a delay time automatically turns off the automatic trigger delay.

Parameters

	description
0 or OFF	Turn selected automatic trigger delay off.
1 or ON	Turn automatic trigger delay on.

Query

command	description
TRIGger:DElay:AUTO?	Query the automatic trigger delay mode. Returns 0 (OFF) or 1 (ON).

TRIGger:SOURce <name>

Use this command to select a trigger source. The instrument accepts a software (BUS) trigger, an immediate internal trigger, or a hardware trigger from the rear-panel EXT TRIG terminal.

Parameters

<name>	description
BUS	Select software trigger.
IMMediate	Select immediate internal trigger.
EXTernal	Select hardware trigger from the rear-panel EXT TRIG terminal.

Query

command	description
TRIGger:SOURce?	Query the trigger source.

Details

Refer to Trigger sources information about sources.

Troubleshooting guide

In this section:

Troubleshooting	6-1
Running a self-test	6-2
Error codes.....	6-3

Troubleshooting

This section provides information to help you troubleshoot problems with your instrument.

Refer to the following Websites for information about your instrument:

1. [Keithley Instruments website](http://www.keithley.com) (*http://www.keithley.com*)
2. [Keithley web forum](http://forum.keithley.com) (*http://forum.keithley.com*)

Refer to the [Displaying the instrument's serial number](#) (on page 1-5) section for information about your instrument's serial number.

Refer to the remainder of this section for information about running a self test and error codes.

Running a self-test

Self-test procedures are built into the Model 2110 for checking that the logic and measurement hardware are functioning properly. Every time the instrument is powered on, these test procedures are performed to make sure the basic functions of the instrument work properly. If any error occurs during self-test procedures, it indicates that parts of the instrument are not operating properly and may need to be serviced.



CAUTION

Erroneous self-test failures may occur under the following conditions:

- Signals are present on the input terminal during self-test procedure.
- Long test leads act as an antenna, causing pick-up of AC signals.
- Power line voltages are not set correctly.

You may also run self-tests on the instrument that provide additional hardware testing.

To run a self-test, use the following procedure:

1. Press the **SHIFT** and **CONFIG (MENU)** keys to display the MENU options.
2. Use the **▶** and **◀** keys to display SYSTEM, and then press the **ENTER** key.
3. Use the **▶** and **◀** keys to display SELF TEST, and then press the **ENTER** key. The instrument runs the test and shows the results on the display as follows:
 - TEST PASS - if the test passes.
 - TEST FAIL - if the test fails. The instrument also lights the **ERR** indicator if the test fails.

If there are errors, refer to [Viewing errors in the error queue](#) (on page 2-23) for information about how to view the errors.

Error codes

Errors are retrieved in first-in-first-out (FIFO) order. The first error returned is the first error that was stored. When you have read all errors from the queue, the ERROR annunciator turns off. The instrument beeps once each time an error occurs.

If more than 20 errors occur, the last error stored in the queue (the most recent error) is replaced with the error code:

```
-350, "Too many errors"
```

No additional errors are saved until you remove errors from the queue. After you remove errors from the queue, the instrument responds with:

```
+0, "No error"
```

The following conditions clear the error queue:

- Turning off the power
- Sending a *CLS (clear status) command

The *RST (reset) command does not clear the error queue.

Refer to [Viewing errors in the error queue](#) (on page 2-23) for information about how to view the errors.

This topic provides information about execution errors (EE) and self-test errors (ST).

Error code	Type	Description
-101 Invalid character	EE	An invalid character was found in the command string.
-102 Syntax error.	EE	Invalid syntax was found in the command string.
-103 Invalid separator	EE	An invalid separator was found in the command string.
-104 Data type error	EE	A parameter type error was found in the command string.
-105 GET not allowed	EE	A Group Execute Trigger (GET) is not allowed in the command string.
-108 Parameter not allowed	EE	More parameters were found than needed for the command.
-109 Missing parameter	EE	Not enough parameters were received for the command.
-112 Program mnemonic too long	EE	A command header with too many characters was received.
-113 Undefined header	EE	An invalid command was received.
-121 Invalid character in number	EE	An invalid character was found in the number specified for a parameter value.
-123 Numeric overflow	EE	A numeric parameter with exponent larger than 32000 was found.
-124 Too many digits	EE	A numeric parameter was found whose mantissa contained more than 255 digits, excluding leading zeros.
-131 Invalid suffix	EE	A suffix was incorrectly specified for a numeric parameter.
-138 Suffix not allowed	EE	A suffix was received following a numeric parameter which does not accept a suffix.
-148 Character not allowed	EE	A discrete parameter was received but a character string or a numeric parameter was expected.
-151 Invalid string data	EE	An invalid character string was received.
-158 String data not allowed	EE	A character string was received but not allowed for the command.
-160~~168 Block data errors	EE	Block data is not acceptable.
-170~~178 Expression errors	EE	The meter does not accept mathematical expression.
-211 Trigger ignored	EE	A Group Execute Trigger (GET) or *TRG was received but the trigger was ignored.

Error code	Type	Description
-213 Init Ignored	EE	An INITiate command was received but could not be executed because a measurement was already in progress. Send a device clear to halt a measurement in progress and place the meter in the idle state.
-214 Trigger deadlock	EE	A trigger deadlock occurs when the trigger source is BUS and a READ? command is received.
-221 Settings conflict	EE	This error can be generated in one of the following situations: <ul style="list-style-type: none"> Situation 1: You sent a CONFigure or MEASure command with autorange enabled and with a fixed resolution. Situation 2: You turned math on and then changed to a math operation that was not valid with the present measurement function. Situation 3: When the autorange is enabled at the DCI's and ACI's 10A ranges, the error message will be generated.
-222 Data out of range	EE	A numeric parameter value is out of range.
-223 Too much data	EE	A character string was too long.
223 2nd function mismatch	EE	The 1st and 2nd functions mismatch.
-224 Illegal parameter value	EE	A discrete parameter was received that was not a valid choice for the command.
225 Function/range mismatch		The measurement function and the range specified for the function are mismatched.
-230 Data Stale	EE	A FETCh? command was received, but the memory was empty.
-350 Too many errors	EE	The error queue is full.
-410 Query INTERRUPTED	EE	A command was received that sends data to the output buffer, but the output buffer contained data from a previous command.
-420 Query UNTERMINATED	EE	The instrument was addressed to talk (for example, to send data over the interface), but a command has not been received that will send data to the output buffer.
-430 Query DEADLOCKED	EE	A command was received that generates too much data to fit in the output buffer at the same time that the input buffer was full. Command execution continues, but all data is lost.
-440 Query UNTERMINATED after indefinite response	EE	The *IDN? command must be the last query command within a command string.
521 Input buffer overflow	EE	Input buffer overflow.
522 Output buffer overflow	EE	Output buffer overflow.
531 Insufficient memory	EE	There is not enough memory to store the requested number of readings in internal memory using the INITiate command. The product of the sample count (SAMPLE:COUNT) and the trigger count (TRIGger:COUNT) must not exceed 2000 readings.
532 Cannot achieve requested resolution	EE	The instrument cannot achieve the requested measurement resolution. You may have specified an invalid resolution in the CONFigure or MEASure command.
540 Cannot use overload as math reference	EE	The instrument cannot store an overload reading (9.90000000E+37) as the math reference for null or dB measurements. The math state is turned off as a result of this condition.
550 Command not allowed in local	EE	The instrument received a READ? command while in the local mode.
601 Front panel does not respond	ST	The main CPU U1601 attempts to establish serial communications with the front-panel processor U3. Communication must function in both directions for this test to pass.
602 RAM read/write failed	ST	This test writes and reads a 55h and AAh checkerboard pattern to each address of RAM U1701. Any incorrect read back will cause a test failure. This error is only readable from the remote interface.

Error code	Type	Description
603 Front-End MCU does not respond	ST	The main CPU U1601 attempts to establish serial communications with the front-end processor U2001. Communication must function in both directions for this test to pass.
604 A/D noisy test failed	ST	This test configures to the 10 V DC range with the internal 0 V. A 20 ms ADC measurement is performed, and the result is checked against a limit of $0\text{ V} \pm 20\text{ }\mu\text{V}$.
605 N2 calibration parameter failed:	ST	This error message indicates that N2 calibration parameter is out of range.
606 N3 calibration parameter failed:	ST	This error message indicates that N3 calibration parameter is out of range.
607 Buffer1 offset out of range	ST	This procedure is to test the offset of buffer U507. The result is checked against a limit of $0 \pm 0.1\text{ mV}$
608 Buffer2 offset out of range	ST	This procedure is to test the offset of buffer U508. The result is checked against a limit of $0 \pm 0.1\text{ mV}$
609 DC gain x1 failed	ST	This procedure is to test the tolerance of DC gainx1 amplifier. The limit of gain tolerance is ± 0.005 .
610 DC gain x10 failed	ST	This procedure is to test the tolerance of DC gainx10 amplifier. The limit of gain tolerance is ± 0.05 .
611 DC gain x100 failed	ST	This procedure is to test the tolerance of DC gainx100 amplifier. The limit of gain tolerance is ± 0.5 .
612 Ohms 500 nA source failed	ST	This test configures to the 10 V DC range with the internal 10 M 100:1 divider R204 connected across the input. The 500 nA ohms current source is connected to produce a nominal 5 V signal. A 20 ms A DC measurement is performed, and the result is checked against a limit of $5\text{ V} \pm 1\text{ V}$.
613 Ohms 5 uA source failed	ST	This test configures to the 1000 V DC range with the internal 10 M 100:1 divider R204 connected across the input. The 5 μA ohms current source is connected. The compliance limit of the current source is measured. A 20 ms A DC measurement is performed, and the result is checked against a limit of $0.12\text{ V} \pm 0.01\text{ V}$.
614 DC 1000V zero failed	ST	This test configures to the 1000 V DC range with no input applied. A 20 ms A DC measurement is performed, and the result is checked against a limit of $0\text{V} \pm 5\text{ mV}$.
615 Ohms 10 uA source failed	ST	This test configures to the 1000 V DC range with the internal 10 M 100:1 divider R204 connected across the input. The 10 μA ohms current source is connected. The compliance limit of the current source is measured. A 20 ms A DC measurement is performed, and the result is checked against a limit of $0.12\text{ V} \pm 0.01\text{ V}$.
616 DC current sense failed	ST	This test configures to the 3 A DC range. A 20 ms A DC measurement is performed, and the result is checked against a limit of $0\text{ A} \pm 5\text{ A}$. This test confirms that the DC current sense path is functional. The test limit is set wide because K303 does not open the current input during self-test. This test should catch a DC current sense failure without causing false failures when current inputs are applied during self-test.
617 Ohms 100 uA source failed	ST	This test configures to the 1000 V DC range with the internal 10 M 100:1 divider R204 connected across the input. The 100 μA ohms current source is connected. The compliance limit of the current source is measured. A 20 ms A DC measurement is performed, and the result is checked against a limit of $0.12\text{ V} \pm 0.01\text{ V}$.
618 DC high voltage attenuator failed	ST	This test configures to the 1000 V DC range. The 500 nA ohms current source is connected to produce a nominal 5 V signal. A 20 ms A DC measurement is performed, and the result is checked against a limit of $5\text{ V} \pm 1\text{ V}$.

Error code	Type	Description
619 Ohms 1 mA source failed	ST	This test configures to the 1000 V DC range with the internal 10 M 100:1 divider R204 connected across the input. The 1 mA ohms current source is connected. The compliance limit of the current source is measured. A 20 ms A DC measurement is performed, and the result is checked against a limit of $0.12 \text{ V} \pm 0.01 \text{ V}$.
620 AC rms zero failed	ST	This test configures for the 100 mV AC range with the AC input grounded. The internal residual noise of the AC section is measured and checked against a limit of -10 mV to 70 mV at the output of the RMS-to-DC converter.
621 AC rms full scale failed	ST	This test configures for the 100 m V AC range. The 1 mA ohms current source is switched on to charge the AC input capacitor C614. This produces a pulse on the output of the RMS-to-DC converter, which is sampled 100 ms after the current is applied. A 20 ms A/D measurement is performed and checked against a limit of 2 V to 13 V into the A DC.
624 Unable to sense line frequency	EE ST	The AC line frequency cannot be measured after powering on the instrument. The instrument will assume 50 Hz line operation for all future measurements.
640 Meas setting failed	EE	You cannot command to set through the A/D.
641 Meas reading failed	EE	You cannot command to read from A/D.
642 Board Protect failed	EE	The specific IC is malfunctioning or missing. All communication is blocked.
650 Panel failed	EE	The main board cannot communicate with the front panel.
651 Panel Program Checksum Error	EE	The checksum from the front panel is incorrect.

In this section:

[Additional Model 2110 information](#) 7-1

Additional Model 2110 information

This manual has prepared you to start using your new Model 2110 instrument.

For additional information on the Model 2110, refer to:

- The Product Information CD-ROM (ships with the product): Contains software tools, drivers, and product documentation.
- The [Keithley Instruments website](http://www.keithley.com) (<http://www.keithley.com>): Contains the most up-to-date information; from the website, you can access:
 - The Knowledge Center, which contains the following handbooks:
 - *The Low Level Measurements Handbook: Precision DC Current, Voltage, and Resistance Measurements*
 - *Switching Handbook: A Guide to Signal Switching in Automated Test Systems*
 - Application notes
 - Updated drivers
- Your local Field Applications Engineer can help you with product selection, configuration, and usage. Check the website for contact information.

Maintenance

In this appendix:

Introduction.....	A-1
Line fuse replacement	A-1
Current input fuse replacement	A-4
Upgrading the firmware	A-5

Introduction

This section provides maintenance information and procedures that can be performed by the operator.

Line fuse replacement

A fuse located on the Model 2110 rear panel protects the power line input of the instrument.




WARNING

Disconnect the line cord at the rear panel and remove all test leads connected to the instrument before replacing the line fuse. Failure to do so could expose the operator to hazardous voltages that could result in personal injury or death.

The power line fuse is accessible from the rear panel, adjacent to the AC power receptacle, as shown in the following figure.

Figure 33: Plug in power switch

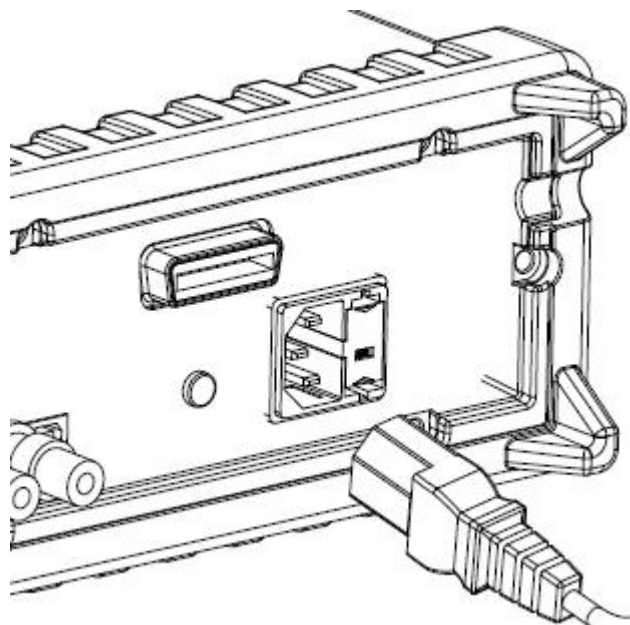

Perform the following steps to replace the line fuse:




WARNING

To prevent injury, death, or instrument damage, use only the correct fuse type.


1. Power-off the instrument and remove the line cord.
2. The voltage selector container is located next to the AC receptacle. A small tab is located on the top of the container. Using a thin-bladed knife or a screwdriver, pry this tab away from the AC receptacle.
3. Slide the voltage selector container out to gain access to the fuse, as shown in the following figure.

Figure 34: Remove voltage selector

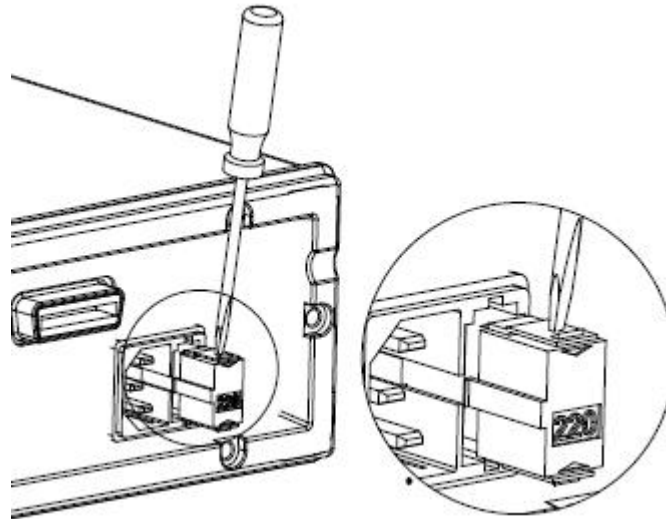

4. Snap the fuse out of voltage selector container and replace it with the same type.

Figure 35: Removing a broken fuse

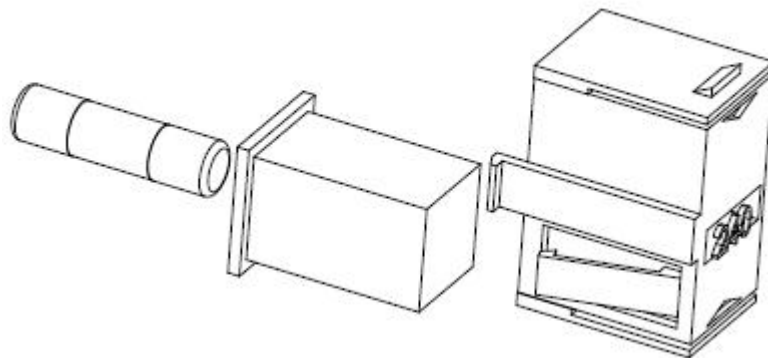

5. Push the voltage selector container back into the module.

If the power line fuse continues to blow, a circuit malfunction exists and must be corrected. Return the unit to Keithley Instruments for repair.

Current input fuse replacement

The Model 2110 uses two fuses to protect it from excessive input current:

- 3 A, 250 V, 5 x 20 mm, slow-blow fuse
- 15 A, 250 V, 5 x 20 mm, slow-blow fuse

WARNING

Disconnect the line cord at the rear panel and remove all test leads connected to the instrument before replacing a current input fuse. Failure to do so could expose you to hazardous voltages that could result in personal injury or death.


CAUTION

For continued protection against fire or instrument damage, only replace the current input fuses with the same type and rating. If the instrument repeatedly blows fuses, have the unit serviced at an authorized repair facility.

As shown in the following figure, the current input fuses are located in the current input terminals. Perform the following steps to replace a blown fuse:

1. Push in the fuse holder and turn it to the right until it releases.
2. Pull out the fuse holder to expose the current input fuse.
3. Remove the blown fuse and replace it with the same fuse type and rating.
4. Reinsert the fuse holder, turning it to the left as you push it in. Ensure that the fuse holder is properly seated and secured.

Figure 36: Current input fuses

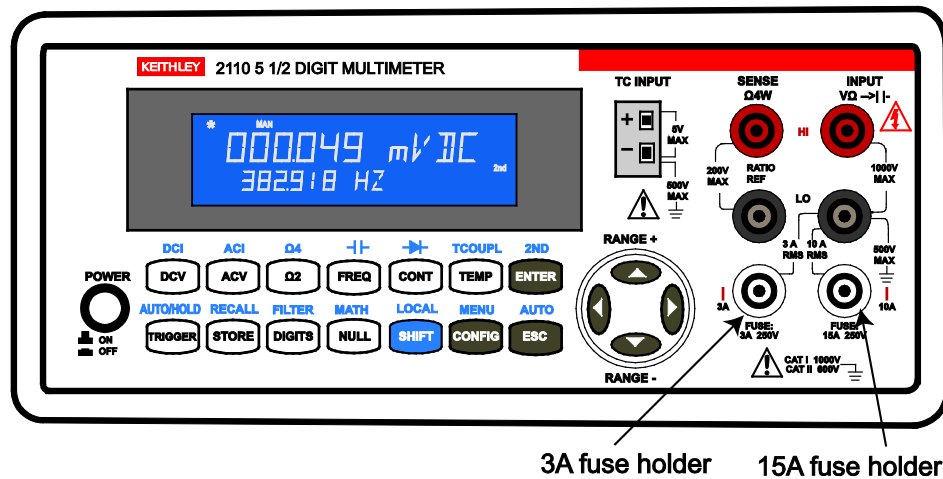

Upgrading the firmware

Refer to the [Keithley Instruments website](http://www.keithley.com) (<http://www.keithley.com>) for information about upgrading the firmware.

Status model

In this appendix:

Overview	B-1
Clearing registers and queues.....	B-3
Programming enable registers	B-3
Reading registers	B-4
Status byte and service request (SRQ)	B-4
Status register sets.....	B-8
Status reporting command summary.....	B-11

Overview

The Model 2110 provides a series of status registers and queues, allowing the operator to monitor and manipulate the various instrument events. The status structure is shown in following figure. The heart of the status structure is the Status Byte Register. This register can be read by the user's test program to determine if a service request (SRQ) has occurred, and what event caused it.

Status byte and SRQ

The Status Byte Register receives the summary bits of the status register sets, queue, and buffer. The registers monitor the various instrument events. When an enabled event occurs, it sets a summary bit in the Status Byte Register. When a summary bit of the Status Byte and its corresponding enable bit are set (as programmed by the user), the Request Service (RQS) bit will set to indicate that a service request (SRQ) has occurred.

Status register sets

A typical status register set is made up of an event register and an event enable register.

The event enable register:


- Accepts both read and write operations
- Indicates bits in the corresponding event register that are ORed together to produce the summary bit of the event register.

When an event occurs, the appropriate event register bit sets to 1. The bit remains latched to 1 until the register is reset. When an event register bit and its corresponding enable bit are set (as programmed by the user), the output (summary) of the register will set to 1, which then sets the summary bit of the Status Byte Register.

Error Queue and Output Buffer

The instrument uses an Output Buffer and an Error Queue. The response messages to query commands are placed in the Output Buffer. As various programming errors and status messages occur, they are placed in the Error Queue. When a queue contains data, it sets the appropriate summary bit of the Status Byte Register.

Figure 37: Status model

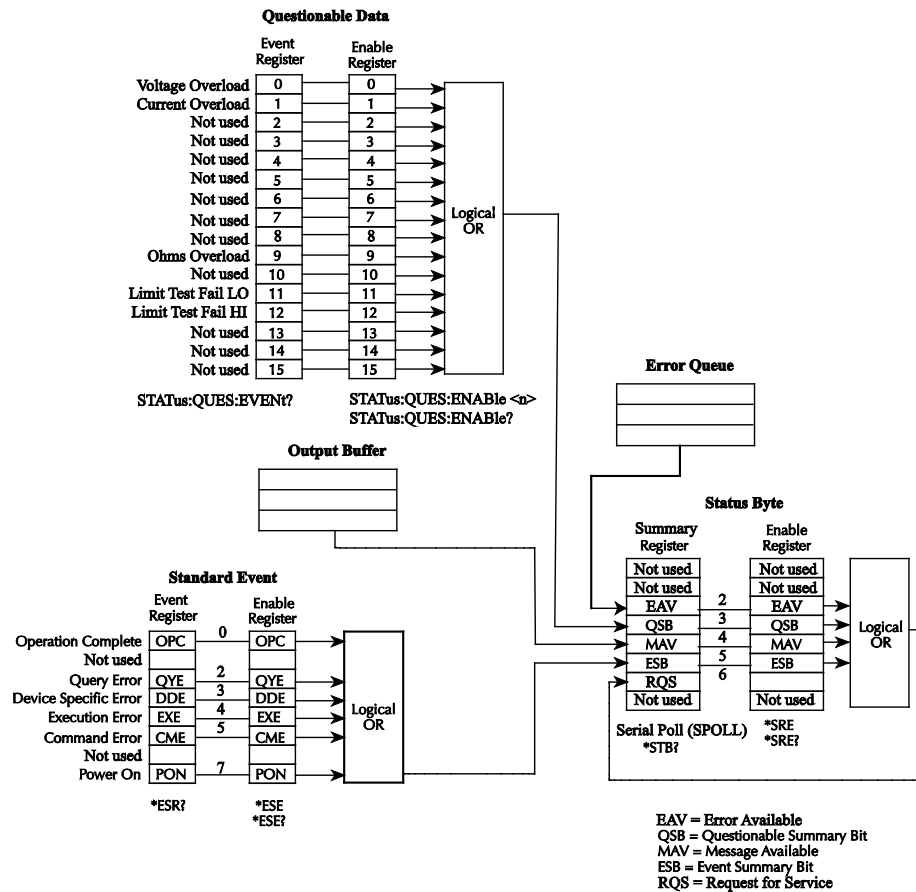

Clearing registers and queues

When the instrument is turned on, the bits of all registers in the status structure are cleared (reset to 0), and the queue and buffer are empty. Commands to reset the Event and Event Enable registers, and the Error Queue, are listed in the following table. In addition to these commands, any enable register can be reset by sending the 0 parameter value with the individual command to program the register.

Common and SCPI commands to reset registers and clear queues

Commands	Description	Ref.
To reset registers: *CLS *SRE 0 *PSC 1	Reset all bits of the following event registers to 0: Standard Event Register Questionable Data Register Reset all bits of the following enable registers to 0: Standard Event Enable Register Questionable Event Enable Register Clear enable registers: If command sent previously, turning on instrument power clears the enable registers	Note 1 Note 1
To clear error queue: *CLS	Clear all messages from Error Queue	Note 1

NOTE

1. The Standard Event Enable Register is not reset by *CLS. Send the 0 parameter value with *ESE to reset all bits of that enable register to 0 (see [Status byte and service request commands](#) (on page B-7)). When the instrument is powered on, the Standard Event Enable Register will not be cleared if users have set the instrument previously by using *PSC 0.
2. To query the Standard Event and Questionable Data Registers will clear only the separate bits in the summary register.

Programming enable registers

The only registers that can be programmed by the user are the enable registers. All other registers in the status structure are read-only registers. The following explains how to determine the parameter values for the various commands used to program enable registers. The actual commands are covered later in this section.

A command to program an event enable register is sent with a parameter value that determines the desired state (0 or 1) of each bit in the appropriate register. An enable register can be programmed using the decimal format.

The bit positions of the register indicate the binary parameter value and decimal equivalent.

Reading registers

Any register in the status structure can be read by using the appropriate query (?) command. The response message is a decimal value corresponding to a binary-weighted sum of all bits set in the register.

Status byte and service request (SRQ)

Service request is controlled by two 8-bit registers: The Status Byte Register and the Status Byte Enable Register.

Status Byte Register

The summary messages from the status registers and queues are used to set or clear the appropriate bits (B3, B4, B5, and B7) of the Status Byte Register. These summary bits do not latch, and their states (0 or 1) are solely dependent on the summary messages (0 or 1). For example, if the Standard Event Register is read, its register will clear. As a result, its summary message will reset to 0, which will then reset the ESB bit in the Status Byte Register.

The bit definitions of the Status Byte Register are described in the following table.

Status Byte Register			
Bit	Definition	Decimal value	Description
0	Not used	1	Set to 0.
1	Not used	2	Set to 0.
2	Error Available (EAV)	4	Set bit indicates that a measurement event has occurred.
3	Questionable Summary Bit (QSB)	8	One or more bits are set in the Questionable Data Register indicating that an enabled questionable event has occurred (bits have to be "enabled" in the enable register).
4	Message Available (MAV)	16	Set summary bit indicates that a response message is present in the Output Buffer.
5	Event Summary Bit (ESB)	32	One or more bits are set in the Standard Event Register, indicating that an enabled standard event has occurred (bits have to be "enabled" in the enable register).
6	Request Service (RQS)	64	Set bit indicates that an enabled summary bit of the Status Byte Register is set and the instrument requires service (Serial Poll).
7	Not used	128	Set to 0.

Using the Message Available Bit (MAV)

The Output Buffer holds response messages. Response messages are the messages sent in response to query commands. When a response message is placed in the Output Buffer, the Message Available Bit (MAV) (B4) in the Status Byte Register sets. A data message is cleared from the Output Buffer when it is read. The Output Buffer is considered cleared when it is empty. An empty Output Buffer clears the MAV bit in the Status Byte Register. A message is read from the Output Buffer by addressing the instrument to talk after the appropriate query is sent.

Use the READ? command to initiate measurements after the trigger conditions are met.

Use the INITiate command to store readings in the instrument's internal memory.

Use the FETCH? command to transfer readings to the instrument's Output Buffer.

When the instrument takes the first reading in response to a READ? command, the MAV bit is set indicating that a message is in the Output Buffer.

Service request

The generation of a service request is controlled by the Status Byte Enable Register. This register is programmed by you and is used to enable or disable the setting of bit B6 (RQS) by the Status Summary Message bits (B3, B4, B5, and B7) of the Status Byte Register. The summary bits are logically ANDed (&) with the corresponding enable bits of the Status Byte Enable Register. When a set (1) summary bit is ANDed with an enabled (1) bit of the enable register, the logic "1" output is applied to the input of the OR gate, and then sets the RQS bit in the Status Byte Register.

The individual bits of the Status Byte Enable Register can be set or cleared by using the *SRE common command. To read the Status Byte Enable Register, use the *SRE? query command. The Status Byte Enable Register clears when power is cycled or a parameter value of 0 is sent with the *SRE command (for example, *SRE 0). The commands to program and read the SRQ Enable Register are described in [Status byte and service request commands](#) (on page B-7).

NOTE

If you have set the instrument previously by using *PSC 0, the Status Byte Enable Register will not be cleared at power-on.

Status structure

Using serial polling and SRQ

Any enabled event summary bit that goes from 0 to 1 will set bit B6 and generate a SRQ (service request). In your test program, you can periodically read the Status Byte to check if an SRQ has occurred, and what caused it. If an SRQ occurs, the program can, for example, branch to an appropriate subroutine that will service the request.

Typically, SRQs are managed by the serial poll sequence of the instrument. If an SRQ does not occur, bit B6 of the Status Byte Register remains cleared, and the program proceeds normally after the serial poll is performed. If an SRQ does occur, bit B6 of the Status Byte Register will set, and the program can branch to a service subroutine when the SRQ is detected by the serial poll.

B6 stays set until all Status Byte summary bits are reset.

The serial poll automatically resets B6 of the Status Byte Register. This allows subsequent serial polls to monitor bit B6 for an SRQ occurrence generated by other event types. After a serial poll, the same event can cause another SRQ, even if the event register that caused the first SRQ has not been cleared.

The Master Summary Status Bit (MSS) is set when an enabled summary bit of the Status Byte Register is set. This bit (B6) may also be interpreted as a Request Service (RQS) bit. Depending on how it is used, Bit B6 of the Status Byte Register is either the Request for Service (RQS) bit or the Master Summary Status (MSS) bit:

- When using the serial poll sequence to obtain the status byte (serial poll byte), B6 is the RQS bit.
- When using the *STB command to read the Status Byte Register, B6 is the MSS (Message Summary Status) bit.

The serial poll, although automatically resetting the RQS bit, does not clear MSS. The MSS remains set until all Status Byte summary bits are reset.

To use an SRO:

Configure the instrument to generate an SRQ when the ESB bit is set. Use the Status Byte Enable Register (SRE) to select the low-level SRQ signal set by summary bits. When the status byte B6 is set, the instrument automatically sends the SRQ interrupt message to the bus controller, which may poll the instruments on the bus to identify which one requested service. Querying the Status Byte that is using the serial poll or querying the event register with the summary bit that caused the service request will clear the request service.

To use a serial poll:

You can send the serial poll message to read the Status Byte Summary Register. The serial poll will clear the RQS bit automatically in the Status Byte Summary Register, but no other bits will be affected.

Since synchronization between the bus controller program and the instrument is not guaranteed by the IEEE-488.2 standard, you can send the *OPC? command to make sure that commands are completed. Using a serial poll before *RST, *CLS, or other commands have completed can cause reported conditions to be reported again.

Knowing when a command sequence is finished

Use the following commands to find out when a command sequence has finished.

1. Send a DCL general bus command to clear the Output Buffer and bus controller.
2. Send a *CLS command to clear all bits in the Event Register.
3. Send a *ESE 1 command to instruct the instrument to set the ESB bit in the Status Byte when the OPC event in the ESR is set.
4. Send the *OPC command to set the Operation Complete (OPC) bit in the Standard Event Register after all pending commands have been executed.
5. Configure the instrument to generate an SRQ when the ESB bit is set.

SPE, SPD (serial polling)

The SPE, SPD General Bus Command sequence is used to serial poll the instrument. Serial polling obtains the serial poll byte (status byte). Typically, serial polling is used by the controller to determine which of several instruments has requested service with the SRQ line.

Read the Status Byte by using *STB?

Reading the status byte with the *STB? command is similar to a IEEE-488 serial poll. However, the *STB? command:

- Does not clear the RQS bit (B6) in the Status Byte Register.
- Is processed like an ordinary command and completes only after previous commands have completed making it impossible to poll.

Status byte and service request commands

The commands to program and read the Status Byte Register and Status Byte Enable Register are listed in the following table. For details on programming and reading registers, see Programming enable registers.

NOTE

To reset the bits of the Status Byte Enable Register to 0, use 0 as the parameter value for the *SRE command (for example, *SRE 0).

*CLS and STATus:PRESet commands have no effect on the Status Byte Enable Register.

Status Byte and Status Byte Enable Register commands	
Command	Description
*SRE 0	Read the Status Byte Register.
*SRE <NRf>	Program the Status Byte Enable Register: <NRf> = 0 to 255 decimal format.
*SRE?	Read the Status Byte Enable Register.

Status register sets

There are two status register sets in the status structure of the instrument: Standard Event Status and Questionable Event Status.

Standard Event Register

The bit definition of the Standard Event Register is shown in the following table.

You will have to use the *ESE command and the appropriate decimal value for each bit to set the enable register mask.

For example, enable “operation complete” by using the *ESE 1 command.

NOTE

All errors in the error queue are recorded as an error condition (including bits 2, 3, 4, or 5 of the Standard Event Register). The only exception is if you read the error queue using the SYSTem:ERRor? command.

NOTE

All reading overload conditions are reported to the Standard Event Register bit 3 from the Questionable Data Event Register bits 0, 1, or 9. However, no reading overload conditions are reported to the instrument's Error Queue.

Standard Event Register			
Bit	Definition	Decimal value	Description
0	Operation Complete	1	Set bit indicates that all pending selected device operations are completed and the instrument is ready to accept new commands. This bit only sets in response to the *OPC? query command. See *OPC — operation complete command (on page 5-7) and *OPC? — operation complete query (on page 5-7) for details.
1	Not used.	2	Set to 0.
2	Query Error (QYE)	4	Set bit indicates that you attempted to read data from an empty Output Buffer; a new command line was received before a previous query was read; or both the input and Output Buffers are full.
3	Device-Dependent Error (DDE)	8	Set bit indicates that an instrument operation did not execute properly due to some internal condition.
4	Execution Error (EXE)	16	Set bit indicates that the instrument detected an error while trying to execute a command.
5	Command Error (CME)	32	Set bit indicates that a command error has occurred. Command errors include: <ul style="list-style-type: none"> IEEE-488.2 syntax error — instrument received a message that does not follow the defined syntax of the IEEE-488.2 standard. Semantic error — instrument received a command that was misspelled or received an optional IEEE-488.2 command that is not implemented. The instrument received a Group Execute Trigger (GET) inside a program message.
6	Not used.	64	Set to 0.
7	Power ON (PON)	128	Set bit indicates that the instrument has been turned off and turned back on since the last time this register has been turned off.

Monitor the contents of the Output Buffer by using *OPC

The *OPC command causes the instrument to set the Operation Complete Bit (OPC) (B6) after all pending operations are complete.

The *OPC? operation complete query places an ASCII "1" in Output Buffer after all pending instrument operations are complete.

Typically, either one of these commands is sent after the INITiate command. The INITiate command is used to take the instrument out of idle in order to perform measurements.

- After the instrument completes all programmed commands, the instrument returns to the idle state. Then the instrument completes all pending commands including:
- *OPC command. Completing this command sets the OPC bit
- *OPC? command. Completing this command places an ASCII "1" in Output Buffer

If there are too many messages in the Output Buffer before the *OPC command is sent, the buffer cannot accept any additional messages and the instrument will stop taking readings.

Questionable Data Register

The Questionable Data Register indicates when measurements result in any of the following conditions by setting the appropriate bit:

- Voltage range overload
- Current range overload
- Out-of-limit conditions
- Ohms overload

All of the set bits are summarized to the Questionable Summary Bit (QSB) (B3). A set summary bit indicates that an enabled questionable event has occurred.

The bits of the Questionable Data Register are described in the following table. Use the STATus:QUESTionable:ENABle command to set the contents of the Event Enable Registers.

Questionable Data Register			
Bit	Definition	Decimal value	Description
0	Voltage overload	1	Range overload on DC or AC volts, frequency, period, diode or ratio function.
1	Current overload	2	Range overload on DC or AC current function.
2	Not used	4	Set to 0.
3	Not used	8	Set to 0.
4	Not used	16	Set to 0.
5	Not used	32	Set to 0.
6	Not used	64	Set to 0.
7	Not used	128	Set to 0.
8	Not used	256	Set to 0.
9	Ohms overload	512	Range overload on 2 or 4-wire ohm function.
10	Not used	1024	Set to 0.
11	Limit Failed at LO	2048	Reading is less than the lower limit under limit test.
12	Limit Failed at HI	4096	Reading is more than upper limit under limit test.
13	Not used	8192	Set to 0.
14	Not used	16384	Set to 0.
15	Not used	32768	Set to 0.

Status reporting command summary

Refer to Status subsystem for information about status commands.

Communication interface

In this appendix:

Communication interfaces C-1

Communication interfaces

This section shows you how to connect instruments to the following communication interfaces:

- Universal serial bus (USB)
- General purpose interface bus (GPIB or IEEE-488)

It describes how to configure and troubleshoot these interfaces on computers with Microsoft® Windows® 2000, Windows XP®, Windows Vista®, and Windows 7® operating systems.

It also describes the I/O software, drivers, and application software that can be used with Keithley's instruments.

Selecting an interface

The Keithley Instruments Model 2110 supports the following remote interfaces:

- GPIB (general purpose interface bus)
- USB

The Model 2110 can only be controlled from one remote interface at a time. The first interface that receives a message takes control of the instrument. It will ignore the other interfaces until the instrument is taken back to local operation.

USB communications

To use the rear-panel USB connection, you must have the Virtual Instrument Software Architecture (VISA) layer on the host computer. See [How to install the Keithley I/O Layer](#) (on page C-16) for more information.

VISA contains a USB class driver for the USB Test and Measurement Class (USBTMC) protocol which, once installed, allows the Microsoft® Windows® operating system to recognize the instrument.

When a USB device that implements the USBTMC or USBTMC-USB488 protocol is plugged into the computer, the VISA driver automatically detects the device. It is important to note that only USBTMC and USBTMC-USB488 devices are automatically recognized by the VISA driver. Other USB devices, such as printers, scanners, and storage devices, are not recognized.

In this section, "USB instruments" refers to devices that implement the USBTMC or USBTMC-USB488 protocol.

NOTE

The full version of National Instruments (NI[®]) VISA provides a utility to create a USB driver for any other kind of USB device that you want to communicate with VISA. For more information, see the [NI VISA website http://www.ni.com](http://www.ni.com).

Communicate with the instrument

To communicate with the USB device, you need to use NI-VISA[™]. VISA requires a resource string in the following format to connect to the correct USB instrument:

```
USB[board]::manufacturer ID::model code::serial number[::USB interface number][::INSTR]
```


This requires that you determine the parameters. You can gather this information by running a utility that automatically detects all instruments connected to the computer.

If you installed the Keithley I/O Layer, the Keithley Configuration Panel is available from the Microsoft[®] Windows[®] Start menu in the Keithley Instruments menu.

To use the Keithley Configuration Panel to determine the VISA resource string:


1. Start the Keithley Configuration Panel. The Select Operation dialog box is displayed.
2. Select **Add**.

Figure 38: Select Operation dialog box

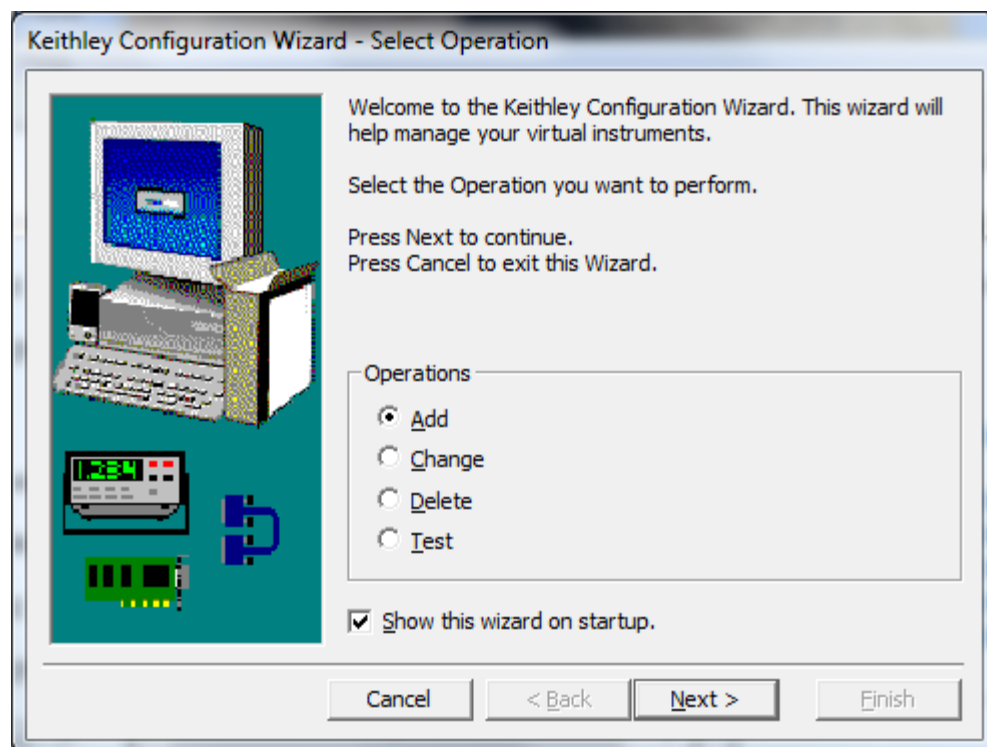


3. Click **Next**. The Select Communication Bus dialog box is displayed.

Figure 39: Select Communication Bus dialog box

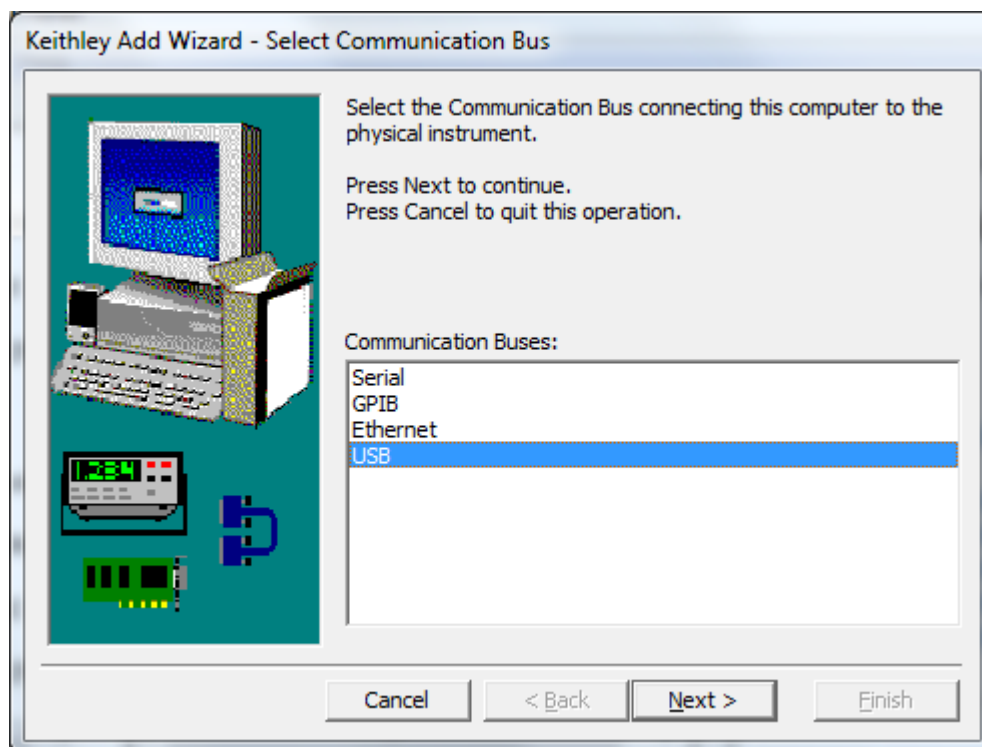


4. Select **USB**.
5. Click **Next**. The Select Instrument Driver dialog box is displayed.

Figure 40: Select Instrument Driver dialog box

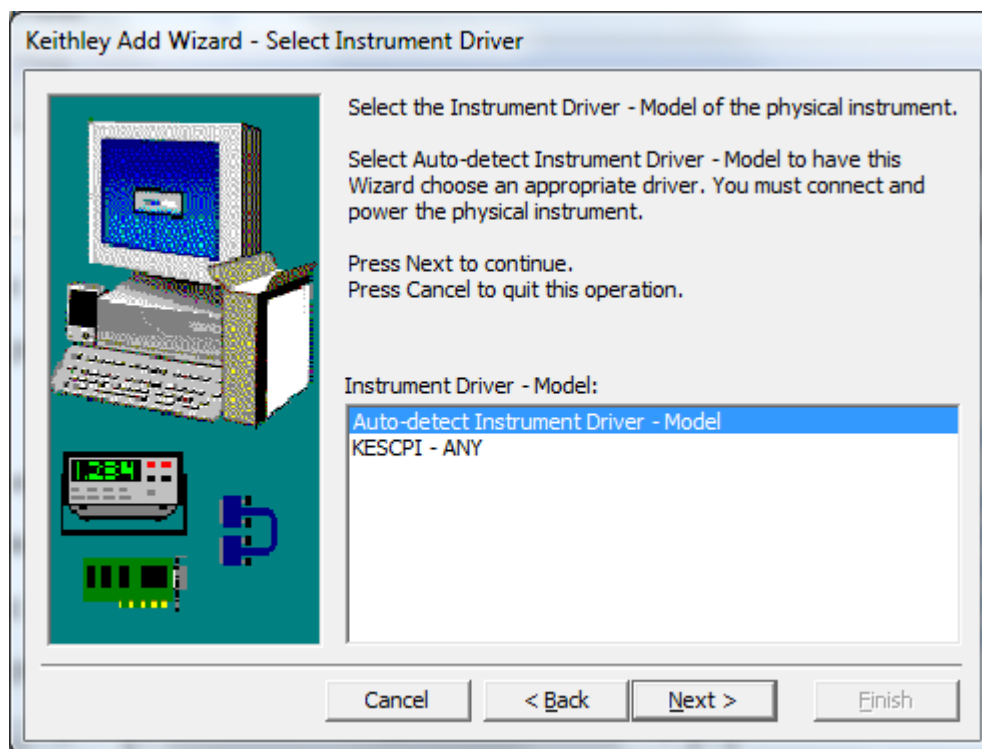


6. Select **Auto-detect Instrument Driver - Model**.
7. Click **Next**. The Configure USB Instrument dialog box is displayed with the detected instrument VISA resource string displayed.
8. Click **Next**. The Name Virtual Instrument dialog box is displayed.

Figure 41: Name Virtual Instrument dialog box

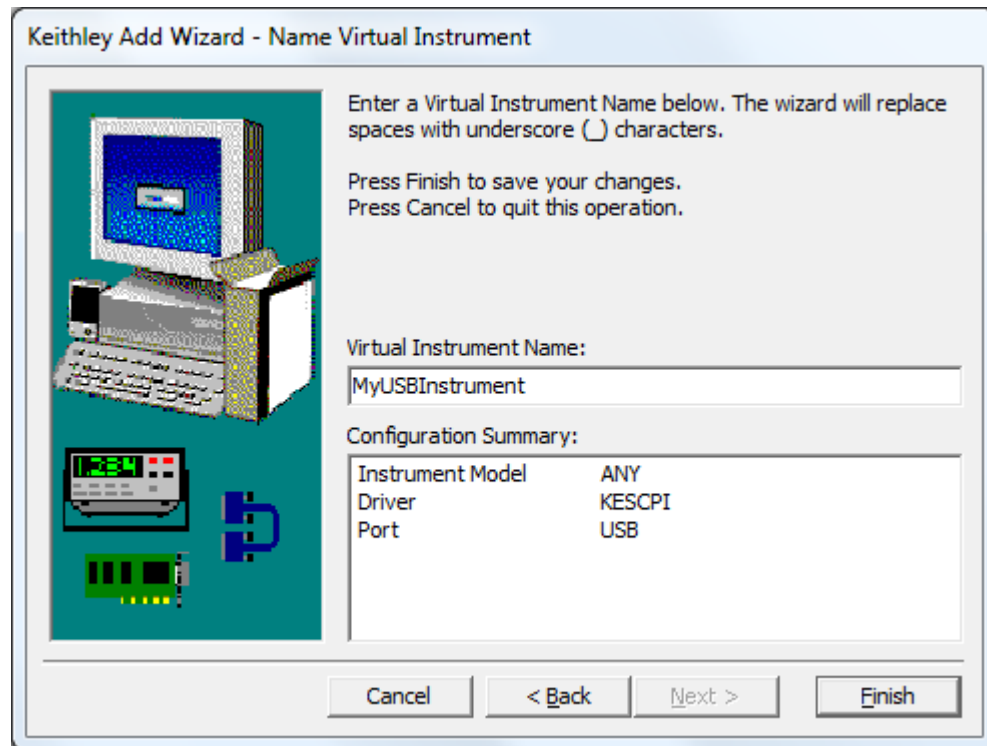

9. In the Virtual Instrument Name box, enter a name that you want to use to refer to the instrument.
10. Click **Finish**.
11. Click **Cancel** to close the Wizard.
12. Save the configuration. From the Configuration Utility, select **File > Save**.
13. In the Keithley Communicator, select **File > Open Instrument** to open the instrument you just named.

Figure 42: Keithley Communicator Open Instrument

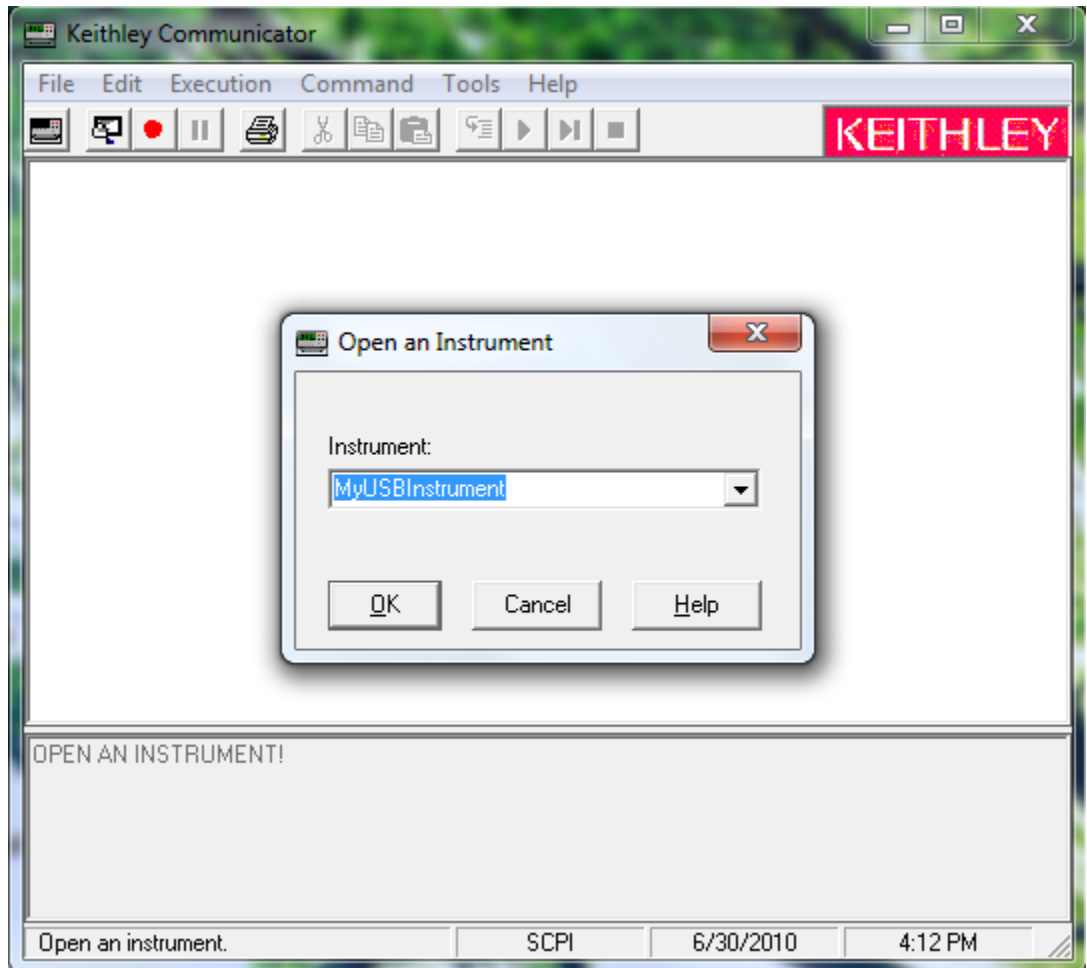

14. Click **OK**.
15. Send a command to the instrument and see if it responds.

NOTE

If you have a full version of NI VISA on your system, you can run NI-MAX or the VISA Interactive Utility. See their documentation for information.


If you have the Agilent IO Libraries on your system, you can run Agilent Connection Expert to check out your USB instruments. See their documentation for information.

Pass/fail output from USB connector

The USB connector on the instruments rear panel is a series B connector. When the USB interface is disabled (IEEE-488 interface is selected), the internal pass and fail TTL output signals (limit testing) will be transmitted via the USB port.

The pass and fail signals are low true and indicate the Math Pass/Fail Limit Test result for the next reading to be output to the GPIB interface. The signals are active low for approximately 2ms (± 100 μ sec) for each reading taken. The following figure shows the USB connector (series B).

Figure 43: USB connector

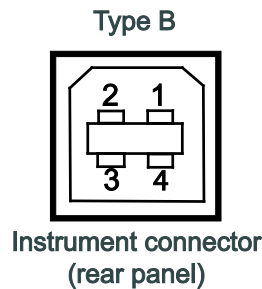

Contact number	Signal name	Typical wiring assignment	Description
1	VBUS	Red	Floating
2	D-	White	Limit Test Pass
3	D+	Green	Limit Test Fail
5	GND	Black	GND

NOTE

If you turn off the USB interface, the Pass/Fail output function will turn on automatically.
 If you want to use the Pass/Fail signal output, you must use the GPIB interface for remote control.
 Disconnect the USB cable from your instrument while using the Pass/Fail signal output.

To turn on and off the pass/fail output:

1. Press the **SHIFT** key, and then press the **CONFIG** key.
2. Use the **▶** and **◀** keys to select **INTERFACE**.
3. Press **ENTER**.
4. Use the **▶** and **◀** keys to:
 - Select **GPIB** to turn on the output.
 - Select **USB** to turn off the output.
5. Press **ENTER**.

Additional USB information

This section provides further details and more advanced information about the USB bus and test and measurement instruments.

Connecting multiple USB instruments to the computer

The most convenient way to connect USB instrumentation to the computer is to plug a USB cable directly from the instrument to the computer. If you have more than one USB instrument or have other USB devices, such as printers, keyboards, and mice, you might not have enough USB connectors on the computer.

To gain more ports, you can use a USB hub or add more USB controller cards if you have available PCI or PCI Express slots.

There are two types of USB hubs that you can use with Model 2110:

- **Bus powered:** This type of hub draws its power from the USB bus and can only supply 100 mA (USB 2.0) per port.
- **Self powered:** This type of hub has an external power supply and can supply up to 500 mA per port (USB 2.0).

GPIB setup

This section contains information about GPIB standards, connections, and address selection.

NOTE

The GPIB connector is optional and may not be present on your instrument.

GPIB standards

The GPIB is the IEEE-488 instrumentation data bus, which uses hardware and programming standards originally adopted by the Institute of Electrical and Electronic Engineers (IEEE) in 1975. The instrument is IEEE Std 488.1 compliant and supports IEEE Std 488.2 common commands and status model topology.

Install the GPIB cards in your computer

Refer to the manufacturer's documentation for information about installing the GPIB cards.

Install the GPIB driver software

Check the documentation for your GPIB controller for information about where to acquire drivers. Keithley Instruments also recommends that you check the vendor's website for the latest version of drivers or software.

It is important that you install the drivers before you connect the hardware to prevent associating the incorrect driver to the hardware.

Communicate with instruments

The GPIB driver software you installed installs an interactive dumb terminal program that allows you to send commands to the instrument. The program directly calls the GPIB driver support libraries.

For the KPCI-488LPA and KUSB-488B GPIB controller from Keithley Instruments, the configuration utility is called the KI-488 Diagnostic Tool. It is available from the Windows Start menu at **Keithley Instruments > KI-488 > KI-488 Diagnostic Tool**. After installing the Keithley I/O layer.

For the KUSB-488A GPIB controller from Keithley Instruments, the configuration utility is called TrTest. It is available from the Microsoft® Windows® Start Menu at **Keithley Instruments > GPIB-488-CEC > TrTest**.

For National Instruments (NI™) GPIB controllers, you can use NI-MAX. Start NI-MAX. If your hardware is installed correctly, you will see the controller in the GPIB section of the tree control on the left side. Select it and right-click to see an option to communicate with the instrument.

NOTE

If you want to use the GPIB controller with an instrument driver (such as VXIPnP or IVI) or high-level software, you must also install I/O software, which installs the VISA layer. See [How to install the Keithley I/O Layer](#) (on page C-16).

Terminator

When receiving data over the GPIB, the instrument terminates on any line feed character or any data byte with EOI asserted (line feed with EOI asserted is also valid). When sending data through the GPIB drivers, it is not necessary to append a line feed character to all outgoing messages. The EOI line is asserted with the last character sent.

However, if you want your program to communicate with all I/O buses on the instrument (GPIB and USB), it is good practice to add a line feed to the end of the outgoing command. Use VISA, and the same program will work with all the I/O buses by just changing the resource string in the VISA Open method.

Front-panel GPIB operation

This section describes aspects of the front panel that are part of GPIB operation, including messages, status indicators, and the LOCAL key.

Error and status messages

The front-panel display may show error and status messages.

Local key

The SHIFT (LOCAL) key cancels the remote state and restores local operation of the instrument.

GPIB reference

General bus commands

General commands are commands that have the same general meaning, regardless of the instrument (for example, DCL). The following table lists the general bus commands.

General bus commands

Command	Effect on Model 2110
REN	Goes into remote operation when next addressed to listen. See REN (on page C-10) for details.
IFC	Goes into talker and listener idle states. See IFC (on page C-10) for details.
LLO	LOCAL key locked out. See LLO (on page C-10) for details.
GTL	Cancel remote; restore Model 2110 front-panel operation. See GTL (on page C-10) for details.
DCL	Returns the Model 2110 and all devices on the GPIB to known conditions. See DCL (on page C-11) for details.
SDC	Returns the Model 2110 to known conditions. See SDC for details.
GET	Initiates a trigger. See GET (on page C-11) for details.
SPE, SPD	Serial polls the Model 2110. See SPE, SPD (on page C-11) for details.

REN

The remote enable (REN) command is sent to the Model 2110 by the controller to set up the instrument for remote operation. Generally, the instrument should be placed in the remote mode before you attempt to program it over the bus. Setting REN true does not place the instrument in the remote state. You must address the instrument to listen after setting REN true before it goes into remote operation.

IFC

The interface clear (IFC) command is sent by the controller to place the Model 2110 in the talker idle state and the listener idle state. The instrument responds to the IFC command by canceling front-panel TALK or LSTN lights, if the instrument was previously placed in one of these states.

Transfer of command messages to the instrument and transfer of response messages from the instrument are not interrupted by IFC. If transfer of a response message from the instrument was suspended by IFC, transfer of the message will resume when the instrument is addressed to talk. If transfer of a command message to the instrument was suspended by IFC, the rest of the message can be sent when the instrument is addressed to listen.

LLO

When the instrument is in remote operation, all front-panel controls are disabled, except the LOCAL and OUTPUT OFF keys (and the POWER switch). The local lockout (LLO) command disables the LOCAL control, but does not affect the OUTPUT OFF control, which cannot be disabled.

GTL

Use the go to local (GTL) command to put a remote-mode instrument into local mode. Leaving the remote state also restores operation of all front-panel controls.

DCL

Use the device clear (DCL) command to clear the GPIB interface and return it to a known state. Note that the DCL command is not an addressed command, so all instruments equipped to implement DCL will do so simultaneously.

When the Model 2110 receives a DCL command, it:

- Clears the input buffer, output queue, and command queue
- Cancels deferred commands
- Clears any command that prevents the processing of any other device command

A DCL does not affect instrument settings and stored data.

SDC

The selective device clear (SDC) command is an addressed command that performs essentially the same function as the device clear (DCL) command. However, because each device must be individually addressed, the SDC command provides a method to clear only selected instruments, instead of clearing all instruments simultaneously with the DCL command.

When the Model 2110 receives an SDC command, it clears the input buffer and output queue, cancels deferred commands, and clears any command that prevents the processing of any other device command. An SDC command does not affect instrument settings and stored data.

GET

The group execute trigger (GET) command is a GPIB trigger that triggers the instrument to take readings from a remote interface.

SPE, SPD

Use the serial polling sequence to obtain the Model 2110 serial poll byte. The serial poll byte contains important information about internal functions (see [Status model](#) (on page B-1)). Generally, the serial polling sequence is used by the controller to determine which of several instruments has requested service with the SRQ line. The serial polling sequence may be performed at any time to obtain the status byte from the Model 2110.

GPIB status indicators

The ADR status indicator shows that the instrument is controlled via the GPIB Interface.

Configure the GPIB controllers

Each instrument on a GPIB bus needs a unique address from a range of 0 to 30. Generally, the GPIB host controller is on address 0. However, there are GPIB controllers that adopt the address of 21. To be safe, do not configure any of the instruments for 21 or 0.

If you do need to change the host controller address, consult the controller documentation.

For the KPCI-488LPA and KUSB-488B GPIB controller from Keithley Instruments, the configuration utility is called the KI-488 Diagnostic Tool. It is available from the Microsoft® Windows® Start menu at **Keithley Instruments > KI-488 > KI-488 Diagnostic Tool**.

For the KUSB-488A GPIB controller from Keithley Instruments, the configuration utility is called GPIB Configuration. It is available from the Windows Start Menu at **Keithley Instruments > GPIB-488 > GPIB Configuration**.

For National Instruments (NI™) GPIB controllers, you can use NI-MAX. Start NI-MAX. If your hardware is installed correctly, you will see the controller in the GPIB section of the tree control on the left side. Select it and right-click to see an option to configure the controller. Do not forget to save your settings.

Supplied software

The majority of software applications and all instrument drivers from Keithley Instruments depend on some, or all, of the following software components:

- NI-VISA™
- VISA shared components
- IVI shared components
- NI™ CVI™ runtime engine
- NI™ IVI™ compliance package
- Keithley instrument driver

These software components are included on the CD-ROMs that came with your instrument, and are also available for download at the [Keithley Instruments support website](http://www.keithley.com/support) (<http://www.keithley.com/support>).

Instrument driver types

There are several different styles of instrument drivers. Keithley Instruments provides three different instrument drivers for the Model 2110: A native LabVIEW™ driver, an IVI-C driver, and an IVI-COM driver. You need to pick the style that best suits the application development environment (ADE) that you are using. For example, if you are using LabVIEW, you would pick a native LabVIEW driver. If a native LabVIEW driver is not available, then you can use an IVI-C driver, because LabVIEW has the option of creating a wrapper for the IVI-C driver. LabVIEW supports IVI-COM drivers, but they are definitely not the first or second choice. However, if it is the only driver type for the instrument, it can be used.

If LabWindows/CVI or C/C++ is your programming language, an IVI-C driver is the best option. For Microsoft® Visual Basic® 6.0 and any .NET language (C#, VB.NET, and so on), an IVI-COM driver is the best option.

Sometimes instrument vendors do not provide all three driver types. Most languages can accommodate other driver types, but this is not optimal.

The following sections describe the different driver types in more detail.

VXIPnP drivers

VXI (Vixie) plug-and-play (VXIPnP) style drivers are Win32 DLLs that have some standard functions defined by the VXIPnP Alliance, such as:

- init
- close
- error_message
- reset
- self_test
- Read
- Initiate
- Fetch
- Abort

The application programming interface (API) was defined so that users of instruments would have a familiar API from instrument to instrument. There are some basic guidelines when creating APIs for your instrument, such as using VISA data types and how to construct the CVI hierarchy. There are many VXIPnP drivers available for Agilent, Fluke, and Tektronix instruments.

LabVIEW drivers

Native LabVIEW drivers

A native LabVIEW™ driver is a LabVIEW driver that is created using entirely built-in LabVIEW VIs — it does not make any calls to external DLLs or Library files. This makes the driver portable to all the platforms and operating systems that LabVIEW and VISA supports (currently, Linux® on x86, Mac OS® X, and Microsoft® Windows®).

National Instruments (NI™) maintains a native [LabVIEW driver style guide](http://zone.ni.com/devzone/cda/tut/p/id/3271) (<http://zone.ni.com/devzone/cda/tut/p/id/3271>).

LabVIEW driver wrappers

All IVI-C drivers have a function panel file (.fp) that shows a hierarchy of the function calls into a DLL. It is a tool that guides a user to select the correct function call in the driver, since a DLL only has a flat API entry point scheme (unlike COM or .NET). Any CVI-generated .fp file can be imported into LabVIEW and LabVIEW will generate a wrapper for the DLL. The drawback here is that the driver is dependent on the DLL, which is not portable and is therefore Windows-specific.

Obtaining instrument drivers

To see what drivers are available for your instrument:

1. Go to the [Keithley Instruments support website](http://www.keithley.com/support) (<http://www.keithley.com/support>).
2. Enter the model number of your instrument.
3. Select Software Driver from the list.

For LabVIEW™, you can also go to National Instrument's website and search their instrument driver database.

Instrument driver examples

All Keithley drivers come with examples written in several programming languages that show you how to do the most common things with the instruments.

Install the driver. The examples are in the Microsoft® Windows® Start menu, under **Keithley Instruments > Model Number** (where Model Number is the instrument model number).

IVI shared components

The IVI shared components are a similar concept to the VISA shared components. The IVI Foundation provides class drivers for:

- All the supported instruments (DMM, Scope, Fgen, and so on)
- The configuration store

The IVI shared components also create the installation folders and registry keys that all IVI drivers and support files use for installation.

Interchangeable Virtual Instruments (IVI) style drivers

The major problem with VXIPnP drivers was that the API was not specific to the instrument. For something as standard as measuring DC volts on a digital multimeter (DMM), it would be a good idea if there were a set of standard functions to do this.

The [IVI Foundation](http://www.ivifoundation.org) (<http://www.ivifoundation.org>) defined a set of application programming interfaces (APIs) for the following instruments: DMM, function generator, DC power supply, scope, switch, spectrum analyzer, RF signal generator and power meter. They are currently working on class APIs for some other instrument types.

There are two types of IVI drivers: IVI-COM drivers use Microsoft® COM technology to expose driver functionality, while IVI-C drivers use conventional Microsoft® Windows® DLLs to export simple C-based functions.

For more information about IVI drivers and the differences between the COM, C, and .NET interfaces, see [Making the Case for IVI](http://pacificmindworks.com/docs/Making%20the%20Case%20for%20IVI.pdf) (<http://pacificmindworks.com/docs/Making%20the%20Case%20for%20IVI.pdf>).

NI CVI runtime engine

IVI-C drivers that are created using National Instruments (NI™) LabWindows/CVI environment depend on either the CVI runtime (cvirte.dll), or the instrument support run-time (instrsup.dll), and must be present on the system for them to run.

NI IVI Compliance Package

The National Instruments (NI™) IVI Compliance Package is a software package that contains IVI class drivers and support libraries that are needed for the development and use of applications that leverage IVI instrument interchangeability. The IVI Compliance Package also is based on and is compliant with the latest version of the instrument programming specifications defined by the IVI Foundation.

The NI ICP installer installs the IVI shared components, CVI runtime engine, and the instrument support runtime engine.

Keithley I/O layer

The Keithley I/O Layer (KIOL) is a software package that contains several utilities and drivers. It is mainly used as a supplement to IVI drivers, or application software like Test Script Builder (TSB).

The KIOL contains:

- NI-VISA™ Runtime-Time Engine
- Keithley Configuration Panel
- Keithley Communicator

NI-VISA Runtime

NI-VISA™ is National Instruments (NI™) implementation of the VISA standard. There are two versions: a full version and a run-time version. The Keithley I/O Layer (KIOL) contains a licensed version of the NI-VISA Run-Time Engine that contains only the binary files (DLLs) that allow the NI-VISA drivers to operate.

If you already have NI software (such as LabVIEW™ or LabWindows™) installed, you have a valid license that can be used with Keithley drivers and application software.

If you do not have NI software installed, you must install the KIOL to install the the drivers.

Keithley Configuration Panel

The Keithley Configuration Panel is a configuration utility for IVI drivers, similar to NI-MAX. It also has the ability to autodetect USBTMC instruments and LAN instruments that support the VXI-11 protocol.

Keithley Communicator

The Keithley Communicator is a dumb terminal program that uses VISA to communicate with the instrument.

Computer requirements for the Keithley I/O Layer

The Keithley I/O Layer version C02 supports the following operating systems:

- Microsoft® Windows® 7 (32-bit only)
- Microsoft Windows Vista® (SP1)
- Microsoft Windows XP (SP2)
- Microsoft Windows 2000 (SP4)

Note that Microsoft Windows 95, Windows ME, Windows 98, and Windows NT are not supported.

How to uninstall previous versions of the Keithley I/O Layer

If you have an earlier version of the Keithley I/O Layer software installed on your computer, you must uninstall it.

To uninstall the Keithley I/O layer:

1. From the Control Panel, select **Add/Remove Programs**.

2. Uninstall the following components:
 - Keithley I/O Layer
 - Keithley I/O Layer Suite
 - Keithley SCPI-based Instrument IVI-C Driver
 - NI-VISA Run-Time Engine x.x.x (if present) (x.x.x is the VISA version)
3. Reboot your computer.

How to install the Keithley I/O Layer

NOTE

Before installing, it is a good idea to check the [Keithley Instruments website](http://www.keithley.com) (<http://www.keithley.com>) to see if a later version of the Keithley I/O Layer is available. On the website, select the **Support** tab, under **model number**, type KIOL, and select **Software Driver**.

You can install the Keithley I/O Layer from the CD-ROM that came with your instrument, or from the download from the Keithley website.

The software installs the following components:

- Microsoft® .NET Framework 2.0
- NI™ IVI Compliance Package 3.3
- NI-VISA™ Run-Time Engine 4.5.0
- Keithley SCPI-based Instrument IVI-C driver SCPI-856C02
- Keithley I/O Layer KIOL-850C02

To install the Keithley I/O Layer from the CD-ROM:

1. Close all programs.
2. Place the CD-ROM into your CD-ROM drive.
3. Your web browser should start automatically and display a screen with software installation links. If you need to manually open the web page, use a file explorer to navigate to the CD-ROM drive and open the file named `index.html`.
4. From the web page, select the **Software** category and click Keithley I/O Layer.
5. Accept all defaults.
6. Click **Next**.
7. Click **Install**.
8. Reboot your computer.

To install the Keithley I/O Layer from the Keithley website:

1. Download the Keithley I/O Layer Software from the [Keithley Instruments website](http://www.keithley.com) (<http://www.keithley.com>) as described in the note. The software is a single compressed file and should be downloaded to a temporary directory.
2. Run the downloaded file from the temporary directory.
3. Follow the instructions on the screen to install the software.
4. Reboot your computer.

Special installation considerations

Situations may occur during installation that cannot be handled automatically by the installation utility. The installation utility will warn you if one of these situations is detected. The sections below describe the action you must take before the installation can be completed.

Mismatch between IVI Shared Components and IVI Engine Detected

The IVI Shared Components and IVI Engine are software components that may be installed by various test and measurement software applications, instrument drivers, and so on. Keithley I/O Layer software requires that these components, if present, be compatible versions. The installation utility will detect a mismatch, which must be corrected before the software installation can proceed. If this situation is detected, the Keithley I/O Layer software installation will automatically stop.

The recommended way to resolve this situation is to install the IVI Compliance Package (ICP) software from National Instruments (NI™). You may download the ICP software and release notes from National Instrument's website. When the ICP installation is complete, restart the Keithley I/O Layer software installation.

Non-National Instruments VISA detected

VISA software is used to communicate with the instrument and may be installed by various test and measurement software applications, instrument drivers, and so on. Keithley I/O Layer software requires and will install National Instruments NI-VISA™ software. The installer will detect if another vendor's version of VISA is already installed on the computer. If this occurs, the installer will pause and display a warning message. The warning message displays the vendor of the detected VISA in its title bar, if this can be determined. Make a note of the vendor name. At this point, you may elect to continue the installation, which will overwrite the existing VISA installation with NI-VISA. This will allow the Keithley I/O Layer software to operate properly, but may cause other applications or instrument drivers that were dependent on the existing VISA to malfunction.

The recommended way to resolve this situation is to perform the following steps:

1. Exit the Keithley I/O Layer software when the warning message is displayed. Make note of the VISA vendor in the warning message (if any).
2. Uninstall the non-NI VISA software.
3. Uninstall Tektronix VISA by selecting OpenChoice TekVISA from the Control Panel Add/Remove programs list.
4. Uninstall Agilent VISA by selecting Agilent I/O Libraries Suite from the Control Panel Add/Remove programs wizard list.
5. Uninstall other versions of VISA by selecting the appropriate entry from the Control Panel Add/Remove Programs Wizard list.
6. Restart the Keithley I/O Layer software installation.
7. If the pre-existing version of VISA was supplied by Tektronix or Agilent (as displayed in the warning message), you may safely reinstall that version of VISA once Keithley I/O Layer software installation is complete. When you reinstall Tektronix or Agilent VISA, it may prompt you to preserve the current VISA version, which you should do. This will usually restore the operation of any dependent applications or drivers.
8. If the pre-existing version of VISA was supplied by a vendor other than Tektronix or Agilent, we recommend that you do not reinstall it, because this will likely cause the Keithley I/O Layer software to malfunction.

Installation troubleshooting

If problems occur during installation, it might be helpful to install the components individually. Error messages might appear that will help you resolve the installation issue.

If problems occur during installation:

1. Follow the instructions to uninstall all the KIO Layer components in [Special installation considerations](#) (on page C-16).
2. Rerun the KIO Layer installer. Note where the installer unpacks the files (usually in a temporary folder).
3. Cancel the installer.
4. Go to the folder where the files were unzipped.
5. Run the setup.exe for each of the following components in the following order:
 - IVP Compliance Package (ICP)
 - NI-VISA™ Run-Time Engine
 - KIO Layer
 - Keithley SCPI Driver
6. Ignore all the other folders.
7. Reboot the computer.

Modifying, repairing, or removing Keithley I/O Layer software

The Keithley I/O Layer interconnects many other installers.

To remove all the KIO Layer components, you need to uninstall the following applications using Control Panel Add/Remove programs:

- National Instruments NI™ IVP Compliance Package
- National Instruments NI-VISA™ Run-Time Engine
- IVP Shared Components
- Visa Shared Components
- Keithley SCPI Driver

After uninstalling components, reboot the computer.

Addressing instruments with VISA

VISA allows you to communicate with the instrument on different communication buses by changing a resource string that gets passed in with the viOpen function, in VISA-C, or with the Open method on the VISA-COM resource manager object.

For detailed information about the format of the resource string, refer to the VISA specification VPP4.3 at the IVP Foundation website, or refer to the help file provided by the vendor of the VISA implementation you are using.

The following sections describe the resource strings for some of the communication types that Keithley supports. Any field that has [] (square brackets) around it is optional and will revert to a default value.

Addressing instruments using USB

```
USB[board]::manufacturer ID::model code::serial number::USB interface number[::INSTR]
```

board is not used (0).

manufacturer ID is the USB.org reserved four-digit hexadecimal code for the instrument vendor company. Keithley Instruments hexadecimal code is 05E6.

model code is the model number of the instrument. For example, when addressing a Model 707B, use 707B.

serial number is the serial number of the instrument.

USB interface number identifies which USBTMC interface on the instrument to address (usually 0).

NOTE

Also see USB VISA identifiers.

Addressing instruments through GPIB

There are two different resource classes in VISA for the GPIB bus.

INSTR is the basic class that everyone uses. It allows application software to send and receive data and commands without dealing with some low level GPIB nuances. This class is recommended for typical GPIB communication.

The **INTFC** class allows finer control over the GPIB controller card in the computer. You must comply with the IEEE-488.1 protocol and tell the instrument to listen and the controller to talk before sending a message to the instrument. This class allows you to communicate to the instrument using low-level GPIB commands. Refer to your VISA documentation for more details on how to use this class.

The GPIB INSTR resource class format is:

```
GPIB[board]::primary address[::secondary address][::INSTR]
```

board is the number of the GPIB card, if there are more than one in the computer. If there is only one GPIB card, don not include *board*, but do not leave a space.

primary address is the main GPIB address of the instrument, which can be changed, if necessary, through the front panel of the instrument.

secondary address is for secondary addressing in GPIB. Some instruments have subinstruments or cards inside the main instrument or backplane. The primary address identifies the main instrument. The secondary address identifies subinstruments. Refer to the instrument user manual for the secondary address, if applicable.

Sending raw commands to an instrument

The next sections show you how to use VISA-C and VISA-COM to send raw instrument commands without using the instrument drivers.

VISA-C sample code

The following is a simple C/C++ console application that reads back the instrument identification string using VISA-C. You need to include visa.h and link with the visa32.lib file.

```
#include "stdafx.h"
#include <visa.h>

#define checkErr(fCall)      if (error = (fCall), (error = (error <
    0) ? error : VI_SUCCESS)) \
                            {goto Error;} else error = error

int _tmain(int argc, _TCHAR* argv[])
{
    ViSession defaultRM, vi;
    char buf [256] = {0};
    ViStatus  error = VI_SUCCESS;

    /* Open session to GPIB device at address 22 */
    checkErr(viOpenDefaultRM(&defaultRM));
    checkErr(viOpen(defaultRM, "GPIB0::14::INSTR", VI_NULL,VI_NULL, &vi));

    /* Initialize device */
    checkErr(viPrintf(vi, "*RST\n"));

    /* Send an *IDN? string to the device */
    checkErr(viPrintf(vi, "*IDN?\n"));
    ViUInt16 status = 0;
    do
    {
        checkErr(viReadSTB(vi, &status));
        printf("ReadSTB = %X\n", status);
    } while(status == 0);

    /* Read results */
    checkErr(viScanf(vi, "%t", &buf));
    /* Print results */
    printf ("Instrument identification string: %s\n", buf);

    /* Close session */
    checkErr(viClose(vi));
    checkErr(viClose(defaultRM));

Error:

    if(error < VI_SUCCESS)
        printf("Visa Error Code: %X\n", error);
    printf("\nDone - Press Enter to Exit");
    getchar();

    return 0;
}
```

VISA-COM sample code

This example gets the instrument identification string using VISA-COM in C#.

The first thing to do is add a reference to the VISA-COM interop DLL, which is usually located at C:\Program Files\IVI Foundation\VISA\VisaCom\Primary Interop Assemblies\Ivi.Visa.Interop.dll.

```
using Ivi.Visa.Interop;

namespace WindowsApplication1
{
    public class IdnSample: System.Windows.Forms.Form
    {
private Ivi.Visa.Interop.FormattedIO488 ioDmm;
        //
    }
}

private void IdnSample_Load(object sender, System.EventArgs e)
{
    ioDmm = new FormattedIO488Class();

    SetAccessForClosed();
}

private void btnInitIO_Click(object sender, System.EventArgs e)
{
    try
    {
        ResourceManager grm = new ResourceManager();
        ioDmm.IO = (IMessage)grm.Open("GPIB::16::INSTR",
            AccessMode.NO_LOCK, 2000, "");
        ioDmm.IO.TerminationCharacterEnabled = true;
    }
    catch (SystemException ex)
    {
        MessageBox.Show("Open failed on " + this.txtAddress.Text + " " +
            ex.Source + " " + ex.Message, "IdnSample", MessageBoxButtons.OK,
            MessageBoxIcon.Error);
        ioDmm.IO = null;
    }
}
}
```

Specifications are subject to change without notice.
All Keithley trademarks and trade names are the property of Keithley Instruments, Inc.
All other trademarks and trade names are the property of their respective companies.



A G R E A T E R M E A S U R E O F C O N F I D E N C E

Keithley Instruments, Inc.

Corporate Headquarters • 28775 Aurora Road • Cleveland, Ohio 44139 • 440-248-0400 • Fax: 440-248-6168 • 1-888-KEITHLEY • www.keithley.com